

# Part 573 Safety Recall Report

# 22V-137

**Manufacturer Name :** General Motors, LLC**Submission Date :** MAR 08, 2022**NHTSA Recall No. :** 22V-137**Manufacturer Recall No. :** N222363740**Manufacturer Information :**

Manufacturer Name : General Motors, LLC

Address : 29427 Louis Chevrolet Road  
MAIL CODE 480-210-2V WARREN MI  
48093

Company phone : 586-596-1733

**Population :**

Number of potentially involved : NR

Estimated percentage with defect : 100 %

**Vehicle Information :**

Vehicle 1 : 2010-2017 GMC Terrain

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Manufacturing records were used to identify affected vehicles.

Vehicles built after 2017 model year use a different headlamp design and are not included in this recall.

Production Dates : MAY 21, 2009 - JUL 13, 2017

VIN Range 1 : Begin : NR End : NR

 Not sequential**Description of Noncompliance :**

Description of the Noncompliance : General Motors has decided that the lower beam headlamps in 2010-2017 GMC Terrain vehicles fail to conform, in part, to S10.15.6 of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, reflective devices, and associated equipment." A reflection caused by the headlamps' housing can project a narrow beam of light 80 degrees outboard and 45 degrees upward of each lamp's forward-center axis. When tested, the light emitted from this single point on each lamp may be brighter than the maximum designated in section S10.15.6 and Table XIX of FMVSS 108.

FMVSS 1 : 108 - Lamps, reflective devices, and assoc. Equipment

FMVSS 2 : NR

Description of the Safety Risk : These reflections may cause glare or be distracting to other drivers, increasing the risk of a crash.

Description of the Cause : The headlamp design allows a narrow beam of light from the lower beam lamp

to reflect off of the inner surface of the high beam reflector. The lamps' high beams are not affected by this condition.

Identification of Any Warning NR  
that can Occur :

## Involved Components :

Component Name 1 : HEADLAMP ASM  
Component Description : Headlamp Assembly  
Component Part Number : 23319179, 23319180, 23319181, 23319182, 84064624, 84064625, 84064626, 84064627

## Supplier Identification :

### Component Manufacturer

Name : I I Stanley Co., Inc  
Address : 1500 Hill-Brady Rd.  
Battle Creek Michigan 49037  
Country : United States

## Chronology :

GM petitioned NHTSA for an exemption from the notice and remedy provisions of the Federal Motor Vehicle Safety Act for this condition for all affected vehicles on June 7, 2019. On March 1, 2022, NHTSA notified GM that this petition was denied. On March 3, 2022, GM's SFADA reviewed NHTSA's denial and decided to conduct a noncompliance recall of the affected vehicles.

## Description of Remedy :

Description of Remedy Program : GM will provide a remedy description once a remedy is determined. Pursuant to 577.11, GM will provide reimbursement to owners for repairs according to the plan submitted on May 12, 2021.

How Remedy Component Differs NR  
from Recalled Component :

Identify How/When Recall Condition  
was Corrected in Production : These vehicles are a prior generation GMC Terrain. The current generation, beginning model year 2018, use a different headlamp design.

**Recall Schedule :**

Description of Recall Schedule : Dealers will be notified on March 8, 2022. GM estimates owner notification will begin on April 23, 2022.

Planned Dealer Notification Date : MAR 08, 2022 - MAR 08, 2022

Planned Owner Notification Date : APR 23, 2022 - APR 23, 2022

\* NR - Not Reported