Part 573 Safety Recall Report

Manufacturer Name :Keystone RV CompanySubmission Date :APR 13, 2022NHTSA Recall No. :22V-242Manufacturer Recall No. :22-431

Manufacturer Information :

Manufacturer Name : Keystone RV Company Address : PO Box 2000 2642 Hackberry Drive Goshen IN 46527 Company phone : 574-535-2100

Vehicle Information :

Vehicle 1: 2022-2022 Crossroads Zinger Vehicle Type: TRAILERS Body Style: Power Train: NR Descriptive Information: All floor plans Production Dates: MAR 01, 2022 - MAR 17, 2022 VIN Range 1: Weight: 4YDTZRS26NS372358 End: 4YDTZRN23NS372605 In the sequential

Description of Defect :

Description of the Defect :	It has been decided that the vehicles in the recall population have a furnace vent extension that may not have been installed.
FMVSS 1 :	NR
FMVSS 2 :	NR
Description of the Safety Risk :	If the vent extension is not installed, an operating furnace can draw combustion air/carbon monoxide into the living area leading to an increased risk of personal injury or death.
Description of the Cause :	The vent was not installed on random units by a new employee.
Identification of Any Warning that can Occur :	The carbon monoxide detector will alarm.

Involved Components :

The information contained in this report was submitted pursuant to 49 CFR §573



22V-242

Population :

Number of potentially involved :248Estimated percentage with defect :3 %

Part 573 Safety Recall Report

 $\mathbf{22V} \cdot \mathbf{242}$

Component Name 1 :Furnace - Vent Panel - ExteriorComponent Description :Furnace - Vent Panel - ExteriorComponent Part Number :637124

Supplier Identification :

Component Manufacturer

Name : NR Address : NR NR Country : NR

Chronology :

3/29/2022 – During a routine audit it was discovered that the exterior furnace vent panel was missing. Investigation opened. All affected Zinger units were put on hold and furnace vent was inspected. 4/7/2022 – Investigation concluded and scope completed.

Description of Remedy :

Description of Remedy Program :	The remedy is inspect the exterior vent to be sure that the exterior furnace vent panel was installed. If the exterior vent panel is not installed, the exhaust vent will need to be removed and an exterior vent panel is to be installed. Manufacturer Reimbursement Plan on file as of 10/07/2020. General reimbursement plan to be updated every two years. New vehicles are covered under warranty.
How Remedy Component Differs from Recalled Component :	The exterior vent panel is missing and will need to be installed.
Identify How/When Recall Condition was Corrected in Production :	Units were quarantined, inspected then repaired as indicated by inspection.

Recall Schedule :

Description of Recall Schedule :	Keystone will notify the dealers and owners of the recreational vehicles by letter. A final copy of the owner letter will be provided to NHTSA,
	along with the dealer repair procedures.
Planned Dealer Notification Date :	JUN 01, 2022 - JUN 01, 2022
Planned Owner Notification Date :	JUN 01, 2022 - JUN 01, 2022

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

Page 3

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573