

Part 573 Safety Recall Report

22V-293

Manufacturer Name : Cruiser RV**Submission Date :** MAY 05, 2022**NHTSA Recall No. :** 22V-293**Manufacturer Recall No. :** TBD**Manufacturer Information :**

Manufacturer Name : Cruiser RV

Address : 7805 North State Road 9
PO Box 130 Howe IN 46746

Company phone : 866-277-5630

Population :

Number of potentially involved : 24

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2022-2022 Cruiser Shadow Cruiser

Vehicle Type : TRAILERS

Body Style : OTHER

Power Train : NR

Descriptive Information : The population was determined by cross-referencing out Production PO numbers with affected Flex-Tech shipments

Production Dates : APR 12, 2022 - APR 14, 2022

VIN Range 1 : Begin : 5RXDB322XNN508446 End : 5RXDB2829NN508469 Not sequential**Description of Defect :**

Description of the Defect : Flex-Tech has informed us that the brass used in production may be porous causing small cracks in the LP Quick disconnect. Therefore the Quick disconnect/s in the LP gas system may be cracked.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : A Crack in the LP disconnect can cause an LP leak. Excessive LP gas leak may lead to an explosion and fire, which may lead to property damage and personal injury.

Description of the Cause : Porous brass from the manufacturer can lead to cracks in the fitting when tightening during assembly.

Identification of Any Warning that can Occur : The owner may notice the smell of LP gas near the quick disconnect mounted under the trailer.

Involved Components :

Component Name 1 : LP quick disconnect

Component Description : LP quick disconnect female

Component Part Number : 76290W

Supplier Identification :

Component Manufacturer

Name : Enerco Group

Address : 4560 West 160 St.
Cleveland Ohio 44135

Country : United States

Chronology :

4/6/22 was notified by Thor Corp of Forest Rivers findings of faulty disconnects. 4/7 to 4/20 FRC and Warranty claims investigation and analysis. 4/19 Received shipment and PO information from Flex Tech. 4/20 - found 2 warranty claims with no personal injury or property damage. 4/20 received letter from Flex-Tech stating LP disconnect issue with Flex-Techs findings. 4/26 safety committee meeting voted for a voluntary recall. An investigation called for to determine the affected unit scope and range.

Description of Remedy :

Description of Remedy Program : Cruiser will have an authorized dealer or repair center inspect the quick disconnect. If found faulty, the dealer will replace the LP quick connect and perform a drop pressure test to verify proper installation. This repair should take no more than 25 minutes to complete. This defect will be corrected at no expense to you, the owner. All Reimbursements will be covered by Cruiser's general reimbursement plan.

How Remedy Component Differs from Recalled Component : 76290W Quick Disconnect replacement will have the same part number 76290W

Identify How/When Recall Condition was Corrected in Production : On March 31, 2022, the supplier indicated that they had and were conducting immediate and complete internal retraining.

Recall Schedule :

Description of Recall Schedule : Cruiser will begin notifying owners/dealers once letters are approved

Planned Dealer Notification Date : JUL 01, 2022 - JUL 01, 2022

Planned Owner Notification Date : JUL 01, 2022 - JUL 01, 2022

* NR - Not Reported