

# Part 573 Safety Recall Report

# 22V-804

**Manufacturer Name :** Lamborghini (Automobili Lamborghini)**Submission Date :** OCT 26, 2022**NHTSA Recall No. :** 22V-804**Manufacturer Recall No. :** L636-R.01.22**Manufacturer Information :**

**Manufacturer Name :** Lamborghini (Automobili Lamborghini)  
**Address :** Via Modena 12  
 Sant'Agata Bolognese (BO) 40019 -  
 Italy 00 99999  
**Company phone :** 999

**Population :**

**Number of potentially involved :** 48  
**Estimated percentage with defect :** 100 %

**Vehicle Information :**

**Vehicle 1 :** 2022-2022 Lamborghini Urus  
**Vehicle Type :** LIGHT VEHICLES  
**Body Style :** SUV  
**Power Train :** GAS

**Descriptive Information :** The recall population was determined based on supplier production records of the affected infotainment main units. Only vehicles which have received suspect parts are included in the recall.

Vehicles not included in the recall are not equipped with suspect infotainment main units.

**Production Dates :** SEP 16, 2021 - SEP 23, 2021**VIN Range 1 : Begin :** ZPBUA1ZLONLA16098 **End :** ZPBUA1ZL8NLA16222  Not sequential**Description of Noncompliance :**

**Description of the Noncompliance :** Due to a hardware issue, the infotainment main unit in the center console may become damaged when the driver turns off the vehicle and the main unit shuts down. Upon the next start, the damaged infotainment unit would not work. In this case, all functionalities including the rearview camera image would not be available. In this case, the vehicle does not comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

**FMVSS 1 :** 111 - Rear visibility**FMVSS 2 :** NR

**Description of the Safety Risk :** The vehicle operator will notice upon starting the vehicle that the infotainment screen and the entire main unit is not working and that a rearview image is not displayed when reversing. A rearview camera screen that displays no image can reduce the driver's view of what is behind the

vehicle, increasing the risk of injury to people outside the vehicle.

**Description of the Cause :** Under certain conditions during shutdown of the infotainment main unit, an error in one of the voltage regulators may lead to damage to various components within the control unit causing a loss of all functions including the screen display. In this case, the infotainment main unit is damaged permanently and needs to be replaced.

**Identification of Any Warning that can Occur :** Upon start-up, the driver will notice that the infotainment screen in the center console is not working and not displaying an image which should prompt the driver to pay extra attention for objects behind the vehicle when reversing.

## Involved Components :

**Component Name 1 :** Infotainment Main unit  
**Component Description :** Infotainment Main unit  
**Component Part Number :** 4ML035092; 4ML035136

## Supplier Identification :

### Component Manufacturer

**Name :** Aptiv Services Deutschland GmbH  
**Address :** NR  
Hildesheim Foreign States 31135  
**Country :** Germany

## Chronology :

On July 2022 Automobili Lamborghini S.p.A. received information from Volkswagen Group that a certain number of infotainment units manufactured in 2021 could have been produced by the supplier with too high input voltage that could lead to the infotainment main unit becoming inoperative. An investigation started immediately to determine the possible involvement and to analyze field cases. August - September 2022, results from the investigation revealed that a batch of possible involved components were delivered to Lamborghini and tracked within the production systems. Additionally, the issue was also identified on 3 field cases that further confirmed the failure modality and involvement. September 2022, compliance with regulations in the affected markets was evaluated and discussed between the involved brands of Volkswagen Group. The assessment considered the failure mode and the requirements of FMVSS 111 – Rear Visibility, which requires the display of a “field of view” of certain objects behind the vehicle upon the initiation of a backing event. On October 19, 2022 the Lamborghini Product Safety Committee makes the determination of a non-compliance

for the US and Canada markets and decides a non-compliance recall.  
Lamborghini has not received any reports of a crash or injury due to this topic.

## Description of Remedy :

**Description of Remedy Program :** Affected vehicles will receive a new infotainment main unit at no cost to customers. Lamborghini will not offer a reimbursement plan under this recall as all affected vehicles are still under warranty.

**How Remedy Component Differs from Recalled Component :** The part numbers for the remedy and the recalled components are the same. The remedy infotainment main units have been produced outside of the suspect manufacturing period at the supplier.

**Identify How/When Recall Condition was Corrected in Production :** The supplier has introduced a measure to change the resistance at the voltage regulator to lower the input voltage on end 2021.

## Recall Schedule :

**Description of Recall Schedule :** Customer will be notified by registered mail and customer app while dealers through Lamborghini dealer portal.

**Planned Dealer Notification Date :** DEC 09, 2022 - DEC 09, 2022

**Planned Owner Notification Date :** DEC 16, 2022 - DEC 16, 2022

\* NR - Not Reported