

Part 573 Safety Recall Report

22V-810

Manufacturer Name : Hyundai Motor America**Submission Date :** OCT 27, 2022**NHTSA Recall No. :** 22V-810**Manufacturer Recall No. :** 237**Manufacturer Information :**

Manufacturer Name : Hyundai Motor America

Address : 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone : 800-633-5151

Population :

Number of potentially involved : 44,396

Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2018-2018 Hyundai Santa Fe Sport

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

Descriptive Information : The subject vehicles include 44,396 model year 2018 Hyundai Santa Fe Sport vehicles produced on 05/01/2017 through 05/10/2018 by Kia Georgia ("KaGA") for sale in the U.S. market.

Production Dates : MAY 01, 2017 - MAY 10, 2018

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : Certain model year 2018 Hyundai Santa Fe Sport vehicles produced for sale in the U.S. were omitted from Recall 218 (22V-056) VIN scope. The subject vehicles are equipped with Anti-Lock Brake System ("ABS") modules that could malfunction internally and cause an electrical short over time.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : An electrical short could result in significant overcurrent in the ABS module increasing the risk of an engine compartment fire while parked or driving.

Description of the Cause : Hyundai is actively investigating and will continue efforts recovering incident parts to determine the root cause(s).

Identification of Any Warning that can Occur :

1. Smoke from the engine compartment.
2. Burning/melting odor.
3. Illumination of the MIL and/or ABS light.

Involved Components :

Component Name 1 : ABS Assembly

Component Description : ABS module

Component Part Number : 58920-4Z300

Supplier Identification :**Component Manufacturer**

Name : Mando

Address : 32, Hamanho-gil
Poseung-eup Seoul Foreign States

Country : Korea, Republic of

Chronology :

Please see Attachment A for the requested chronology.

Description of Remedy :

Description of Remedy Program : Owners can continue driving these vehicles; however, Hyundai recommends parking their vehicles outside and away from structures until the recall remedy is completed. All owners of the subject vehicles will be notified by first class mail with instructions to bring their vehicles to a Hyundai dealer for repair. The ABS multi-fuse will be replaced with a revised one to mitigate the risk of a fire caused by an internal electrical short.

This remedy will be offered at no cost to owners for all affected vehicles, regardless of whether the affected vehicles are still covered under Hyundai's New Vehicle Limited Warranty. Additionally, Hyundai will provide owners of affected vehicles reimbursement for out-of-pocket expenses incurred to obtain a remedy for the recall condition in accordance with the reimbursement plan submitted to NHTSA on February 24, 2022.

How Remedy Component Differs from Recalled Component : The remedy ABS multi-fuse is rated at a lower amperage to effectively limit the operating current of the ABS module.

Identify How/When Recall Condition was Corrected in Production : N/A

Recall Schedule :

Description of Recall Schedule : Dealers and owners will be mailed in accordance with the listed dates in this section.

Planned Dealer Notification Date : DEC 26, 2022 - DEC 26, 2022

Planned Owner Notification Date : DEC 26, 2022 - DEC 26, 2022

* NR - Not Reported