

Part 573 Safety Recall Report

22V-857

Manufacturer Name : Shyft Group

Submission Date : FEB 10, 2023

NHTSA Recall No. : 22V-857

Manufacturer Recall No. : 22-16



Manufacturer Information :

Manufacturer Name : Shyft Group

Address : 1541 Reynolds Road
Charlotte MI 48813

Company phone : 517-543-6400

Population :

Number of potentially involved : 206

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2023-2023 Utilmaster Walk-In Vans

Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER

Power Train : GAS

Descriptive Information : Vehicles subject to this recall are equipped with a jump seat supplied by Seats, Inc. that may not have a safety clip installed. Shyft continues to investigate this matter.

Production Dates : AUG 16, 2022 - NOV 10, 2022

VIN Range 1 : Begin :

NR

End : NR

Not sequential

Description of Defect :

Description of the Defect : The jump seat on the passenger side may be missing a safety clip that prevents the pivot rod from sliding. Without this safety clip, the pivot rod could shift causing the seat to fall.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : A seat falling could increase the risk of an injury.

Description of the Cause : NR

Identification of Any Warning that can Occur : This could occur without warning.

Involved Components :

Component Name 1 : Jump Seat

Component Description : Seat

Component Part Number : 13676766

Supplier Identification :

Component Manufacturer

Name : Seats, Inc.

Address : 1515 Industrial St
Reedsburg Wisconsin 53959

Country : United States

Chronology :

On November 3, 2022, a jump seat collapsed on the vehicle assembly line. The seat was inspected and found to be missing a retaining clip on one side. On November 7, jump seats were inspected and approximately 9% were found to be missing the retaining clip on one side of the pivot rod. A review of purchase order and receipt history were pulled to identify the potential population. This was complete on November 10, 2022 and on November 11, 2022, Shyft determined a potential safety defect could exist in the affected vehicles.

Description of Remedy :

Description of Remedy Program : The required retaining clip will be installed at no charge. Vehicles subject to this recall are still within their warranty period. Any claims would be processed through the normal warranty process.

How Remedy Component Differs from Recalled Component : Jump seats that have been remedied will have retaining clips on both ends of the pivot rod where the jump seats subject to this recall would be missing a retaining clip on one end of the pivot rod.

Identify How/When Recall Condition was Corrected in Production : Jump seats subject to this condition were quarantined and inspected for the missing clip on November 7, 2022.

Recall Schedule :

Description of Recall Schedule : Shyft does not have dealers for this product line.

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : DEC 16, 2022 - DEC 16, 2022

* NR - Not Reported