

Part 573 Safety Recall Report

22V-905

Manufacturer Name : Hyundai Translead**Submission Date :** MAR 29, 2023**NHTSA Recall No. :** 22V-905**Manufacturer Recall No. :** 22E-081**Manufacturer Information :**

Manufacturer Name : Hyundai Translead

Address : 8880 Rio San Diego Drive, #500
San Diego CA 92108-164

Company phone : 819-574-1500

Population :

Number of potentially involved : 39

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2020-2021 Hyundai Translead BOM 30018702 Model VC2530152-JSW (Dry Van Trailer), BOM 30017890 Model VC2530152-AJS (Dry Van Trailer) and BOM 30017051 Model VR2506132-ARSW (Reefer Trailer)

Vehicle Type : TRAILERS

Body Style : OTHER

Power Train : NR

Descriptive Information : An improperly installed spring bracket may enable the pad retainer and spring bracket to detach from the brake and allow the brake pad to loosen. A loose brake pad may reduce brake effectiveness and may cut a tire valve resulting in a flat tire, and eventually cause damage to the brake pad or wheel. A detached spring bracket or pad retainer may come in contact with other vehicle parts or fall into the roadway, creating road debris and a potential traffic hazard increasing the risk of crash.

Production Dates : JUL 23, 2020 - SEP 02, 2021

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : An improperly installed spring bracket may enable the pad retainer and spring bracket to detach from the brake and allow the brake pad to loosen. A loose brake pad may reduce brake effectiveness and may cut a tire valve resulting in a flat tire, and eventually cause damage to the brake pad or wheel.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : A detached spring bracket or pad retainer may come in contact with other vehicle parts or fall into the roadway, creating road debris and a potential traffic hazard increasing the risk of crash.

Description of the Cause : NR

Identification of Any Warning NR
that can Occur :

Involved Components :

Component Name 1 : Haldex ModulT Gen II

Component Description : Air Disc Brake

Component Part Number : Haldex ModulT Gen II

Supplier Identification :

Component Manufacturer

Name : Haldex Brake Products Corporation

Address : 10930 North Pomona Avenue
Kansas City Missouri 64153

Country : United States

Chronology :

10/12/2022, we received the Important Safety Recall Notice # 22E-081 from Haldex where it described that the brake pad retaining assembly on a very small percentage of Haldex ModulT Gen II air disc brakes (ADB) produced in Monterrey, MX, between February 11, 2021, and September 16, 2022, may contain an improperly installed retaining clip.

10/17/2022. Haldex sent a potential list of units that were affected by 22E-081.

11/04/2022. Hyundai Translead identified units involved in 22E-081 but list did not match that of Haldex.

12/08/2022. After conference call between both parties, determined a total of 39 units to be potentially affected. Sent in notification to customers same day.

Description of Remedy :

Description of Remedy Program : Haldex will remedy the defect without charge. To remedy, the brake(s) need to be inspected by a trained technician and, if necessary, repaired. The inspection involves a visual check to determine whether the spring bracket is properly seated. Repair, if needed, involves adjusting the pad retainer slightly to allow the spring bracket to seat properly. Inspection and repair are relatively simple and are conducted without removing the wheel or lifting the vehicle, with minimal impact to service. This repair takes approximately 5 minutes per brake to perform. This repair will be done free of charge.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : We are to send the recall notification letter to the (3) customers involved as soon as NHTSA authorizes our letter. Once customer acknowledge receipt of the letter, they will coordinate inspection or repair directly with Haldex.

Planned Dealer Notification Date : DEC 08, 2022 - DEC 08, 2022

Planned Owner Notification Date : DEC 08, 2022 - DEC 08, 2022

* NR - Not Reported