

Stacy L. Balzer Operating Director Service Engineering Operations Ford Customer Service Division Ford Motor Company P. O. Box 1904 Dearborn, Michigan 48121

October 24, 2023

TO: All U.S. Ford and Lincoln Dealers

SUBJECT: NEW VEHICLE DEMONSTRATION / DELIVERY HOLD Safety Recall 22S35 - Supplement #1 Certain 2016 Model Year F-Super Duty Clockspring Contamination REF: NEW VEHICLE DEMONSTRATION / DELIVERY HOLD Advance Notice - Safety Recall 22S35 Dated June 21, 2023

New! <u>REASON FOR THIS SUPPLEMENT</u>

• **Parts Requirements:** The parts availability for Platinum series vehicles with a heated steering wheel has been updated.

AFFECTED VEHICLES

Vehicle	Model Year	Assembly Plant	Build Dates
Super Duty	2016	Kentucky Truck	December 1, 2014 through July 5, 2016

US population of affected vehicles: 313,139. Affected vehicles are identified in OASIS and FSA VIN Lists.

REASON FOR THIS SAFETY RECALL

In some of the affected vehicles, an opening in the rotor component underneath the anti-rotation pin can allow dust/contamination to enter the internals of the steering wheel clock spring. The customer may observe a progression of symptoms as the clock spring ribbon cable begins to disconnect, beginning with a loss of steering wheel illumination followed by inoperative steering wheel control switches, inoperative horn and finally an airbag malfunction light. If the airbag circuit disconnects, and a crash event of sufficient severity warrants a driver front airbag deployment, the airbag will not deploy.

SERVICE ACTION

Before demonstrating or delivering any new in-stock vehicles involved in this safety recall, dealers are to replace the clock spring. This service must be performed on all affected vehicles at no charge to the vehicle owner.

OWNER NOTIFICATION MAILING SCHEDULE

Owner letters stating that parts are available were mailed on July 10, 2023. Dealers should repair any affected vehicles that arrive at their dealerships, whether or not the customer has received a letter.

PLEASE NOTE:

Federal law requires dealers to complete this recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to \$26,315 per vehicle. Correct all vehicles in your new vehicle inventory before delivery.

New! <u>ATTACHMENTS</u>

- Administrative Information
- Labor Allowances and Parts Ordering Information
- Technical Information

QUESTIONS & ASSISTANCE

For questions and assistance, contact the Special Service Support Center (SSSC) via the SSSC Web Contact Site. The SSSC Web Contact Site can be accessed through the Professional Technician System (PTS) website using the SSSC link listed at the bottom of the OASIS VIN report screen or listed under the SSSC tab.

Sincerely,

Story & Bal

Stacy L. Balzer

Administrative Information Page 1 of 3

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD

Safety Recall 22S35-Supplement #1

Certain 2016 Model Year F-Super Duty Clockspring Contamination

MOBILE SERVICE REPAIR ASSESSMENT LEVEL

- All repairs in this program have the following assessment level.
- Light Mobile Service

MOBILE REPAIR RECOMMENDATIONS

- Confirm with the customer a mobile repair is feasible.
- Check OASIS before going to the customer's home or business to confirm if any other outstanding FSA needs to be completed.
- Transportation due to the simplicity of this repair, a specialty vehicle is not required.

MOBILE REPAIR ADDITIONAL INFORMATION

Please ensure the technician brings the following to the mobile repair destination:

- Printed Technical Instructions
- Printed Repair/Work Order or any other necessary documentation as customer copy(s)
 Documents could also be emailed to the customer.
- Shirt/uniform and vehicle graphic with the dealership or Ford logos are recommended.

MOBILE REPAIR QUESTIONS AND ASSISTANCE

- For questions and assistance, contact the Special Service Support Center (SSSC) via the SSSC Web Contact Site. Work with Dealership warranty administrator to create a SSSC contact ID#.
- Once an SSSC agent responds to the new contact ID#, you may opt to call the SSSC hotline: (800) 325-5621.

MOBILE REPAIR CLAIMING QUESTIONS

Dealers participating in the Remote Experience Program:

• Refer to Electronic Field Communication - EFC12071 2023 Remote Experience Program.

OASIS ACTIVATION

OASIS was activated on May 16, 2022.

FSA VIN LISTS ACTIVATION

FSA VIN Lists have been available through <u>https://web.fsavinlists.dealerconnection.com</u> since May 16, 2022. Owner names and addresses were available on July 28, 2023.

NOTE: Your FSA VIN Lists may contain owner names and addresses obtained from motor vehicle registration records. The use of such motor vehicle registration data for any purpose other than in connection with this recall is a violation of law in several states, provinces, and countries. Accordingly, you must limit the use of this listing to the follow-up necessary to complete this recall.

SOLD VEHICLES

• Ford has not issued instructions to stop selling/delivering or driving used vehicles under this safety recall. Owners should contact their dealers for an appointment to have their vehicles remedied as soon as practicable.

Administrative Information Page 2 of 3

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD Safety Recall 22S35-Supplement #1

Certain 2016 Model Year F-Super Duty Clockspring Contamination

SOLD VEHICLES - Continued

- Immediately contact any of your affected customers whose vehicles are not on your VIN list but are identified in OASIS. Give the customer a copy of the Owner Notification Letter (when available) and schedule a service date.
- Correct other affected vehicles identified in OASIS which are brought to your dealership.
- Dealers are to prioritize repairs of customer vehicles over repairs of new and used vehicle inventory.

STOCK VEHICLES

- Correct all affected units in your new vehicle inventory before delivery.
- Use OASIS to identify any affected vehicles in your used vehicle inventory.

DEALER-OPERATED RENTAL VEHICLES

The Fixing America's Surface Transportation (FAST) Act law effective June 2016 prohibits a rental company from selling, renting, or leasing vehicles subject to a safety or compliance recall. Please consult your legal counsel for legal advice.

TITLE BRANDED / SALVAGED VEHICLES

Affected title-branded and salvaged vehicles are eligible for this recall.

OWNER REFUNDS

- This safety recall must still be performed, even if the owner has paid for a previous repair. Claiming a refund will not close the recall on the vehicle.
- Ford Motor Company is offering a refund for owner-paid repairs covered by this recall if the repair was performed before the date indicated in the reimbursement plan, which is posted with this bulletin. Owners are directed to seek reimbursement through authorized dealers or, at their option, directly through Ford Motor Company at P.O. Box 6251, Dearborn, MI 48121-6251.
- Dealers are also pre-approved to refund owner-paid <u>emergency</u> repairs that were performed away from an authorized servicing dealer after the end date specified in the reimbursement plan. Non-covered repairs, or those judged by Ford to be excessive, will not be reimbursed.
- Refunds will only be provided for the cost associated with replacing the clockspring.

RENTAL VEHICLES

Rental vehicles are not approved for this program.

PICK-UP AND DELIVERY- Participating Dealers

Dealers participating in the Remote Experience Program:

• Refer to EFC12071, 2023 Remote Experience Program, Pickup & Delivery (PDL) Offset section for additional details.

Administrative Information Page 3 of 3

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD Safety Recall 22S35-Supplement #1

Certain 2016 Model Year F-Super Duty

Clockspring Contamination

ADDITIONAL REPAIR (LABOR TIME AND/OR PARTS)

Additional repairs identified as necessary to complete the FSA should be managed as follows:

- For related damage and access time requirements, refer to the Warranty and Policy Manual / Section 6 – Ford & Lincoln Program Policies / General Information & Special Circumstances for FSAs / Related Damage.
- For vehicles within new vehicle bumper-to-bumper warranty coverage, no SSSC approval is required, although related damage must be on a separate repair line with the "Related Damage" radio button checked.
 - Ford vehicles 3 years or 36,000 miles
- For vehicles outside new vehicle bumper-to-bumper warranty coverage, submit an Approval Request to the SSSC Web Contact Site before completing the repair.

CLAIMS PREPARATION AND SUBMISSION

- **Claim Entry**: Enter claims using Dealer Management System (DMS) or One Warranty Solution (OWS) online.
 - When entering claims, select claim type 31: Field Service Action. The FSA number 22S35 is the subcode.
 - For additional claims preparation and submission information, refer to the Recall and Customer Satisfaction Program (CSP) Repairs in the OWS User Guide.
- Related Damage/Additional labor and/or parts: Must be claimed as Related Damage on a separate repair line from the FSA with the same claim type and subcode as described in Claim Entry above.

IMPORTANT: Click the Related Damage Indicator radio button.

- **Refunds:** Submit refunds on a separate repair line.
 - Program Code: 22S35 Misc. Expense: ADMIN
 - Misc. Expense: REFUND Misc. Expense: 0.2 Hrs.
 - Multiple refunds should be submitted on one repair line and the invoice details for each repair should be detailed in the comments section of the claim.

• Pickup & Delivery:

- o Dealers participating in the Remote Experience Program -
 - Refer to EFC12071, 2023 Remote Experience Program, Pickup & Delivery (PDL) Offset section for additional details.

• Mobile Repair:

- o Dealers participating in the Remote Experience Program -
 - Refer to Electronic Field Communication EFC12071 2023 Remote Experience Program.

Labor Allowances and Parts Ordering Information

Page 1 of 2

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD

Safety Recall 22S35-Supplement #1

Certain 2016 Model Year F-Super Duty Clockspring Contamination

LABOR ALLOWANCES

Description	Labor Operation	Labor Time	
Replace Clockspring	22S35A	0.6 Hours	

New! PARTS REQUIREMENTS / ORDERING INFORMATION

Part Number	Description	Order Quantity	Claim Quantity
GC3Z-14A664-E	Clock spring (cover and contact plate assembly)	VIN- based	1
GC3Z-14A664-F	Clock spring (cover and contact plate assembly) for heated steering wheels	VIN- based	1
W705985-s437	Steering Wheel Retaining Bolt	1	1

Order your parts through normal order processing channels. To guarantee the shortest delivery time, an emergency order for parts must be placed.

DEALER PRICE

For the latest prices, refer to DOES II.

PARTS RETENTION, RETURN, & SCRAPPING

Follow the provisions of the Warranty and Policy Manual, Section 1 - WARRANTY PARTS RETENTION AND RETURN POLICIES. If a replaced part receives a scrap disposition, the part must be scrapped by all applicable local, state, and federal environmental protection and hazardous material regulations. Federal law prohibits selling motor vehicle parts or components that are under safety, compliance, or emissions recall.

EXCESS STOCK RETURN

The excess stock returned for credit must have been purchased from Ford Customer Service Division by Policy Procedure Bulletin 4000.

Labor Allowances and Parts Ordering Information Page 2 of 2

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD

Safety Recall 22S35-Supplement #1 Certain 2016 Model Year F-Super Duty

Clockspring Contamination

REPLACED FSA PARTS INSPECTION AND SIGN OFF

Effective March 1^{st,} 2021, all parts replaced as part of an FSA repair with a repair order open date of March 1^{st,} 2021, or later must be inspected and signed off on the repair order by a member of your dealer fixed operations management team or an employee of the task has been delegated to. If the task is to be delegated to a non-management employee, the employee needs to be someone other than the technician who completed the repair and needs to understand the importance of completing this task consistently and accurately.

- All parts replaced as part of an FSA repair should be returned to the parts department following the Warranty Parts Retention and Return Policies.
- Inspect the replaced parts to verify the FSA repair was completed.
- If the FSA repair is found to be complete, the designated employee signs the repair order line or parts return stamp area (electronic or hand signed) for the FSA repair indicating the parts were inspected and validated to have been replaced.
- After the parts have been inspected, they should be handled based on the guidance in the parts status report in the Online Warranty System (Hold, Return, CORE, Scrap, etc.). Please visit FMCDEALER > PARTS & SERVICE > WARRANTY ADMINISTRATION & WARRANTY PARTS RETURN for the latest <u>Immediate Scrap List</u> information.
- This process is subject to review during warranty audits for FSA repairs with a repair order open date of March 1^{st,} 2021, or later. Any eligible FSA claims requiring parts replacement found not to have been inspected and signed off during a warranty audit will be subject to chargeback and consideration for enrollment into the Dealer Incomplete Recall Repair Process.

Note: Other approvals (electronic or handwritten) for add-on repair lines, dealer-owned vehicle repairs, and repeat repairs do not qualify as FSA parts inspection approvals. The post-repair FSA parts inspection process (electronic or handwritten) is independent of other warranty approval requirements. The approval by the designated employee implies that the FSA parts were found to be replaced and must be able to be identified on the Repair Order. If multiple FSAs require approval on a single Repair Order, each applicable occurrence will require individual post-repair approval by the designated employee.

CERTAIN 2016 MODEL YEAR SUPER DUTY VEHICLES — CLOCKSPRING CONTAMINATION REPAIR

SERVICE PROCEDURE

1. Replace the clockspring. Follow the Workshop Manual (WSM) procedures in Section 501-20B.

2. Check and clear all Diagnostic Trouble Codes (DTCs).

IMPORTANT NOTE: Federal law prohibits selling motor vehicle parts or components that are under safety, compliance, or emissions recall. Unless a part is requested to be returned to Ford, all parts replaced under this FSA must be scrapped in accordance with all applicable local, state and federal environmental protection and hazardous material regulations. Refer to the Parts Retention, Return, & Scrapping section of the FSA dealer bulletin for further information.

