

JUNE 2022 Safety Recall 22V-362 (NHTSA) / 2022-265 (TC) Campaign Bulletin CB22-J-001B

IMPORTANT SAFETY RECALL

FUEL LINE QUICK CONNECTOR REPLACEMENT – 22V-362

(Transport Canada 2022-265)

To: Isuzu Commercial Truck Service Managers and Parts Managers

This notice and Campaign Bulletin CB22-J-001B are being sent to inform you about Safety Recall – Fuel Line Quick Connector Replacement in certain Isuzu commercial vehicles.

AFFECTED VEHICLES

• 2022MY Isuzu F-Series Vehicles Produced Through January 31, 2022

CONDITION

Isuzu Motors Limited has decided that a defect, which relates to motor vehicle safety, exists in certain 2022MY Isuzu F-Series vehicles produced through January 31, 2022. In the affected vehicles, the quick connector used to connect the fuel suction hose to the fuel inlet pipe of the engine was incorrectly sized with a larger quick connector. Because of the larger diameter of the quick connector, the sealing performance at this connection point is inadequate, resulting in the possibility of diesel fuel leakage from the connection point during the manufacturing or servicing process, which potentially **increases the risk of a fire**. It is also possible that the gap may allow outside air to be sucked into the fuel hose while the engine is running. Air intake into the fuel hose potentially increases the risk of engine stalling, which could lead to a crash.

CORRECTION

Isuzu dealers will replace the fuel line quick connector with a new, appropriately size, quick connector. This service will be performed **free of charge**.

OWNER NOTIFICATION

OWNER NOTIFICATION WILL BEGIN JUNE 24, 2022.

Please ensure that all appropriate personnel within your dealership are aware of this Safety Recall – Fuel Line Quick Connector Replacement.