

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

Subject: Brake Modulator Valves

Models Affected: Specific model years 2017-2023 Freightliner 114SD, Business Class M2, and Cascadia; and Western Star 47X, 49X, and 57X vehicles, manufactured May 3, 2016, through June 18, 2022.

General Information

Daimler Truck North America LLC (DTNA), on behalf of its Freightliner Trucks Division, and wholly owned subsidiary, Western Star Trucks Sales, Inc., has decided that a defect that relates to motor vehicle safety exists on the vehicles mentioned above.

On the affected vehicles, the single brake modulator valves may corrode, which during an Adaptive Cruise Control (ACC) braking event, could lead to a brake pull. This may result in a sudden change in vehicle direction due to uneven braking on the front axle increasing the risk of a motor vehicle crash.

A Daimler Truck North America authorized service facility will inspect and replace the brake modulator valves as required.

There are approximately 240,000 vehicles involved in this campaign.

REVISION: The work instruction has been updated to provide clarity of repair and parts needed.

Additional Repairs

Dealers must complete all outstanding Recall and Field Service campaigns prior to the sale or delivery of a vehicle. A Dealer will be liable for any progressive damage that results from its failure to complete campaigns before sale or delivery of a vehicle.

Owners may be liable for any progressive damage that results from failure to complete campaigns within a reasonable time after receiving notification.

Work Instructions

Please refer to the attached work instructions. Prior to performing the campaign, check the vehicle for a completion sticker (Form WAR260).

Replacement Parts

Replacement parts are now available and can be obtained by ordering the kit and/or part number(s) listed below from your facing Parts Distribution Center.

If our records show your dealership has ordered any vehicle(s) involved in campaign number FL958, a list of the customers and vehicle identification numbers will be available on DTNAPortal. Please refer to this list when ordering parts for this recall.

Table 1 - Replacement Parts for FL958

Campaign Number	Kit Number	Part Description	Part Number	Qty.
FL958A-G	25-FL958-000	SOLENOID,ABS MODULATOR VALVE,	25-FL958-001	2 ea
		WASHER-FLAT,STEEL,HARDENED,3/8 IN	23-09114-002	4 ea
		SPACER-AL,.375 ID.75 O	23-12240-025	4 ea
		SCREW-HEX FLANGE,M8X1.25X90	23-14064-090	4 ea
		NUT	N913023 008003	4 ea
FL958C		NUT-HEX,FLANGE,LOCK,5/16-18,ZINC	23-13861-105	4 ea
FL958D		SPACER-AL,.406IDX1 ODX	23-11427-075	4 ea

Table 1 continued on pg. 2

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

Campaign Number	Kit Number	Part Description	Part Number	Qty.
FL958E		SCREW	N910105 008042	4 ea
FL958F		SCREW	N910105 008042	4 ea
FL958G		SCREW	23-12489-095	4 ea
		NUT-HEXFLGH,PILOTED,M8X1.25	23-14525-000	
		SPACER-AL,,406IDX1 ODX	23-11427-075	
FL958A-G		BLANK COMPLETION STICKER	WAR260	1 ea

Table 1 continued from pg. 2

Removed Parts

U.S. and Canadian Dealers, please follow Warranty Failed Parts Tracking shipping instructions for the disposition of all removed parts. Export distributors, please destroy removed parts unless otherwise advised.

Labor Allowance

Table 2 - Labor Allowance

Campaign Number	Procedure	Time Allowed (hours)	SRT Code	Corrective Action
FL958A-G	Inspect and replace brake modulator valves	1.0	996-R214B	12-Repair Recall/Campaign
FL958B	Inspect brake modulator valves	0.1	996-R214A	06-Inspect

Table 2

IMPORTANT:When the Recall has been completed, locate the base completion label in the appropriate location on the vehicle, and attach the red completion sticker provided in the recall kit (Form WAR260). If the vehicle does not have a base completion label, clean a spot on the appropriate location of the vehicle and first attach the base completion label (Form WAR259). If a recall kit is not required or there is no completion sticker in the kit, write the recall number on a blank sticker and attach it to the base completion label.

Claims for Credit

You will be reimbursed for your parts, labor, and handling (landed cost for Export Distributors) by submitting your claim through the Warranty system within 30 days of completing this campaign. Please reference the following information in OWL:

- Claim type is **Recall Campaign**.
- In the Campaign field, enter the campaign number and appropriate condition code (e.g. **FL958-A, FL958-B, etc.**).
- In the Primary Failed Part Number field, enter **25-FL958-000**.
- In the Parts field, enter the appropriate kit or part number(s) as shown in the Replacement Parts Table.
- In the Labor field, first enter the appropriate SRT from the Labor Allowance Table. Administrative time will be included automatically as SRT 939-6010A for 0.3 hours.
- The VMRS Component Code is **F99-999-005** and the Cause Code is **A1 - Campaign**.
- **U.S. and Canada -- Reimbursement for Prior Repairs.** When a customer asks about reimbursement, please do the following:
 - Accept the documentation of the previous repair.
 - Make a brief check of the customer’s paperwork to see if the repair may be eligible for reimbursement. (See the "Copy of Owner Letter" section of this bulletin for reimbursement guidelines.)
 - Submit an OWL Recall Pre-Approval Request for a decision.

January 2024

FL958A-G

NHTSA #22V-817

Transport Canada #2022-626

SECOND REVISED BULLETIN

- Include the approved amount on your claim in the Other Charges section.
- Attach the documentation to the pre-approval request.
- If approved, submit a based on claim for the pre-approval.
- Reimburse the customer the appropriate amount.

IMPORTANT: OWL must be viewed prior to performing the recall to ensure the vehicle is involved and the campaign has not been previously completed. Also, check for a completion sticker prior to beginning work.

U.S. and Canadian dealers, contact the Warranty Campaigns Department via Web inquiry at DTNAPortal.com/WSC, if you have any questions or need additional information. Export distributors, submit a Web inquiry or contact your International Service Manager.

U.S. and Canadian Dealers: To return excess kit inventory related to this campaign, U.S. dealers must submit a Parts Authorization Return (PAR) to the Memphis PDC. Canadian dealers must submit a PAR to their facing PDC. All kits must be in resalable condition. PAR requests must include the original purchase invoice number. Export Distributors: Excess inventory is not returnable.

The letter notifying U.S. and Canadian vehicle owners is included for your reference.

Please note that the National Traffic and Motor Vehicle Safety Act, as amended (Title 49, United States Code, Chapter 301), requires the owner's vehicle(s) be corrected within a reasonable time after parts are available to you. The Act states that failure to repair a vehicle within 60 days after tender for repair shall be prima facie evidence of an unreasonable time. However, circumstances of a particular situation may reduce the 60 day period. Failure to repair a vehicle within a reasonable time can result in either the obligation to (a) replace the vehicle with an identical or reasonably equivalent vehicle, without charge, or (b) refund the purchase price in full, less a reasonable allowance for depreciation. The Act further prohibits dealers from selling a vehicle unless all outstanding recalls are performed. Any lessor is required to send a copy of the recall notification to the lessee within 10 days. Any subsequent stage manufacturer is required to forward this notice to its distributors and retail outlets within five working days.

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

Copy of Notice to Owners

Subject: Brake Modulator Valves

This notice is sent to you in accordance with the requirements of the Motor Vehicle Safety Act. This is to inform you that your vehicle may contain a defect that could affect the safety of a person.

Daimler Truck North America LLC (DTNA), on behalf of its Freightliner Trucks Division, and wholly owned subsidiary, Western Star Truck Sales, Inc., has decided that a defect which relates to motor vehicle safety exists on specific model years 2017-2023 Freightliner 108SD, 114SD, Business Class M2, and Cascadia; and Western Star 47X, 48X, 49X, and 57X vehicles manufactured March 3, 2016, through June 18, 2022.

On the affected vehicles, the single brake modulator valve may corrode, which during an Adaptive Cruise Control (ACC) braking event, could lead to a brake pull. This may result in a sudden change in vehicle direction due to uneven braking on the front axle increasing the risk of a motor vehicle crash.

A Daimler Truck North America authorized service facility will inspect and replace the brake modulator valve as required. The Recall will take approximately 2 hours and will be performed free of charge.

Please contact an authorized Daimler Truck North America dealer to arrange to have the Recall performed and to ensure that parts are available at the dealership. To locate an authorized dealer, search online at <https://northamerica.daimlertruck.com/contact-us>. Scroll down to "Locate a Dealer" and select the appropriate brand. You may also confirm your vehicle's involvement in this recall at the following URL: <https://dtna-dlrinfo.prd.freightliner.com:48518/VinLookup/vin-module/getVinLookupPage>.

You may be liable for any progressive damage that results from your failure to complete the Recall within a reasonable time after receiving notification.

If you do not own the vehicle that corresponds to the identification number(s) which appears on the Recall Notification, please return the notification to the Warranty Campaigns Department in the postage-paid envelope with any information you can furnish that will assist us in locating the present owner. If you have leased this vehicle, Federal law requires that you forward this notice to the lessee within 10 days. If you are a subsequent stage manufacturer, Federal law requires that you forward this notice to your distributors and retail outlets within five working days. If you have paid to have this recall condition corrected prior to this notice, you may be eligible to receive reimbursement. Please see the reverse side of this notice for details.

If you have questions about this Recall, please contact the Warranty Campaigns Department at (800) 547-0712, 7:00 a.m. to 4:00 p.m. Pacific Time, Monday through Friday, e-mail address dtna.warranty.campaigns@daimlertruck.com. If you wish to submit a complaint about this recall, you can contact Transport Canada road safety, 80 rue Noel, Gatineau, Quebec J8Z 0A1 or call (800) 333-0510.

We regret any inconvenience this action may cause but feel certain you understand our interest in motor vehicle safety.

WARRANTY CAMPAIGNS DEPARTMENT

Enclosure

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

Copy of Notice to Owners

Subject: Brake Modulator Valves

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act.

Daimler Truck North America LLC (DTNA), on behalf of its Freightliner Trucks Division, and wholly owned subsidiary, Western Star Truck Sales, Inc., has decided that a defect which relates to motor vehicle safety exists on certain model years 2017-2023 Freightliner 114SD, Business Class M2, and Cascadia; and Western Star 47X, 49X, and 57X vehicles, manufactured March 3, 2016, through June 18, 2022.

On the affected vehicles, the single brake modulator valve may corrode, which during an Adaptive Cruise Control (ACC) braking event, could lead to a brake pull. This may result in a sudden change in vehicle direction due to uneven braking on the front axle increasing the risk of a motor vehicle crash.

A Daimler Truck North America authorized service facility will inspect and replace the brake modulator valve as required. The Recall will take approximately 2 hours and will be performed free of charge.

Please contact an authorized Daimler Truck North America dealer to arrange to have the Recall performed and to ensure that parts are available at the dealership. To locate an authorized dealer, search online at <https://northamerica.daimlertruck.com/contact-us>. Scroll down to "Locate a Dealer" and select the appropriate brand. You may also confirm your vehicle's involvement in this recall at the following URL: <https://dtna-dlinfo.prd.freightliner.com:48518/VinLookup/vin-module/getVinLookupPage>.

You may be liable for any progressive damage that results from your failure to complete the Recall within a reasonable time after receiving notification.

If you do not own the vehicle that corresponds to the identification number(s) which appears on the Recall Notification, please return the notification to the Warranty Campaigns Department in the postage-paid envelope with any information you can furnish that will assist us in locating the present owner. If you have leased this vehicle, Federal law requires that you forward this notice to the lessee within 10 days. If you are a subsequent stage manufacturer, Federal law requires that you forward this notice to your distributors and retail outlets within five working days. If you have paid to have this recall condition corrected prior to this notice, you may be eligible to receive reimbursement. Please see the reverse side of this notice for details.

If you have questions about this Recall, please contact the Warranty Campaigns Department at (800) 547-0712, 7:00 a.m. to 4:00 p.m. Pacific Time, Monday through Friday, e-mail address dtna.warranty.campaigns@daimlertruck.com. If you are not able to have the defect remedied without charge and within a reasonable time, you may wish to submit a complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE., Washington, DC 20590; or call the Vehicle Safety Hotline at (888) 327-4236 (TTY: 800-424-9153); or to <http://www.nhtsa.gov>.

We regret any inconvenience this action may cause but feel certain you understand our interest in motor vehicle safety.

WARRANTY CAMPAIGNS DEPARTMENT

Enclosure

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

Reimbursement to Customers for Repairs Performed Prior to Recall

If you have already **paid** to have this recall condition corrected you may be eligible to receive reimbursement.

Requests for reimbursement may include parts and labor. Reimbursement may be limited to the amount the repair would have cost if completed by an authorized Daimler Truck North America LLC dealer. The following documentation must be presented to your dealer for consideration for reimbursement.

Please provide original or clear copies of all receipts, invoices, and repair orders that show:

- The name and address of the person who paid for the repair
- The Vehicle Identification Number (VIN) of the vehicle that was repaired
- What problem occurred, what repair was done, when the repair was done
- Who repaired the vehicle
- The total cost of the repair expense that is being claimed
- Proof of payment for the repair (such as the front and back of a cancelled check or a credit card receipt)

Reimbursement will be made by check from your Daimler Truck North America LLC dealer.

Please speak with your Daimler Truck North America LLC authorized dealer concerning this matter.

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

Work Instructions

Subject: Inspect and Replace Brake Modulator Valves

Models Affected: Specific model years 2017-2023 Freightliner 114SD, Business Class M2, and Cascadia; and Western Star 47X, 49X, and 57X vehicles, manufactured May 3, 2016, through June 18, 2022.

REVISION: The work instruction has been updated to provide clarity of repair and parts needed.

IMPORTANT: Due to parts unavailability, this campaign will be released in phases. The phase will be determined based on corrosion factors. You must confirm a vehicle displays on the OWL coverage information screen before proceeding.

PLEASE DO NOT OVERSTOCK THE KITS, AND DO NOT PERFORM ON THE VEHICLES THAT ARE NOT ACTIVE IN OWL.

FL958B – Front Modulator Valve Inspection

1. Check the base label (Form WAR259) for a completion sticker for FL958 (Form WAR260), indicating this work has been done. The base label is usually located on the passenger-side door, about 12 inches (30 cm) below the door latch. If a completion sticker is present, no work is needed. If a completion sticker is not present, proceed to the next step.
2. Park the vehicle on a level surface, shut down the engine, and set the parking brake. Chock the tires.
3. Open the hood.

NOTE: Both the left- and right-hand modulator valves must be inspected. If either one of the modulator valves is bad, replace both modulator valves.

4. Remove the connector from the valve, and inspect the part number underneath the connector. See [Fig. 1](#).

Good part numbers → **472 196 046 0** and **472 196 051 0**

Bad part numbers → **472 196 025 0** and **472 196 037 0**

- If the part numbers are good, install the connector. Clean a spot on the base label (Form WAR259), and attach a campaign completion sticker for FL958 (Form WAR260), indicating this work has been completed.
- If at least one of the part numbers is bad, go to the replacement procedure for the specified group, and replace both the modulator valves.

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

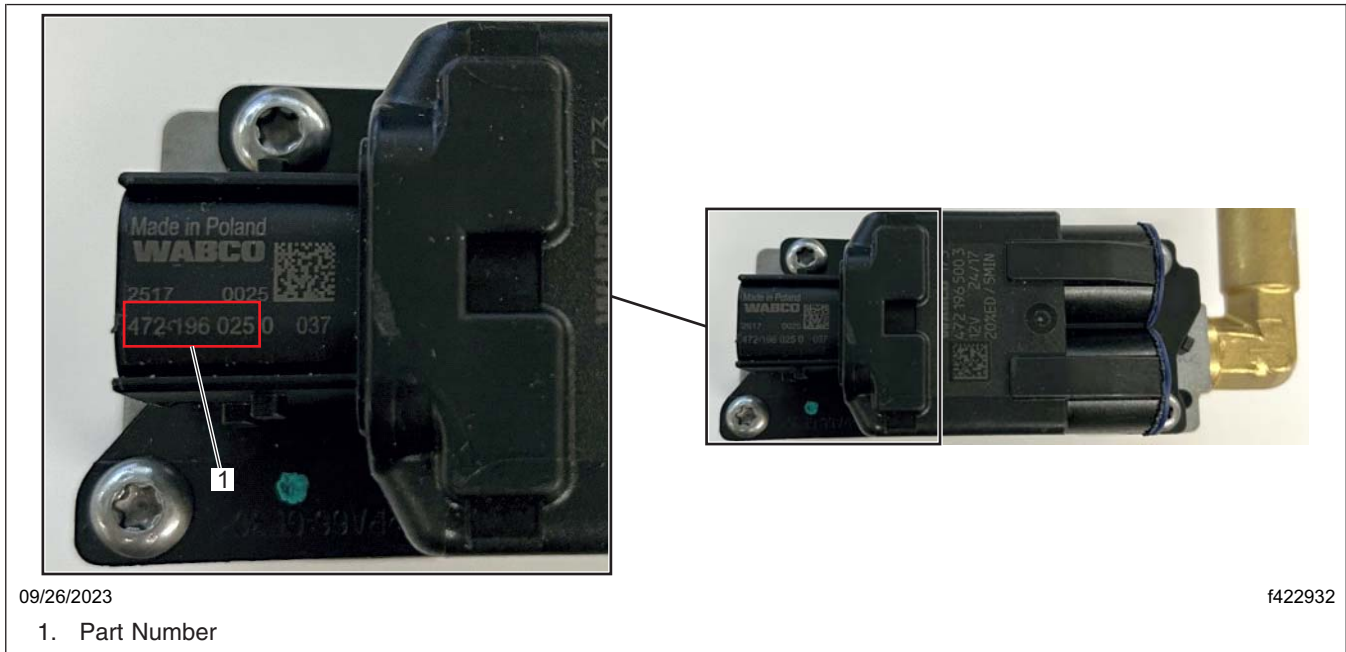


Fig. 1, Modulator Valve

FL958A, B – Front Modulator Valve Replacement

NOTE: Both the left- and right-hand modulator valves must be replaced. Use all of the parts in the recall kit, listed in [Table 3](#).

Kit Number	Part Description	Part Number	Qty.
25-FL958-000	SOLENOID,ABS MODULATOR VALVE	25-FL958-001	2 ea
	WASHER-FLAT,STEEL,HARDENED,3/8 IN	23-09114-002	4 ea
	SPACER-AL.,.375 ID,.75 O	23-12240-025	4 ea
	SCREW-HEX FLANGE,M8X1.25X90	23-14064-090	4 ea
	NUT-HEX,FLANGE,LOCK,5/16-18,ZINC	N913023 008003	4 ea

Table 3

1. Locate the modulator valve on the front-left frame rail, behind the wheel. See [Fig. 2](#)

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

2. Use the flat end of a screwdriver to disconnect the modulator valve electrical connector located on the front side of the frame rail, above the front axle. See [Fig. 3](#).

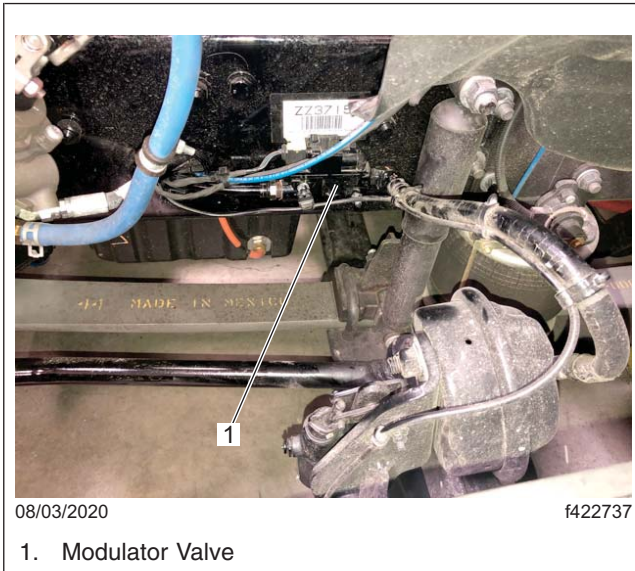


Fig. 2, Location of the Modulator Valve

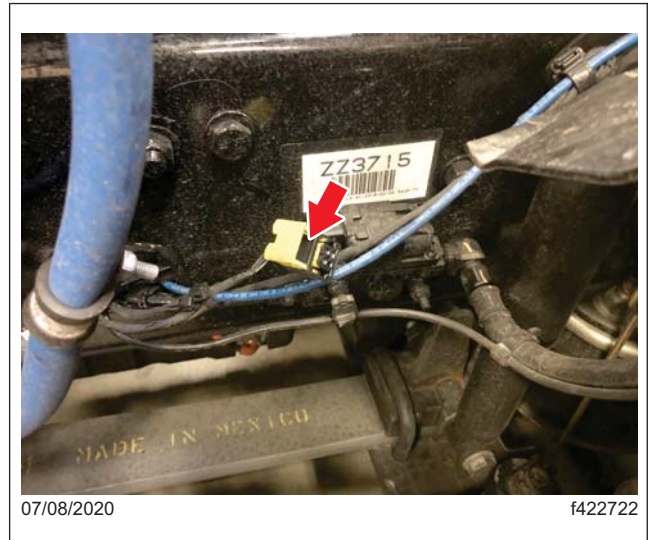


Fig. 3, Location of the Electrical Connector

3. Remove the antilock braking system (ABS) zip tie from the modulator mounting bolt. See [Fig. 4](#).

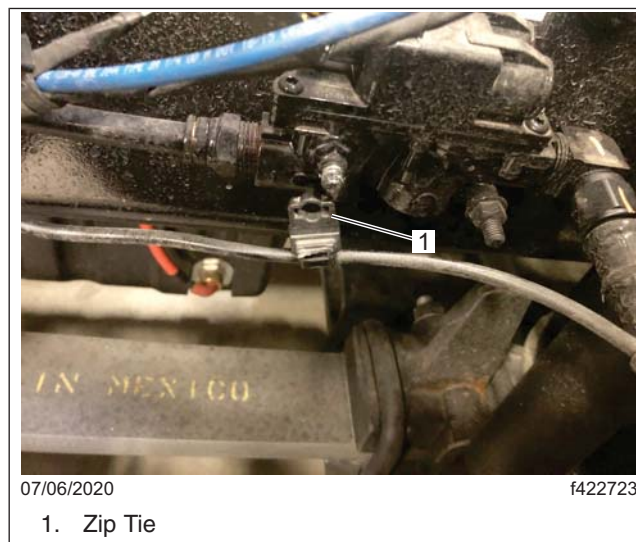


Fig. 4, ABS Zip Tie

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

4. Use special tool (NQ307001-1) supplied in special tool kit NQ307001, referenced in Tool Letter 18 TL-15, to disconnect the plastic air line from the modulator valve. See [Fig. 5](#) and [Fig. 6](#).

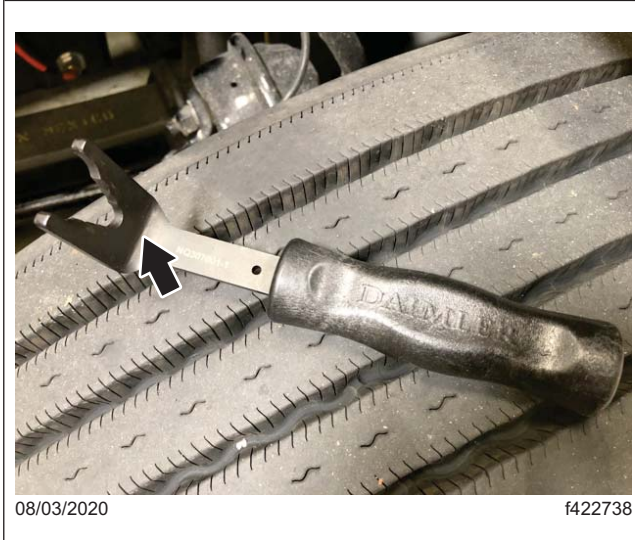


Fig. 5, Special Tool (NQ307001-1)

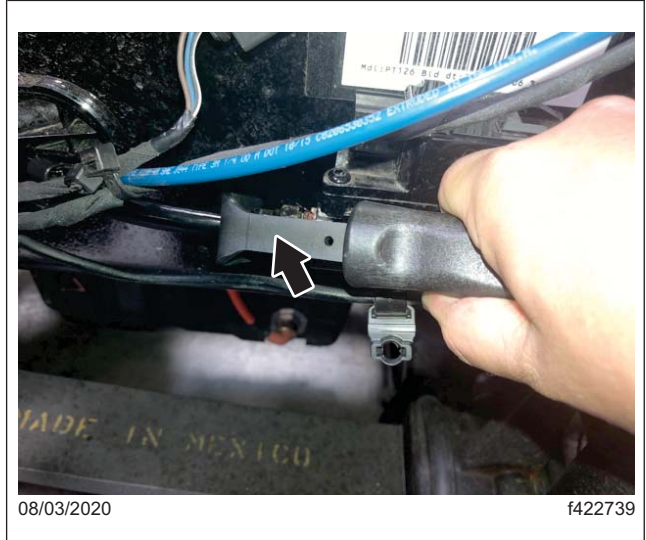


Fig. 6, Disconnecting the Plastic Air Line

5. Use a 7/8-inch wrench to remove the quick-connect fitting from the modulator. See [Fig. 7](#).
6. Use a 7/8-inch wrench to remove the threaded air line that connects the modulator to the brake chamber. See [Fig. 8](#).


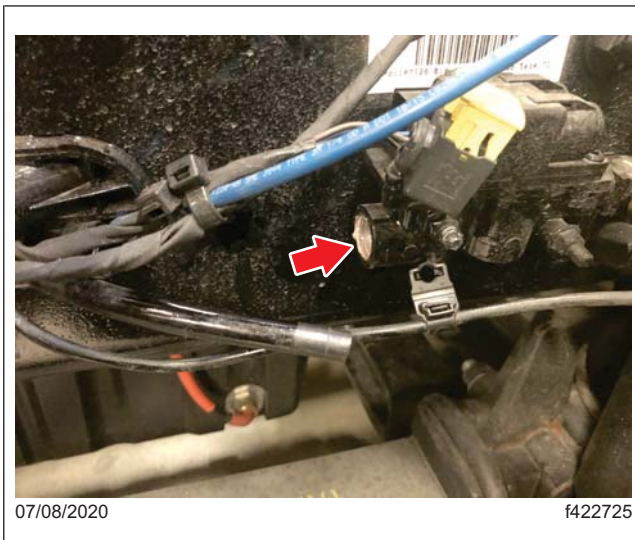


Fig. 7, Disconnecting the Quick-Connect Fitting

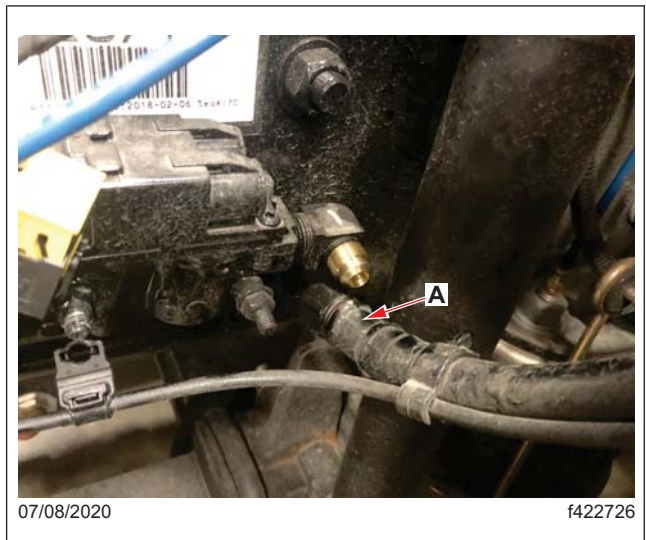

A. Remove the threaded air line that connects the modulator valve to the brake chamber.

Fig. 8, Removing the Threaded Air Line

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

7. Use a 23-mm wrench to loosen the brake chamber air line fitting on the modulator valve. See [Fig. 9](#).

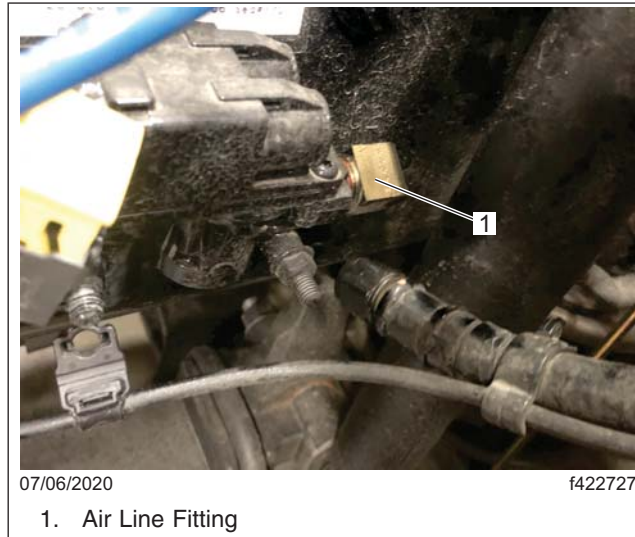


Fig. 9, Loosening the Brake Chamber Air Line Fitting

8. Use a 1/2-inch socket wrench to remove the two modulator valve mounting bolts, then remove the modulator valves from the vehicle.
9. Use a 23-mm wrench to remove the brake chamber air line fitting from the modulator valve.
IMPORTANT: The quick connect fittings come with pre-applied dry sealant (Vibra-Seal) which can be reused up to five times. Replace the fitting with a new one if the thread sealant is no longer usable.
10. Use a 23-mm wrench to install the brake chamber air line fitting on the new modulator valve.
11. Use a 1/2-inch socket wrench along with the new bolts, spacers, and washers (supplied in the kit) to install the modulator on the vehicle. Tighten the bolts 11 lbf-ft (15 N·m). See [Fig. 10](#), [Fig. 11](#), [Fig. 12](#), and [Fig. 13](#).

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN



Fig. 10, 25-FL958-000 Kit Components

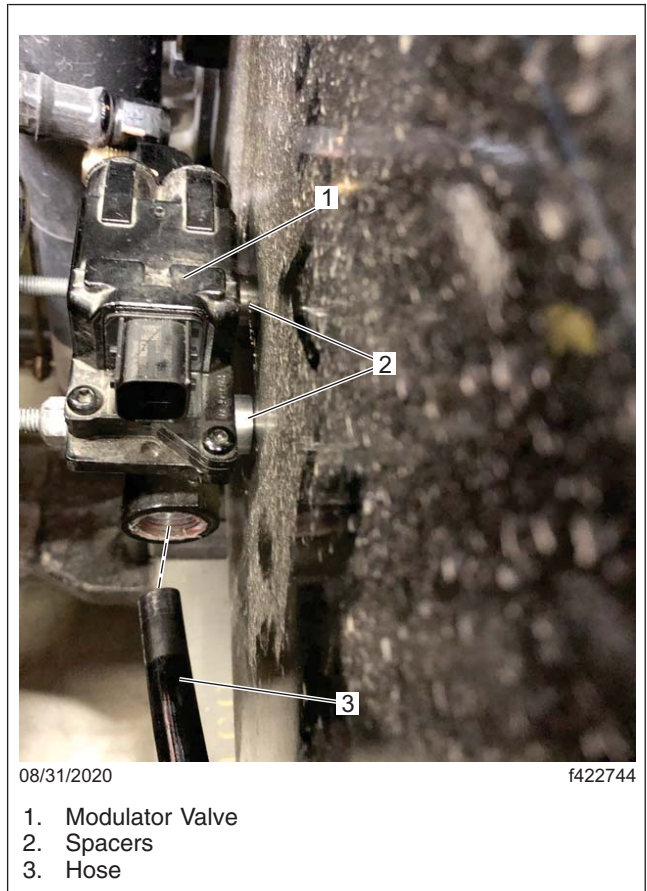


Fig. 11, Installing the Spacers

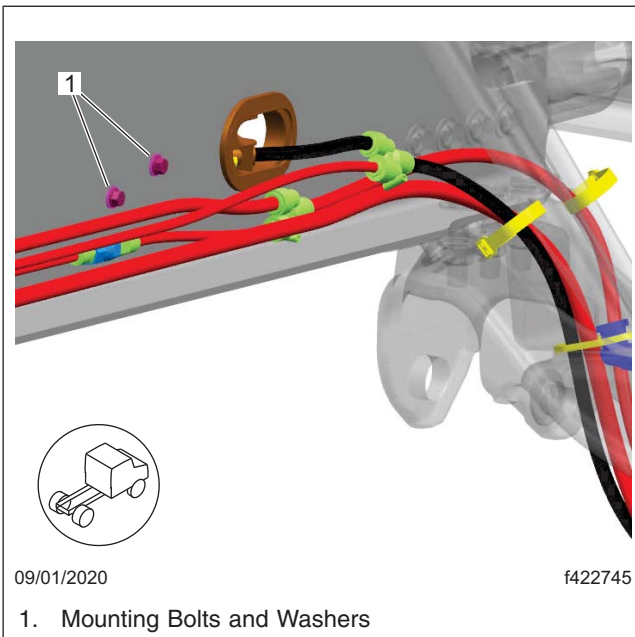


Fig. 12, Modulator Valve Fasteners, Inside Frame Rail View

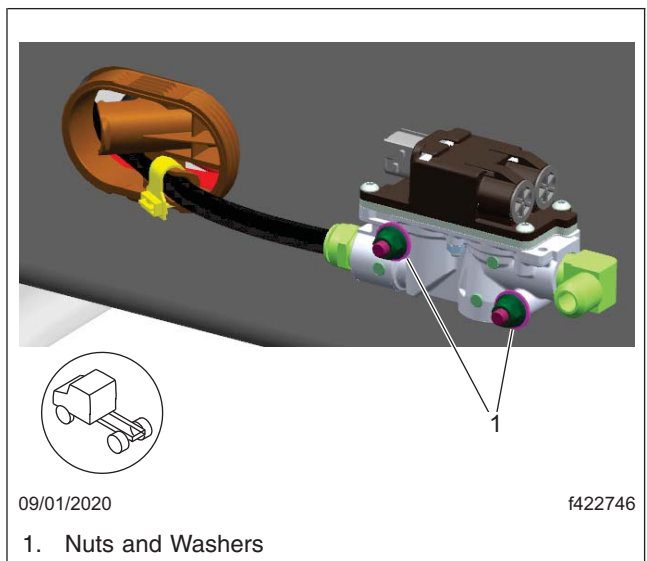


Fig. 13, Modulator Valve Fasteners, Outside Frame Rail View

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

12. Use a 7/8-inch wrench to install the threaded air line that connects the modulator valve to the brake chamber.
- IMPORTANT: The quick connect fittings come with pre-applied dry sealant (Vibra-Seal) which can be reused up to five times. Replace the fitting with a new one if the thread sealant is no longer usable.
13. Use a 7/8-inch wrench to install the quick-connect fitting on the modulator valve.
 14. Attach the plastic air line to the modulator.
 15. Install the ABS zip tie on the modulator mounting bolt (to prevent chafing).
 16. Connect the modulator valve electrical connector.
 17. Repeat the procedure for the modulator valve on the other side of the vehicle.
 18. Close the hood.
 19. Build air pressure to check for leaks and perform six full brake applications in the parking lot to verify proper brake performance.
 20. Clean a spot on the base label (Form WAR259), and attach a campaign completion sticker for FL958 (Form WAR260), indicating this work has been completed.

FL958C – Front Modulator Valve Replacement

For vehicles belonging to group C, the replacement procedure is the same as groups A and B, but the location of the valves is different. Location of the modulator valves is shown in [Fig. 14](#) and [Fig. 15](#).

Use all of the parts in the recall kit, listed in [Table 4](#), with the exception of the nut (N913023 008003), spacer (23-12240-025), and screw (23-14064-090). Use the nut (23-13861-105, 4 each) from the group C parts list, listed in [Table 4](#).

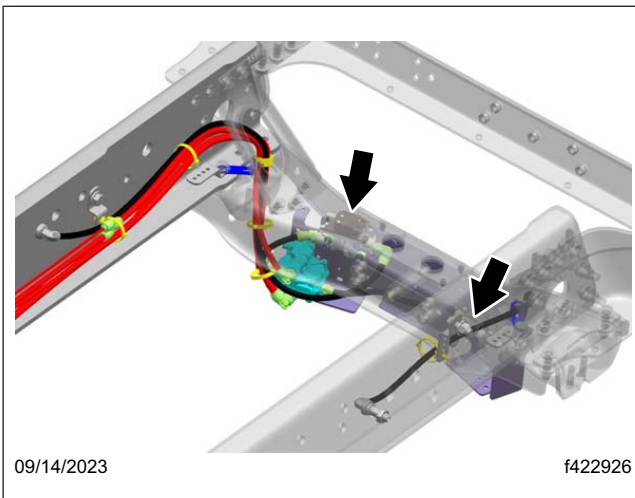


Fig. 14, Modulator Valve Mounting under the Cross Member

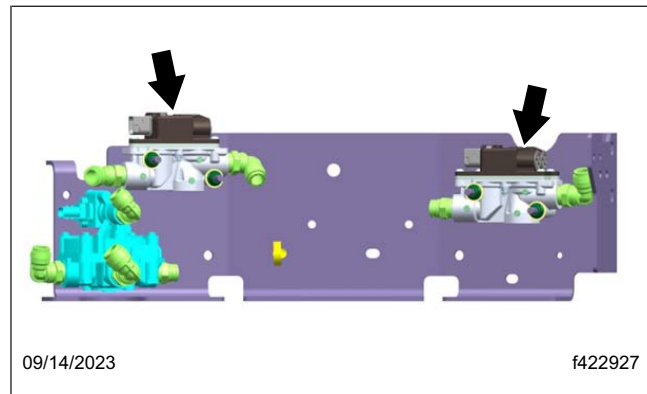


Fig. 15, Modulator Valve Mounting Location

Kit Number/ Group	Part Description	Part Number	Qty.
25-FL958-000	SOLENOID,ABS MODULATOR VALVE	25-FL958-001	2 ea
	WASHER-FLAT,STEEL,HARDENED,3/8 IN	23-09114-002	4 ea
	SPACER-AL.,375 ID,75 O	23-12240-025	4 ea
	SCREW HEX FLANGE,M8X1.25X90	23-14064-090	4 ea
	NUT HEX,FLANGE,LOCK,5/16-18,ZINC	N913023-008003	4 ea
FL958C	NUT	23-13861-105	4 ea

Table 4

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

FL958D – Front Modulator Valve Replacement

For vehicles belonging to group D, the replacement procedure is the same as groups A and B, but the location of the valves is different. Location of the modulator valves is shown in **Fig. 16**.

Use all of the parts in the recall kit, listed in **Table 5**, with the exception of the spacer (23-12240-025). Use the spacer (23-11427-075, 4 each) from the group D parts list, listed in **Table 5**, instead of the spacer in the recall kit.

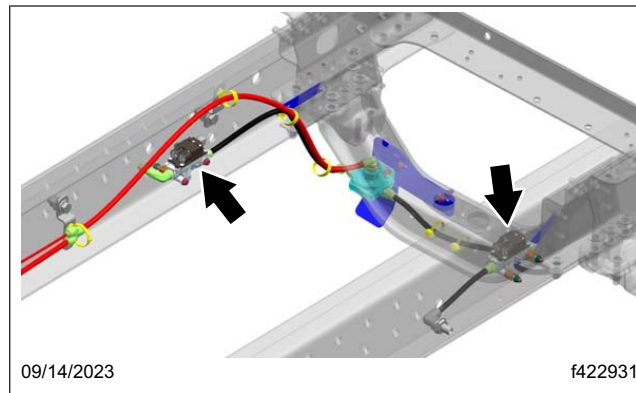


Fig. 16, Modulator Valve Mounting Inside the Frame Rails

Kit Number/ Group	Part Description	Part Number	Qty.
25-FL958-000	SOLENOID,ABS MODULATOR VALVE	25-FL958-001	2 ea
	WASHER-FLAT,STEEL,HARDENED,3/8 IN	23-09114-002	4 ea
	SPACER-AL,.375 ID-.75 O	23-12240-025	4 ea
	SCREW-HEX FLANGE,M8X1.25X90	23-14064-090	4 ea
	NUT-HEX,FLANGE,LOCK,5/16-18,ZINC	N913023 008003	4 ea
FL958D	SPACER-AL,.406IDX1 ODX	23-11427-075	4 ea

Table 5

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

FL958E – Front Modulator Valve Replacement

For vehicles belonging to group E, the replacement procedure is the same as groups A and B, but the location of the valves is different. Location of the modulator valves is shown in [Fig. 17](#) and [Fig. 18](#).

Use all of the parts in the recall kit, listed in [Table 6](#), with the exception of the screw (23-14064-090). Use the screw (N910105 008042, 4 each) from the group E parts list, listed in [Table 6](#). Use only the spacers on the solenoid that is on the engine crossmember and parallel to the engine crossmember. Do not use the spacers on the solenoid that is on the frame rail and perpendicular to the frame rail.

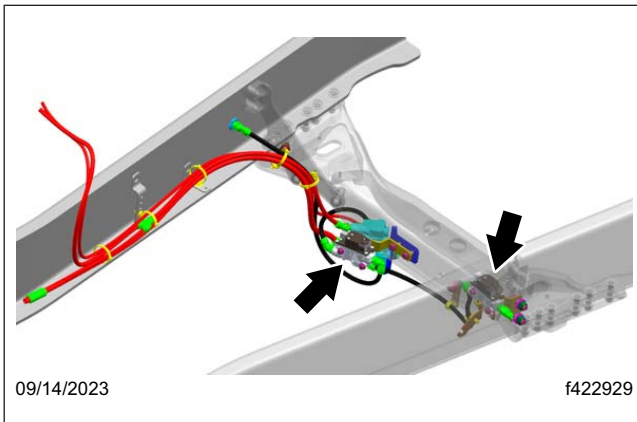


Fig. 17, Modulator Valve Mounting Inside the Frame Rails

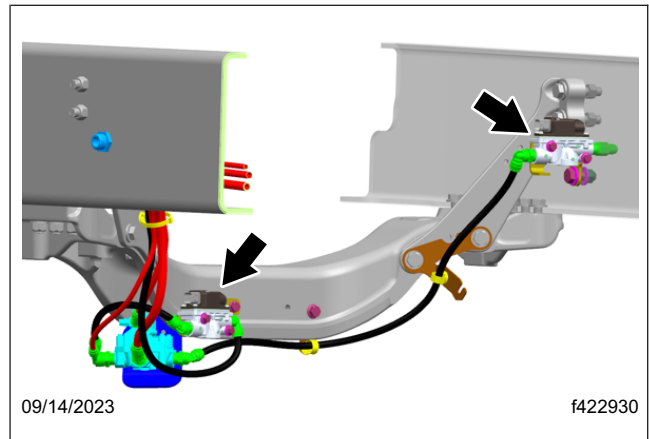


Fig. 18, Modulator Valve Mounting location

Kit Number/ Group	Part Description	Part Number	Qty.
25-FL958-000	SOLENOID,ABS MODULATOR VALVE	25-FL958-001	2 ea
	WASHER-FLAT,STEEL,HARDENED,3/8 IN	23-09114-002	4 ea
	SPACER-AL,,375 ID.75 O	23-12240-025	4 ea
	SCREW-HEX FLANGE,M8X1.25X90	23-14064-090	4 ea
FL958E	NUT-HEX,FLANGE,LOCK,5/16-18,ZINC	N913023 008003	4 ea
	SCREW	N910105 008042	4 ea

Table 6

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

FL958F – Front Modulator Valve Replacement

For vehicles belonging to group F, the replacement procedure is the same as groups A and B, but the location of the valves is different. Location of the modulator valves is shown in **Fig. 19**.

Use all of the parts in the recall kit, listed in **Table 7**, with the exception of the screw (23-14064-090), and spacer (23-12240-025). Use the screw (N910105 008042, 4 each) from the group F parts list, listed in **Table 7**.

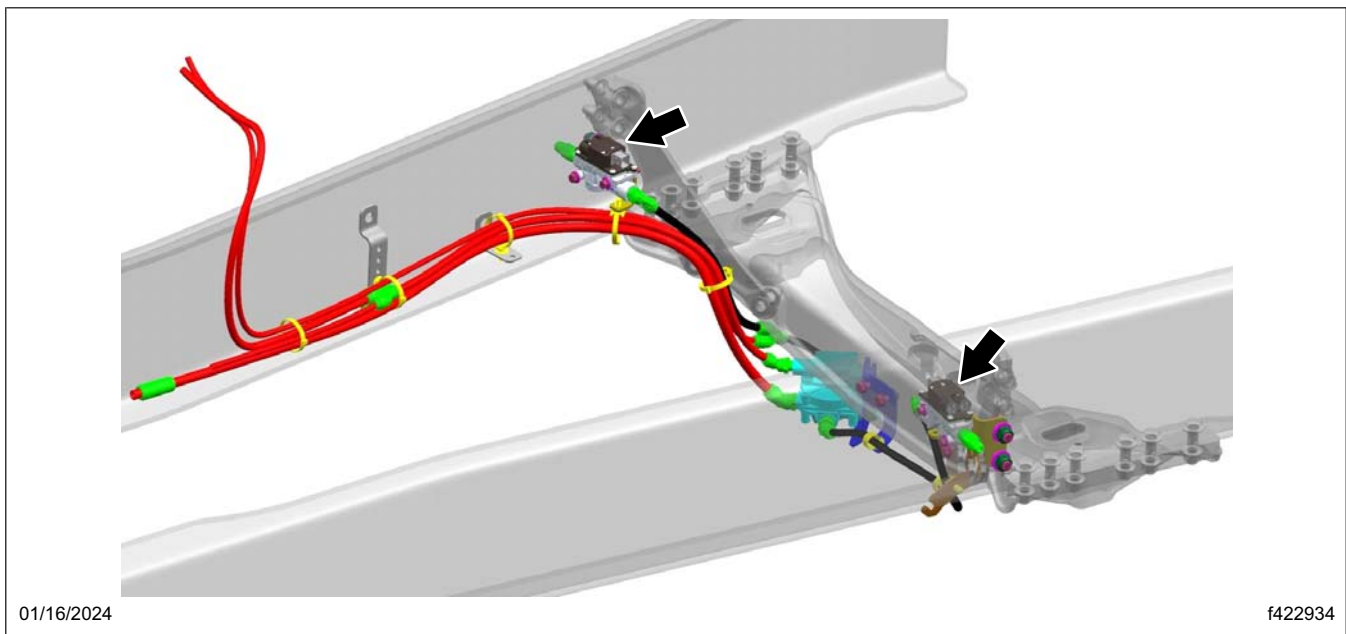


Fig. 19, Modulator Valve Mounting Inside the Frame Rails

Kit Number/ Group	Part Description	Part Number	Qty.
25-FL958-000	SOLENOID,ABS MODULATOR VALVE	25-FL958-001	2 ea
	WASHER-FLAT,STEEL,HARDENED,3/8 IN	23-09114-002	4 ea
	SPACER AL.,.375 ID,.75 O	23-12240-025	4 ea
	SCREW HEX FLANGE,M8X1.25X90	23-14064-090	4 ea
	NUT-HEX,FLANGE,LOCK,5/16-18,ZINC	N913023 008003	4 ea
FL958F	SCREW	N910105 008042	4 ea

Table 7

January 2024
FL958A-G
NHTSA #22V-817
Transport Canada #2022-626
SECOND REVISED BULLETIN

FL958G – Front Modulator Valve Replacement

For vehicles belonging to group G, the replacement procedure is the same as groups A and B, but the location of the valves is different. Location of the modulator valves is shown in **Fig. 20**.

Use only the solenoid (25-FL958-001), and washer (23-09114-002) from the recall kit, listed in **Table 8**. Use the spacer (23-11427-075, 4 each), screw (23-12489-095, 4 each), and nut (23-14525-000, 4 each) from the group G parts list, listed in **Table 8**.

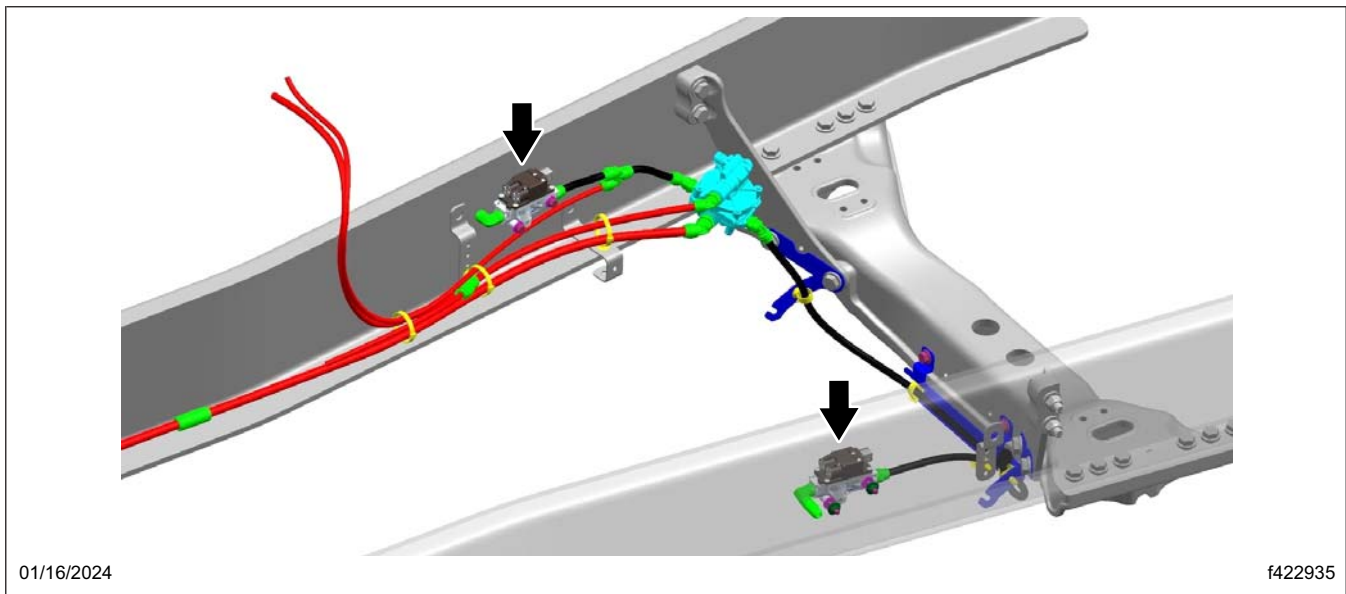


Fig. 20, Modulator Valve Mounting Inside the Frame Rails

Kit Number/ Group	Part Description	Part Number	Qty.
25-FL958-000	SOLENOID,ABS MODULATOR VALVE	25-FL958-001	2 ea
	WASHER-FLAT,STEEL,HARDENED,3/8 IN	23-09114-002	4 ea
	SPACER-AL.,.375 ID,.75 O	23-12240-025	4 ea
	SCREW HEX-FLANGE,M8X1.25X90	23-14064-090	4 ea
	NUT HEX,FLANGE,LOCK,5/16-18,ZINC	N913023-008003	4 ea
FL958G	SPACER-AL.,.4061DX1 ODX	23-11427-075	4 ea
	SCREW	23-12489-095	4 ea
	NUT	23-14525-000	4 ea

Table 8