

## IMPORTANT SAFETY RECALL 22V-120

This notice applies to your vehicle:

Model: MB3

Chassis VIN: 1M9BBBAP1KC\*\*\*\*\*

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act.

MB Companies a division of AEBI-Schmidt, acting on a recall notice from Cummins, AEBI-Schmidt has decided that a defect which relates to vehicle safety exists in 2019 MB3 vehicle equipped with the Cummins X12 engine. The fuel tubes between the fuel rail and the injectors for cylinders four, five, and six may fatigue and crack, which can result in a high-pressure fuel leak. Refer Cummins Recall 21E-099.

Cummins Inc. Model X12, Part No.: DOS3009BX03 or DOS3005BX03 diesel engines are equipped with High Pressure Common Rail fuel systems. The recall consists of the entire population of engines equipped with a certain Injector Fuel Supply Tube (fuel tube). The fuel tubes between the fuel rail and the injector for cylinders 4, 5 and 6 may be susceptible to cracking, resulting in a high-pressure fuel leak. A high-pressure fuel leak in the presence of an ignition source may increase the risk of a fire.

The subject fuel tubes (for cylinders 4, 5 and 6) are susceptible to cracking due to metal fatigue failure resulting from a combination of vibration strain, assembly strain and material strength. Part numbers of affected Injector supply tube are 5536516, 5486389 and 3695190

Identification of occurrence is fuel leaks may be detected during maintenance and an operator may smell fuel or observe a mist due to the fuel leak.

Cummins' dealers will replace the fuel tubes, and install vibration isolators, free of charge. Date for repair to be scheduled by owner with a local Cummins dealer. This repair should take 2 hours.

The subject fuel tubes for cylinders 4, 5 and 6 (the rear half of the engine) will be replaced with new fuel tubes (having the same part number as the recalled components) and vibration isolators will be added to the fuel tubes. The replacement fuel tubes will also have vibration isolators. The fuel tube and vibration isolator combination will have a new part number. A recall-specific reimbursement plan will be provided on the Recall Portal for those units not covered by the manufacturer's limited warranty. Owners may contact AEBI's customer service at 1-920-898-1035. If you have questions or concerns about this recall, please contact your local Cummins Distributor or authorized warranty dealer. You may also contact Cummins Care at 1-800-CUMMINS (1-800-286-6467), or visit our website at [care.cummins.com](http://care.cummins.com).

If you have a complaint relative to this recall, you may report it to the following:

Administrator

National Highway Traffic Safety Administration 1200 New Jersey Avenue, SE  
Washington, DC 20590

You may also call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153);  
or go to <http://www.safercar.gov>.