



Tesla, Inc.
Service Bulletin

Inspect Door Mirror Glass

SB-22-12-002

November 23, 2022

Classification		Section/Group	Mobile Service	Configuration
Recall Bulletin		12 - Exterior Fittings	Can Perform (where permitted)	All
Model Year	Model	Country/Region	Build Location	
2022	Model S	United States	Fremont	

The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.

Recall Bulletin: Recall Bulletins are mandatory service procedures that, unless they can be completed via a firmware update that a customer installs through the normal course of ownership, must be carried out by Tesla-certified Service Centers. Recall work performed by uncertified technicians could lead to unsafe conditions or voided warranty provisions.

Condition

Certain 2021+ Model S vehicles may have received an incorrect left-hand side (LH) and/or right-hand side (RH) door mirror glass during a post-delivery service visit.

Correction

Inspect the LH and RH door mirror glass for symptoms related to the condition. If symptoms are present, replace the LH and/or RH door mirror assemblies.

Correction Description	Correction	Time
Inspect LH And RH Door Mirror Glass; No Repairs Needed	S012212002	0.05
Inspect LH And RH Door Mirror Glass; Replace LH Door Mirror Assembly	S022212002	0.15
Inspect LH And RH Door Mirror Glass; Replace RH Door Mirror Assembly	S032212002	0.15
Inspect LH And RH Door Mirror Glass; Replace LH And RH Door Mirror Assemblies	S042212002	0.30

	Part Number	Description	Quantity
If Necessary	1613819-00-F	EXT MIRROR ASSY PREM DOM LEFT HAND	1
	1613820-00-F	EXT MIRROR ASSY PREM DOM RIGHT HAND	1

These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the [Parts Catalog](#).

Procedure


1. Place the straight edge of a small trim tool on the LH door mirror glass (Figure 1).

⚠ CAUTION: Be careful not to damage the mirror during inspection.


- If the trim tool sits flush to the glass (Figure 2), the LH door mirror glass is flat. No repairs are needed.
- If the trim tool wobbles or does not sit flush to the glass (Figure 3), the LH door mirror glass is convex. Replace the LH door mirror assembly (refer to Service Manual procedure [12091102](#)).



Figure 1

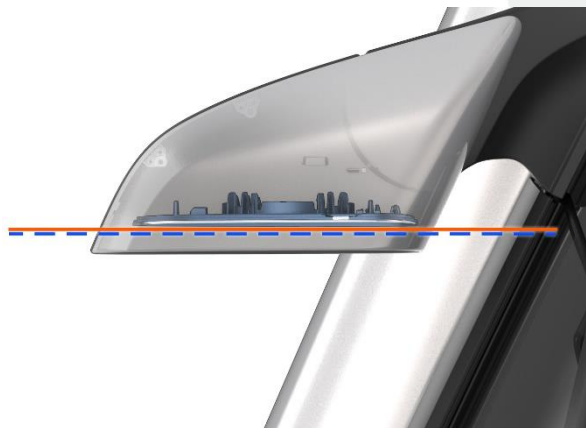


✓ Figure 2 – Top view: Mirror is flat

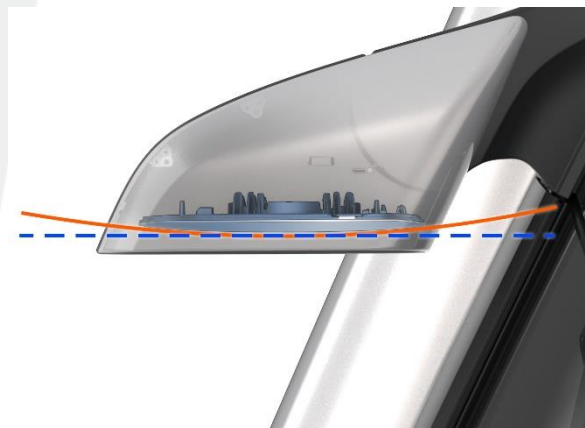

✗ Figure 3 – Top view: Mirror is convex

2. Inspect the RH door mirror glass.

- If the RH door mirror glass contains the text, “OBJECTS IN MIRROR ARE CLOSER THAN THEY APPEAR” (Figure 4), no repairs are needed.
- If the RH door mirror glass does not contain the text, “OBJECTS IN MIRROR ARE CLOSER THAN THEY APPEAR” (Figure 5), replace the RH door mirror assembly (refer to Service Manual procedure [12091102](#)).

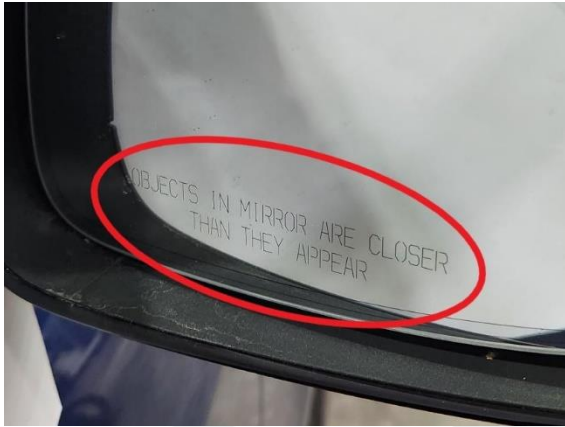

✓ Figure 4 – Mirror has text



✗ Figure 5 – Mirror does not have text