

		<b>Tesla, Inc.</b> Service Bulletin		<b>Update Vehicle Firmware To Remove Rolling Stop Functionality From Full Self-Driving (Beta)</b>	
<b>SB-22-00-001</b> March 2, 2022					
<b>Classification</b>		<b>Section/Group</b>		<b>Mobile Service</b>	
Recall Bulletin		00 - Inspection & Service		Can Perform (where permitted)	
<b>Model Year</b>	<b>Model</b>	<b>Country/Region</b>		<b>Version</b>	
2016 – 2022	Models S, X, 3, Y	United States, Canada		All	
The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.					

Recall Bulletin: Recall Bulletins are mandatory service procedures that must be carried out by Tesla-certified Service Centers. Recall work performed by uncertified technicians could lead to unsafe conditions or voided warranty provisions.

## Condition

Under specific conditions, vehicles operating Full Self-Driving (Beta) firmware releases 2020.40.4.10 through 2021.44.30.14 may travel through all-way-stop intersections before coming to a complete stop.

## Correction

Inspect the firmware installed in the vehicle and update, if necessary, to the latest available firmware release.

Correction Description	Correction	Time
Inspect Vehicle Firmware, No Update Necessary	S012200001	0.05
Inspect And Update Vehicle Firmware To Remove Rolling Stop Functionality	S022200001	0.05

## Procedure

1. On the vehicle touchscreen, touch **Controls** (vehicle icon) > **Autopilot**, and check for the Full Self-Driving (Beta) switch.



**NOTE:** The “Full Self-Driving Visualization Preview” is not of importance and can be ignored for this check.

- If the Full Self-Driving (Beta) switch is not available, then no further action is necessary. Use correction code S012200001.
  - If the Full Self-Driving (Beta) switch is available, continue to the next step.
2. Touch **Controls** (vehicle icon) > **Software**, and then scroll down to display the vehicle firmware version.
    - If the vehicle is operating with firmware version 2021.44.30.15 or a newer release, then no further action is necessary. Use correction code S012200001.
    - If the vehicle is operating with firmware version 2020.40.4.10 through 2021.44.30.14, then update to the latest available firmware release. Use correction code S022200001.