

 <b>HYUNDAI</b> <b>Technical Service Bulletin</b>	GROUP <b>RECALL</b>	NUMBER <b>22-01-026H</b>
	DATE <b>FEBRUARY 2022</b>	MODEL(S) <b>Accent (HC)</b>
<b>SUBJECT:</b>	<b>FRONT SEAT BELT PRETENSIONER REPLACEMENT (RECALL 219)</b>	

**★ IMPORTANT**

As required by federal law, dealers must not deliver new vehicle for sale or for lease to customers until all open recalls have been performed. Dealers must also perform all open recalls on used vehicles, demo, and rental vehicles prior to placing them into customer use and whenever an affected vehicle is in the shop for any maintenance or repair.

When a vehicle arrives at the Service Department, access the "Vehicle Information" screen via WEBDCS to identify open Recalls.

**Description:** The front seat pretensioner may deploy abnormally in the vehicles described below, causing the MGG (Micro Gas Generator) to detach from the assembly. This bulletin describes the procedure to replace the front seatbelt pretensioner to resolve the condition.



**Applicable Vehicles:**

Certain 2020-2021MY Accent (HC) vehicles produced from 3/25/2020 to 7/29/2020.

**Parts Information:**

MODEL	PART NAME	PART NUMBER	NOTES
Accent (HC)	Front Seatbelt Pretensioner	88810-J0600QQH	Only Replace LH Side
	Trim Fastener	82315-2W000	4 Needed

**Warranty Information:**

MODEL	OP CODE	OPERATION	OP TIME	CAUSAL PART	NATURE CODE	CAUSE CODE
Accent (HC)	211M20R0	Front Seat Belt Pretensioner Replacement (LH ONLY)	0.4 M/H	88810-J0600QQH	I11	ZZ3

**NOTE 1:** Submit Claim on Campaign Claim Entry Screen.

**NOTE 2:** If a part that is not covered by this recall is in need of replacement while performing this recall, and the affected part is still under warranty, please submit a separate claim using the same repair order. If the affected part is out of warranty, submit a prior approval request for goodwill consideration prior to performing the work.

**NOTE 3:** The incident part(s) may be subjected to callback through the Warranty Technical Center (WTC).



Refer to the QR code or link below for guided video information:  
[Hyundai Service Learning - Recall 219 Service Procedure](#)

**Service Procedure:**


1. Move the front seat as far forward as possible.

**NOTICE**

**Accent vehicles are equipped with manual levers to adjust seat position.**

2. Record radio presets and turn off the vehicle's ignition key before continuing.
3. Disconnect the negative (-) battery terminal.


- Partially remove the front door body side weather strip (C).

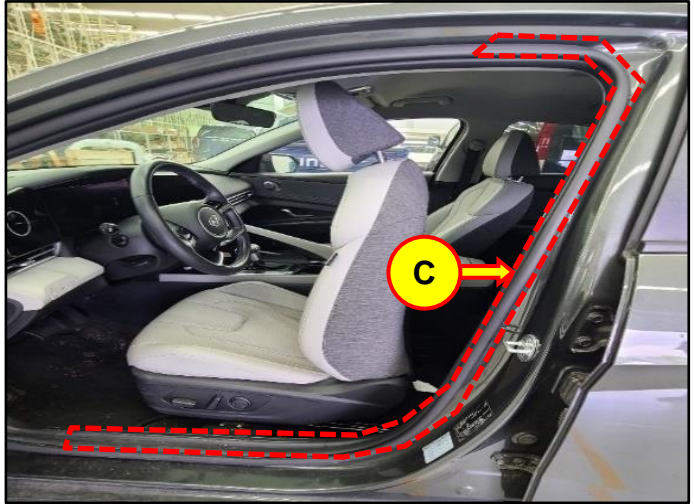

- Remove the front door scuff trim (D) using a flat head screwdriver or plastic trim remover.

**NOTICE**


If using a screwdriver, be sure to wrap protective tape around the tip to prevent damage on the trim and panels.

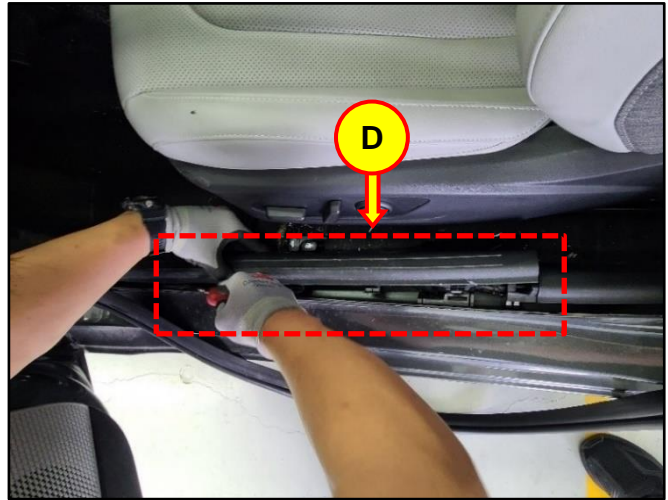


- Partially remove the rear door body side weather strip (E).



7. Partially remove the rear door scuff (F) using a screwdriver or plastic trim remover.

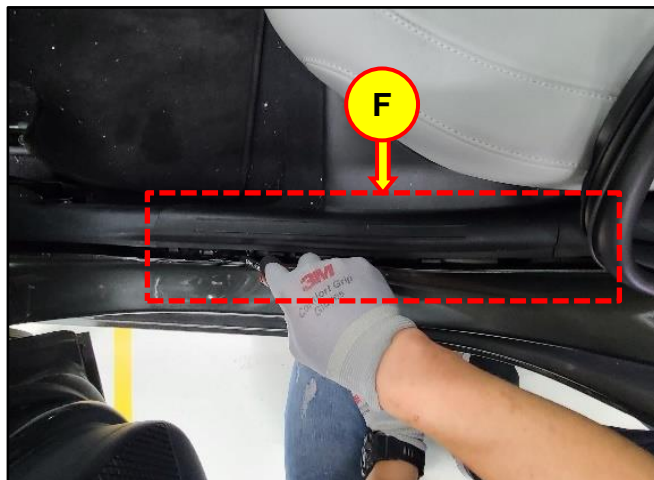


8. Move the front seat belt lower anchor cover (G) upward.

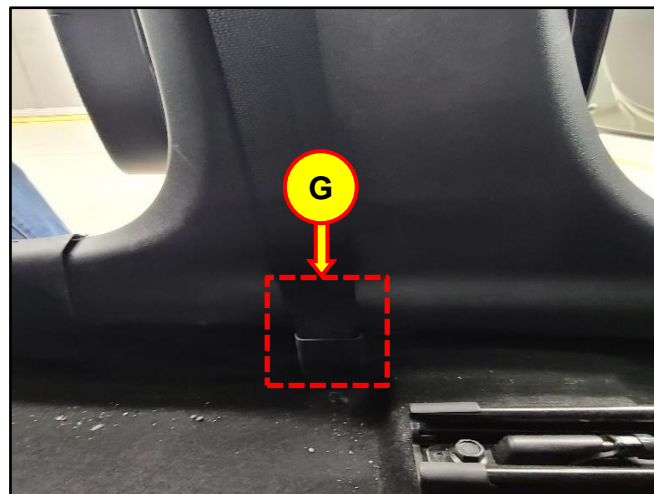

9. Loosen the mounting bolt (H) and remove the front seat belt lower anchor.

**NOTICE**

**Tightening Torque:**  
28.9 – 39.8 lb-ft (39.2 – 53.9 Nm)

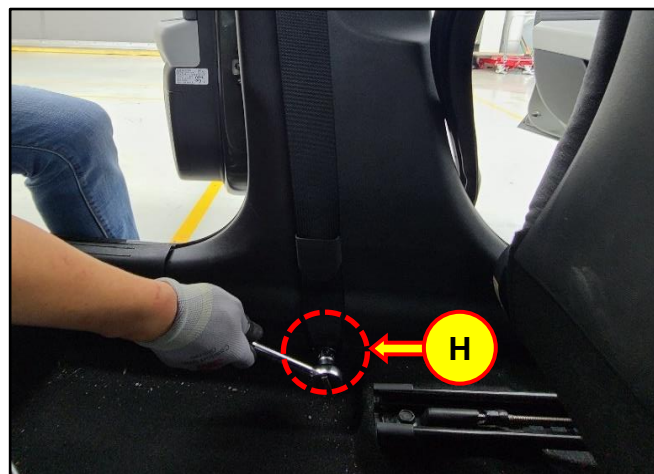


10. Pull and remove the center pillar lower trim (I).

**NOTICE**

Replace existing fasteners with new ones.



11. Remove the center pillar upper trim (J).

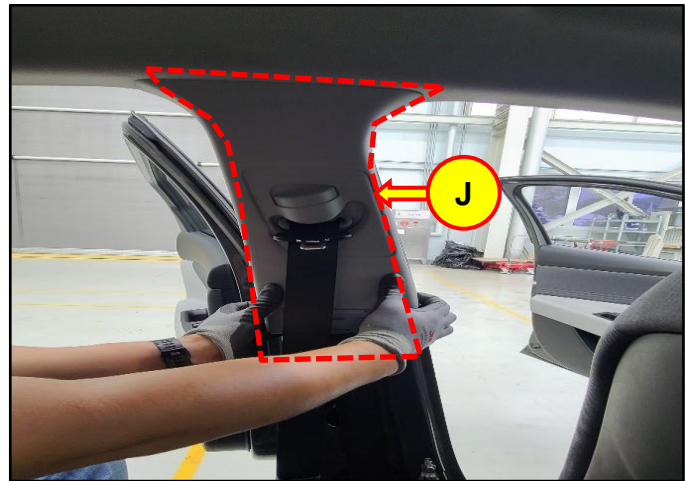

12. Loosen the front seat belt upper anchor mounting bolt (K) and remove the front seat belt anchor.

**NOTICE**

**Tightening Torque:**  
28.9 – 39.8 lb-ft (39.2 – 53.9 Nm)




13. Loosen the mounting bolts (L) and (M) and remove the front seat belt pretensioner.

**NOTICE**



**Tightening Torque:**

L: 5.8 – 8.7 lb-ft (7.7 – 11.8 Nm)

M: 28.9 – 39.8 lb-ft (39.2 – 53.9 Nm)

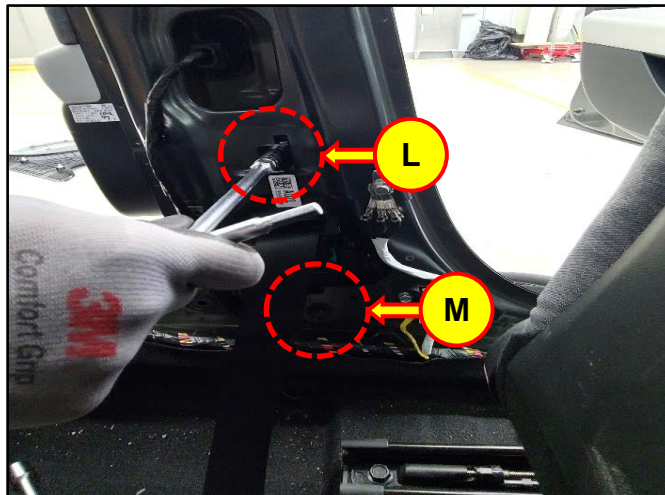

14. Press in the tabs for the locking pin (N) to disconnect the front seatbelt pretensioner connector (O) and the free active seatbelt connector (P).

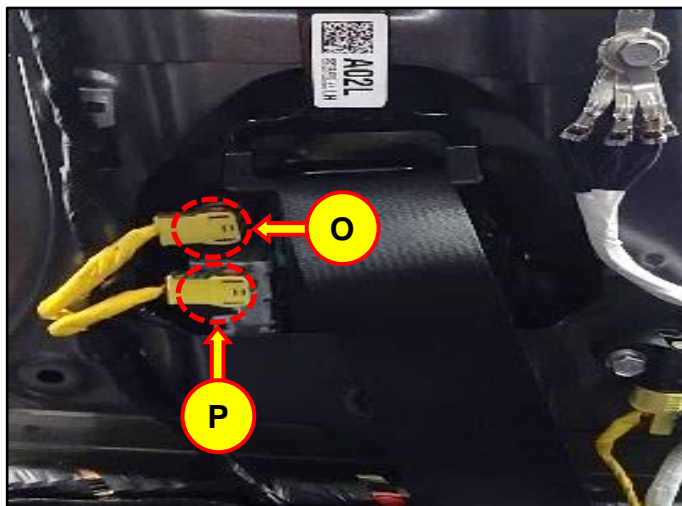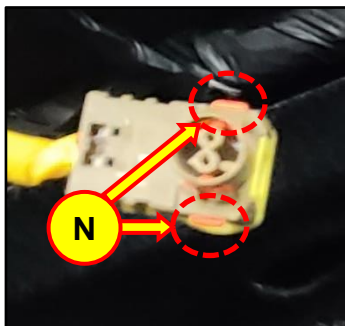

15. Remove the front seat belt pretensioner.



16. Install the newly supplied front seat belt pretensioner.

17. Reinstall parts in reverse order of removal. Make sure you replace existing fasteners with new ones.

**NOTICE**

Move the height adjuster lever (Q) to the highest point before reinstalling the upper center pillar trim.



18. After connecting the negative (-) battery terminal, be sure to reprogram radio presets.
19. The service procedure is complete.