

RECALL R22BT

FMVSS 131 Noncompliance - School Bus Pedestrian Safety Device

Models Affected: Certain 2022 & 2023 Model Year Blue Bird Vision/BBCV School Buses equipped with pneumatic stop/crossing arm feature(s)

Issue: The Stop/crossing arm air pressure regulator electrical connection is a 2 pin, male-female connector. The harness on units in question is mis-built with male pins installed in each connector half.

Corrective Action: Remove both sides of the two-pin connector and install a service jumper connector.

WARNING: Always follow all Federal, State, Local and Shop safety standards and use proper safety equipment, and thoroughly read and understand all instructions before performing these procedures.

Park bus on level surface, apply parking brake, turn off ignition key, and chock wheels.

Parts/Items Needed:

Ite	m Pa	art Number	Description	Quantity
1	1	10077923	Service Jumper Connector	2

Instructions:

STEP 1- Loose LH lower and radio switch panels to gain access. See Figure 1

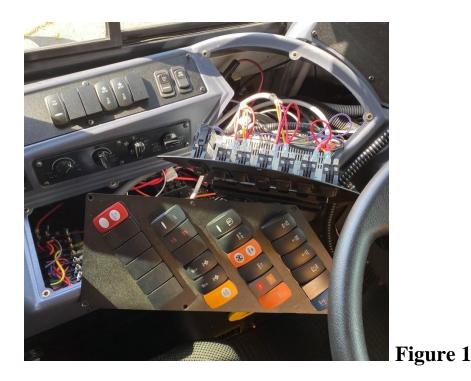




Figure 2




Figure 3



RECALL R22BT

FMVSS 131 Noncompliance - School Bus Pedestrian Safety Device

- Step 2- Identify stop and crossing arm (if equipped) air solenoid connectors. See Figure 2.
- Step 3- Verify connectors are mis-pinned (male pins in female housing), per Figure 3. If they are not, no further action is required and unit can be returned to service.
- Step 4- Cut harness on each side of the air solenoid connector. See Figure 4
- Step 5- Cut & strip the wires and install the service jumper connector. See Figure 5
- Step 6- Run full system check and reinstall the switch panels. See Figure 6
- Step 7- Record date/mileage of repair and return unit to service.

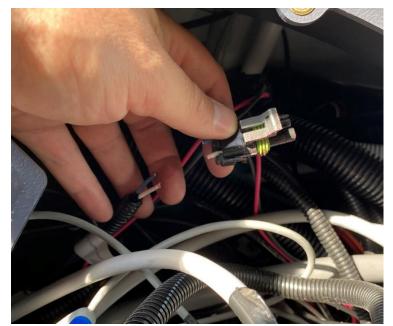

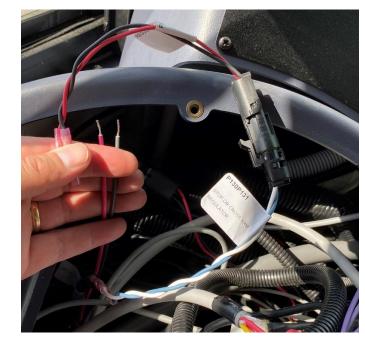




Figure 4

Figure 5

Figure 6