VOLUNTARY RECALL CAMPAIGN

BT22-015

NTB22-052

June 23, 2022

VOLUNTARY SAFETY RECALL CAMPAIGN 2013-2016 PATHFINDER; HOOD LOCK ASSEMBLY

CAMPAIGN ID #:R22A3APPLIED VEHICLES:2013-2016 Pathfinder (R52)

Check Service COMM or Dealer Business Systems (DBS) National Service History to confirm campaign eligibility.

INTRODUCTION

Nissan is conducting this voluntary safety recall campaign on certain specific model year 2013-2016 Pathfinder vehicles, to inspect, clean, and lubricate the Hood Lock Assembly and the Secondary Latch, and if necessary, replace the Hood Lock Assembly, Secondary Latch, and the Hood Lock Release Cable. This service will be performed at no charge to the customer for parts or labor.

IDENTIFICATION NUMBER


Nissan has assigned identification number R22A3 to this campaign. This number must appear on all communication and documentation of any nature dealing with this campaign.

DEALER RESPONSIBILITY

It is the dealer's responsibility to check Service COMM or Dealer Business Systems (DBS) National Service History for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. **Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration**. While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

REPAIR OVERVIEW

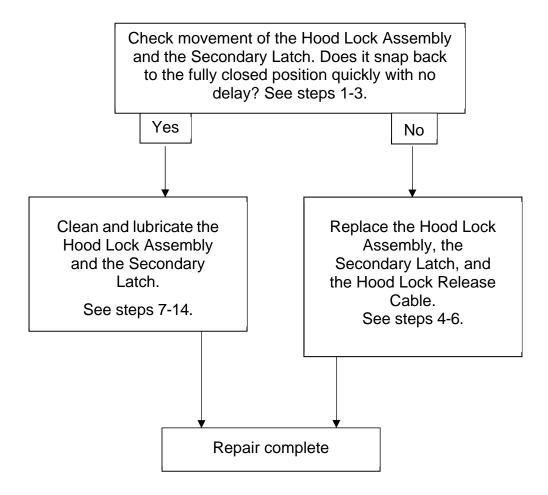

SERVICE PROCEDURE

Check Hood Lock Assembly and Secondary Latch Movement

- 1. Open the hood, and set the hood support rod.
- 2. Place a clean fender cover to protect the core support cover (Figure 1).
 - The release lever on the Secondary Latch must be above the fender cover and accessible.

- Move / cycle the release lever on the Secondary Latch five (5) times (Figure 2). When the release lever is released, does the Secondary Latch lock snap back quickly to the fully closed position without sticking?
 - <u>Yes</u> Skip to step 7 on page 5 to clean and lubricate the Secondary Latch and the Hood Lock Assembly.
 - <u>No</u> Proceed to step 4 on page 4 to replace the Secondary Latch, the Hood Lock Assembly, and the Hood Lock Release Cable (Figure 3).

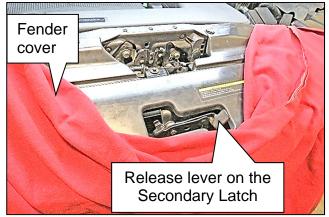


Figure 1

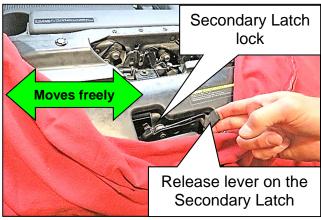


Figure 2

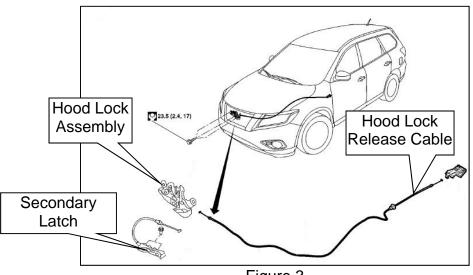


Figure 3

NOTE: It is not necessary to clean and lubricate new parts.

Replace the Secondary Latch

- 4. Replace the Secondary Latch.
 - Refer to the ESM: BODY EXTERIOR, DOORS, ROOF & VEHICLE SECURITY > DOOR & LOCK > REMOVAL AND INSTALLATION > HOOD LOCK > SECONDARY LATCH: Removal and Installation

Replace the Hood Lock Assembly

- 5. Replace the Hood Lock Assembly.
 - Refer to the ESM: BODY EXTERIOR, DOORS, ROOF & VEHICLE SECURITY > DOOR & LOCK > REMOVAL AND INSTALLATION > HOOD LOCK > HOOD LOCK > HOOD LOCK: Removal and Installation

Replace the Hood Lock Release Cable

- 6. Replace the Hood Lock Release Cable.
 - Refer to the ESM: BODY EXTERIOR, DOORS, ROOF & VEHICLE SECURITY > DOOR & LOCK > REMOVAL AND INSTALLATION > HOOD LOCK > HOOD LOCK RELEASE CABLE: Removal and Installation
 - Skip to step 15 on page 7.

IMPORTANT: All replaced parts should be retained for collection via the normal part return process.

Clean and Lubricate the Secondary Latch

 Place a clean shop rag under the release lever on the Secondary Latch (Figure 4).



Figure 4

- 8. Remove/clean previous lubricants and debris from the Secondary Latch (Figure 5).
 - Use a rust penetrant type cleaner that complies with local regulations.
 - Use a spray extension tube to help direct the application.
 - Clean the pivot pin area and between the Secondary Latch release lever and its body.
 - Wipe excess pooled/dripping rust penetrant with a shop rag prior to performing step 9.



Figure 5

9. Use shop air to blow-dry the Secondary Latch (Figure 6).

ACAUTION

To avoid the risk of minor personal injury, be sure to wear appropriate eye protection.



Figure 6

- 10. Apply non-aerosol white lithium grease to the Secondary Latch (Figure 7).
 - <u>Do not</u> use "spray-on" (aerosol) grease.
 - Apply the grease with a small brush.
 - With the brush, work the grease onto the pivot pin area and into the Secondary Latch body.



Figure 7

Clean and Lubricate the Hood Lock Assembly

11. Place a clean shop rag under the Hood Lock Assembly (Figure 8).



Figure 8

- Remove/clean previous lubricants and debris from the Hood Lock Assembly (Figure 9).
 - Use a rust penetrant type cleaner that complies with local regulations.
 - Use a spray extension tube to help direct the application.
 - Clean the pivot pin area and in between the Hood Lock Assembly release lever and its body.
 - Wipe excess pooled/dripping rust penetrant with a shop rag prior to performing step 13 on page 7.



Figure 9

13. Use shop air to blow-dry the Hood Lock Assembly (Figure 10).

ACAUTION

To avoid the risk of minor personal injury, be sure to wear appropriate eye protection.



Figure 10

- 14. Apply non-aerosol white lithium grease to the Hood Lock Assembly (Figure 11).
 - <u>Do not</u> use "spray-on" grease.
 - Apply the grease with a small brush.
 - With the brush, work the grease onto the pivot pin area and into the Hood Lock Assembly body.



Figure 11

- 15. Remove any shop rags/fender covers from the vehicle.
- 16. Lower the hood support rod, secure it, and then close the hood.
- 17. Return the vehicle to the customer.

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
HOOD LOCK ASSEMBLY (1)	65601-3JA1A	1 As needed
CRANK-BELL, HOOD LOCK (Secondary Latch) (1)	65603-9UA0A	1 As needed
COMPLETE CABLE ASSEMBLY (Hood Lock Release Cable) (1)	65621-3KA2A	1 As needed

1) All three listed parts should be replaced together.

CLAIMS INFORMATION

Submit a "CM" line claim using the following claims coding:

CAMPAIGN ("CM") ID	DESCRIPTION	OP CODE	FRT
R22A3	Inspect, Clean and Lubricate Secondary Latch and Hood Lock Assembly (OK Condition)	R22A30	0.2
	Inspect, and Replace Secondary Latch, Hood Lock Assembly, and Complete Hood Lock Release Cable Assembly (NG Condition)	R22A31	0.9

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
June 23, 2022	NTB22-052	Original bulletin published