2022-11-14



SIB 61 14 22

RECALL 22V-541: HIGH-VOLTAGE BATTERY

This Service Information Bulletin (Revision 2) replaces SI B61 14 22 dated October 2022.

What's New:

- Cell modules return procedure note
- · Vehicle production dates

MODEL

E-Series	Model Description	Production Date	
G26 BEV	i4 Gran Coupe	November 10, 2021 – October	
		21, 2022	

AFFECTED VEHICLES

Vehicles which require this Recall Campaign to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System), ISPA Next or Warranty Vehicle Inquiry.

BMW AG is conducting a Voluntary Safety Recall (effective July 21, 2022) on a small number of Model Year 2022 BMW i4 Gran Coupe vehicles that were produced between November 22, 2021, and June 13, 2022.

Affected vehicles are not to be driven or charged and to be parked away from any buildings.

SITUATION

During supplier production, the high-voltage battery may not have been produced to specifications. A short-circuit could occur which could lead to a thermal event. The affected high-voltage battery cell module will be replaced.

We will be turning VINs green "Remedy Available" based on parts availability. The BMW Customer Relations department will contact the appropriate dealer to have them place a Recall IDS ticket for the parts for a specific vehicle. Then Customer Relations will assist in scheduling an appointment based on the arrival of the parts. It is essential that the allotted IDS part goes to the assigned vehicle.

CAUSE

Some high-voltage battery modules may not have been produced to specifications.

CORRECTION

Removal and replacement of affected high-voltage cell modules.

PROCEDURE

Important Warning for Working on the High-Voltage (HV) systems on BMW Group vehicles:

Only properly trained personnel, who passed all applicable HV Technical Training Courses, should perform repairs which require disconnecting, or removal of High Voltage battery components on any Hybrid or Electric Vehicle. Work performed on High Voltage systems by unqualified persons may result in severe injury or damage to the vehicle. Additional safety information is found in Repair Instruction 61 00... "Observe safety instructions when handling electric vehicles".

Additional Information:

Scheduled Maintenance, or Quality Certification 1 (Pre-Delivery Inspection) on Electric or Hybrid vehicles does not require HV technical training.

Prior to disconnecting, or the removal of any HV component, the HV system needs to be disabled and secured (by means of the HV Disconnect Switch) by a properly trained technician, who has a minimum HV Qualification level after completing the Technical Training Course ST1824 (Alternative Drive Part 1). Once the vehicle's HV system is disabled (the "Blitz" - lightning bolt icon displayed in instrument cluster, see below), a technician without HV Certification may remove a HV component (e.g., EH Heater, EKK Compressor, EME Control Unit, et.), except for the High Voltage Battery.



High Voltage Battery removal and rework can be performed <u>ONLY</u> by a HV Specialist Technician (certified by the Technical Training Course ST1825 – Alternative Drive Part 2), <u>AND</u> with a HV Battery Certification level corresponding to a specific Electric or Hybrid vehicle (e.g., to repair GEN4 battery of G05 PHEV, certification from Technical Training Course "ST2006 – SP44 HV Battery" is required).

Therefore, to perform this SIB 61 14 22 a GEN5 battery Certification is required from Technical Training Course "ST2205 Generation 5 High-voltage" class).

BMW recommends NOT to drive the vehicle NOR charge the high-voltage battery until all repair work below has been completed.

The steps below must be followed precisely:

1. Please perform the **cell module read out** test plan in ISTA to determine the serial numbers and locations of the high-voltage cell modules installed in the vehicle.

Diagnostic path:

Vehicle management > Service function > Electric drive > High-voltage battery unit > High-voltage battery unit: Read out stored serial numbers ABL.

The "High-voltage battery unit: Read out stored serial numbers" test plan has been updated to identify the high-voltage cell modules affected by this campaign and their location in the high-voltage battery.

The update will be included in ISTA version 4.38.1x, estimated availability as of October 21, 2022 (pending verification).

Note:

If the test plan is not yet available at the time of the repair or the test plan was inconclusive in identifying the affected modules, please submit a TSARA case titled "Gen 5 HV Battery cell module ID process" for assistance.

2. The high-voltage battery must be discharged prior to removal to an average **cell voltage** of 3.51V using the ISTA test plan below, **before** the high-voltage battery is opened and the defective modules are removed.

Diagnostic path:


Vehicle management > Service function > Electric drive > High-voltage battery unit > High-voltage battery unit discharged to a defined state of charge (SOC) ABL. Note:

The High-voltage battery unit discharged to a defined state of charge (ABL) service function is ONLY available if the high-voltage battery temperature is between 15°C and 35°C (59 to 95 F).

about:blank 2/8

3. Replace the defective high-voltage cell modules using repair instructions **61 27 703** to **61 27 877** depending on the affected cell module location.

G26 BEV SE27 HB Battery module locations shown below-

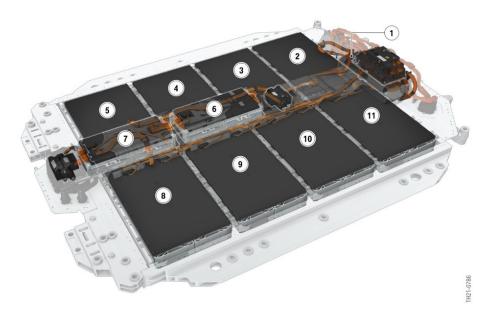

PARTS INFORMATION

Only use and invoice the applicable part listed number below.

G26 BEV

Part Number	Description	Quantity
61 27 9454253	Multi-purpose bolt (M12X1.5X45)	14
61 25 8833851	Hexagon bolt (M12x5x130)	2
61 25 8833846	Hexagon bolt (5x105)	6
07 14 6884435	ASA Multi-purpose bolt (M10x35)	4
33 32 6760340	Torx bolt with washer (M12x127-10.9)	4
33 30 6861221	Torx bolt (ISA M12x35- 10.9)	10
61 27 9884703	Gasket	1
07 14 8860492	Screw (M5)	82
07 14 8838288	Sealing screw (M8x28)	20
61 27 9454854	Screw	as needed (max
		63)
61 27 8677639	Screw (M6x18)	as needed (max.
		22)
39 10 6865725	Multi-purpose bolt	4
07 14 8835104	Multi-purpose bolt (M12x1.5x72-10.9)	4
07 14 6899140	Cage nut (M12x1.5-10- ZNS3)	4
depending on		
the availability		
61 27 8847350	Cell module, high-voltage battery	Up to 3
61 27 8847342	Double module for high-voltage battery	Up to 4
Or		
61 27 8847333	Cell module, high-voltage battery	Up to 3
61 27 8847327	Double module for high-voltage battery	Up to 4

about:blank 3/8

Recalled Part Retention

Recalled parts that are removed from BMW vehicles cannot be used for resale! The recalled parts are the property of BMW NA.

Your center is responsible for the proper identification, storage and documentation of these parts. They must be held in a secure retention area until notification of claim payment is made by BMW NA through DCSnet.

Please DO NOT return these recalled High Voltage (HV) battery modules directly to the WPRC or through the current HV Battery return process.

Please refer to the following document for the procedure that applies to returning these Recalled HV Battery Modules:

Note:

The Gen 5 high-voltage cell module return process is different from the Gen 4 and has NOT been finalized yet per this SIB's Revision 2. This bulletin will be updated when the new procedure is available.

For the latest related training, refer to:

Bulletin #: B-2-0322-0301_HV-Battery_Recall_Training

For more information refer to CenterNet: "Menu>BMW>Aftersales>Business Development & Marketing Portal>Batteries>HV Training Module".

CLAIM INFORMATION

Reimbursement for this Recall will be via normal claim entry utilizing the relevant work package, the additional work labor operation for the applicable FRU allowance and the part numbers listed above that apply.

Plus work (+)	The vehicle is already in the workshop
Main work	The vehicle arrives for this Recall, no other Main work will be performed/ claimed during this workshop visit

Defect Code: 0061970600 G26 BEV Replacing high-voltage battery cell module
--

Refer to the below for the corresponding flat rate unit (FRU) allowances.

Work Pkg	Labor Operation	Description	Labor Allowance
#1	00 72 880	Removing and installing high-voltage battery unit, and removing/installing lid for high-voltage battery unit (Includes 61 27 900 - High-voltage battery unit final test, draining and topping up the coolant circuit) (Plus work)	109 FRU
Or:			
#2	00 72 299	Removing and installing high-voltage battery unit and removing/installing lid for high-voltage battery unit (Includes 61 27 900 - High-voltage battery unit final test, draining and topping up the coolant circuit) (Main work)	111 FRU

Copyright ©2022 BMW of North America, Inc.

about:blank 4/8

Only one of the flat rate labor operation codes listed above can be used for claim submission and reimbursement. Also, only one Main work flat rate labor operation code can be claimed per workshop visit.

Additional Work with Labor Operation 00 72 880 (WP 1) or 00 72 299 (WP 2)

Note: Claim labor operation 00 72 300 one-time only for the applicable total FRU allowance that applies. Itemize the total work time (WT) FRU allowanced claimed on the RO and in the claim comments.

Work time labor operation code 00 72 300 is not considered a Main labor operation.

Labor Operation	Labor Description	Labor Allowance
00 72 300	Only when the test module "High-voltage battery unit: Read out stored serial numbers" is not available: Please submit a TSARA case titled "Gen 5 HV Battery cell module ID process" for assistance. Perform a Vehicle Test (Includes 00 00 556/61 21 528) and run the HV battery discharge procedure	6 FRU

Then, after the test module becomes available

Labor Operation	Labor Description	Labor Allowance
00 72 300	Perform the cell module read out test plan in ISTA to determine the serial numbers and locations of the high-voltage cell modules affected by this Recall (Includes 00 00 556/61 21 528) and run the HV battery discharge procedure	6 FRU

And, as instructed above:

A. 00 72 300 - Replacing Single Cell Module 1

Labor Description	Labor Allowance
Replacing cell module 1	12 FRU

Or:

B. 00 72 300 - Replacing Single Cell Modules 6 and/or 7

Labor Description	Labor Allowance
Replacing cell module 6	14 FRU
Or:	
Replacing cell module 7	14 FRU

Or:

C. 00 72 300 - Replacing Single Cell Modules (1, 6 and/or 7)

Labor Description	Labor Allowance

Copyright ©2022 BMW of North America, Inc.

A and B - 2 single cell modules (1 and 6 or 7)	26 FRU
B only - 2 single cell modules (6 and 7)	28 FRU
A and B for 3 cell modules (1, 6 and 7)	40 FRU

Or:

D. 00 72 300 - Replacing Dual-Cell Modules 2, 3, 4, 5 (Includes cell modules 6 and 7)

Only One (1) Dual-Cell Module (with A when applicable)

Labor Description (Labor Allowance	With Cell Module 1 (A)
Replacing dual-cell module 2 (Includes cell 11)	15 FRU	27 FRU
Or:		
Replacing dual-cell module 3 (Includes cell 10)	13 FRU	25 FRU
Or:		
Replacing dual-cell module 4 (Includes cell 9)	13 FRU	25 FRU
Or:		
Replacing dual-cell module 5 (Includes cell 8)	11 FRU	23 FRU

Or:

Only Two (2) Dual-Cell Modules (with A when applicable)

Dual-cell modules (C)	2/3 (2)	2/4 (2)	2/5 (2)	3/4 (2)	3/5 (2)	4/5 (2)
2 (Includes cell 11)	15 FRU	15 FRU	15 FRU			
3 (Includes cell 10)	13 FRU			13 FRU	13 FRU	
4 (Includes cell 9)		13 FRU		13 FRU		13 FRU
5 (Includes cell 8)			11 FRU		11 FRU	11 FRU
Totals	28 FRU	28 FRU	26 FRU	26 FRU	24 FRU	24 FRU
Cell module 1 (A)	12 FRU					
Totals with A	40 FRU	40 FRU	38 FRU	38 FRU	38 FRU	36 FRU

Or:

Only Three (3) Dual-Cell Modules (with A when applicable)

Dual-cell modules (C)	2/3/4 (3)	2/3/5 (3)	3/4/5 (3)	2/4/5 (3)	All (4)
2 (Includes cell 11)	15 FRU	15 FRU		15 FRU	15 FRU
3 (Includes cell 10)	13 FRU	13 FRU	13 FRU		13 FRU
4 (Includes cell 9)	13 FRU		13 FRU	13 FRU	13 FRU
5 (Includes cell 8)		11 FRU	11 FRU	11 FRU	11 FRU
Totals	41 FRU	39 FRU	37 FRU	39 FRU	52 FRU
Cell module 1 (A)	12 FRU	12 FRU	12 FRU	12 FRU	12 FRU
Totals with A	53 FRU	51 FRU	49 FRU	51 FRU	64 FRU

Or:

E. 00 72 300 - All Single Cell (3) and Dual-Cell (4) Modules

Labor Description	Labor Allowance	
Replacing all cell modules	99 FRU	

And, with any of the above:

Labor Description	Labor Allowance
Additional work with pressure test cooling system high-voltage battery	4 FRU
unit Associated work (coolant drained) (to high-voltage battery unit)	4110

Note: Claim labor operation 00 72 300 one-time only for the applicable total FRU allowance that applies.

Claim Repair Comments

Only reference this SIB number, the work package (Pkg) number performed, and cell modules replaced by their reference number in the RO technician notes and the claim comments (For example: B61 14 22 WP 1, Cell modules 2, 4, 5), unless otherwise required by State law.

Sublet – Bulk Materials (RO and Claim Comments Required)

Sublet Code 4	Up to \$100.00	Reimbursement for the repair-related bulk materials (Do not use the BMW part numbers for claim submission)
		Divir part name of the claim capinical city

Sublet reimbursement calculation for claiming the applicable repair-related bulk materials (BMW part numbers) is at the dealer net price amount for the quantities used plus your center's handling.

Enter this material cost in sublet and itemize the amount on the repair order and in claim comment section

Alternative Mobility Solution (AMS) for Vehicle Owners (RO and Claim Comments Required)

This Recall repair qualifies for Alternative Mobility Solution (AMS) expense reimbursement, claim this item under the Defect Code noted above as follows:

Sublet Code 2 - Itemize the AMS sublet amount on the repair order and in the claim comment section.

Please refer to SI B01 29 16 for additional information.

Reimbursement of Prior Customer-Pay Repairs (TREAD Act)

Based on the issue and the age of the Affected Vehicles being addressed by this Safety Recall Campaign, a reimbursement request for a qualifying prior customer-pay repair is not likely.

However, if you do receive a reimbursement request from a customer for a prior repair that may qualify, please contact the Warranty department (include a legible copy of the invoice) through IDS by selecting Coverage, Policy, Coding Questions and Mileage Corrections. The Warranty department will review and respond to your inquiry accordingly.

FEEDBACK REGARDING THIS BULLETIN

Technical Feedback	To submit feedback for the technical topics of this bulletin: Submit your feedback in the rating box at the top of this bulletin
Warranty Feedback	To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal
Parts Feedback	To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department

Supporting Materials

picture as pdf B611422 C 2 0322 0301 HV Battery Recall Training.pdf picture as pdf B611422 Recall Notice.pdf

about:blank 7/8

Attachment to B61 14 22 July 2022

SAFETY RECALL NOTICE

To: All Center Operators, Sales Managers, Service Manager, Parts Manager and Warranty Processor

RE: Recall 22V-541: High-Voltage Battery – B61 14 22

BMW AG is conducting a Voluntary Safety Recall (effective July 21, 2022) on a small number of Model Year 2022 BMW i4 Gran Coupe vehicles that were produced between November 22, 2021 and June 13, 2022.

Affected vehicles are not to be driven or charged and to be parked away from any buildings.

Please be reminded that it is a violation of federal law (The Safety Act) for you to sell, lease or deliver any new motor vehicle covered by this notification until the recall repair has been performed. This means that centers may not legally deliver new motor vehicles to consumers until they are fixed or use/sell replacement equipment/parts subject to this recall. Note also that substantial civil penalties apply to violations of the Safety Act.

Also, you should not sell, lease or deliver any Certified Pre-Owned or used vehicles subject to a safety recall until the repair is completed.

Please follow any special instructions that we provide to you for the return or disposition of recall parts.

We appreciate all your assistance with this Recall.

Attachment to B61 14 22 October 2022

Bulletin #: C-2-0322-03	01	☑ Take Note ☑ Tal	ke Action
☐ Retail Operator	☐ Sales Pre-Owned	☐ Business Manager	☑ Parts & Accessories
☐ General Manager	☐ Sales New Car	☑ Service	□ Administration
Name: Cesar Ortiz		Phone Number: 201-571	-5143
Title: Hazardous Materials Training for HV Battery Recall		Source: Aftersales Busine Service	ess Development & Technical
Date: 03.8.2022		Supersedes: B-2-0321-0)301

HAZARDOUS MATERIALS TRAINING FOR HV BATTERY RECALLS

TAKE NOTE

- RECALL 20V-601, (B61 23 20) & (B61 21 20) and RECALL 20V-490 (B61 17 20); HIGH-VOLTAGE BATTERY RECALL will be referred to in this document as HV Battery Recalls. HV Battery Recalls require Centers to ship dangerous goods/hazardous materials (DG/HM).
- Center employees preparing shipments of recalled battery modules must be trained in accordance with US DOT Hazardous Materials Regulations (HMR).
- Training materials are attached to DCS Message & will be hosted in CenterNet after DCS expires.
 For DGIS subscribers, the materials can also be accessed on the DGIS Homepage. Training content includes general, safety and security awareness as well as function-specific material that references battery modules and packaging applicable to HV Battery Recalls.
- A training acknowledgement letter will be used to communicate to BMW the names of the employee(s) who complete this training. **ITAP**, the HV recall battery recovery services provider, will request a copy of this letter before arranging Center shipments.
- Recalled parts that are removed from BMW vehicles cannot be used for resale! The recalled
 parts are the property of BMW NA. Your Center is responsible for the proper identification,
 storage, and documentation of these parts. They must be held in a secure retention area until
 notification of claim payment is made by BMW NA through DCSnet.

TAKE ACTION

- Have designated DG/HM employee(s) review training materials and complete included test.
- Using included answer key, grade test(s) to confirm employee understands how to perform the functions outlined in training materials.
- Complete one training acknowledgement letter with the names of each employee who successfully completed training and return to the BMW Dealer Services Group via IDS Parts Logistics US>Returns/Claims/Quality>Other prior to initiating recall shipments.

DETAILS

RECALL:

High voltage battery modules are classified as damaged, defective, or recalled (DDR) lithiumion batteries. Shipments of recalled batteries require special packaging, and employees preparing packages must have applicable regulatory compliance training.

KEY REMINDERS:

Acknowledgement letter must be returned to BMW before battery shipments can be initiated.

LEGAL REQUIREMENTS:

Certain legal requirements must be fulfilled to tender hazardous materials for transportation. These requirements include, but are not limited to:

- Centers must have *at least* one hazmat employee trained according to US DOT regulations (<u>49</u> CFR, Part 172, Subpart H) to prepare recalled battery shipments.
- Lithium ion batteries must be packaged, marked, labeled, and documented in accordance with applicable requirements of 49CFR, Parts 100-185, the Hazardous Materials Regulations. This information can be found in above referenced training and supplemented by instructional documents provided by ITAP.
- A separate communication will provide packaging and reverse logistics details. ITAP will provide
 module packaging kits and guidance for assembling and closing the packages. ITAP will also
 coordinate reverse logistics to their recovery location.
- ITAP will provide hazmat shipping papers to Centers once modules are packaged and prepared for shipment.
 - DO NOT USE DGIS to create hazmat shipping papers.
 - US DOT regulations require all hazmat shipping papers (e.g. bills of lading/BOLs) to be retained and accessible for two years after the date of shipment (49 CFR 172.201(e)).
- Emergency response phone number and information will also be provided by ITAP for module shipments.
- The Center is exclusively responsible for ensuring compliance with all current US DOT hazardous materials transportation regulations (49CFR, Parts 100-185).
- The Center will be responsible for all fines or penalties resulting from improper shipment of hazardous material to ITAP.

PREREQUISITE FOR HV BATTERY RECALL SHIPMENTS:

- Centers are required to submit acknowledgement of completion of DDR lithium battery training to BMW before shipping any recalled modules.
- Acknowledgement letter must be scanned and sent to the Dealer Services Group via IDS Parts Logistics US>Returns/Claims/Quality>Other
- Centers are required to submit their training acknowledgement form to ITAP when scheduling their first pickup.

MORE QUESTIONS?

Training files are hosted in CenterNet Via:

Menu>BMW>Aftersales>Business Development & Marketing Portal>Batteries>HV Training Module

Aftersales Business Development Contacts:

Name	Phone	Email	Title
Cesar Ortiz	201-571-5143	Cesar.S.Ortiz@bmwna.com	Chemical & Battery Program Manager
Jimmy Cox	201-307-4324	James.JC.Cox@bmwna.com	Chemical, Battery & Oil Program Sales Manager
Joachim Pusch	201-546-4635	Joachim.Pusch@bmwna.com	Aftersales Business Development Manager –
Joucillii Pusch			Service and Parts