
	GROUP	MODEL		
	Safety Recall Campaign	2012-2013MY		
		Optima (QF)		
	NUMBER	DATE		
	SC245	September 2022		
SAFETY RECALL CAMPAIGN				
ADHESIVE TAPE APPLICATION				
SUBJECT: ON HEADLINER	PLATES (SC245)			

This bulletin provides information to further secure the headliner plates with adhesive tape on certain 2012-2013MY Optima (QF) vehicles produced at Kia Georgia from August 12, 2011 through September 27, 2013. The subject vehicles are equipped with headliner plates designed as part of the energy absorbing structure of the headliner. Under certain circumstances, the headliner plate(s) may detach from the headliner upon deployment of the side curtain airbag(s), increasing the risk of injury to an occupant. If the headliner plate(s) become detached upon deployment of the side curtain airbag(s), an occupant may be injured. Follow the procedure outlined in this publication to add the supplied adhesive tape in the specified locations. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs.

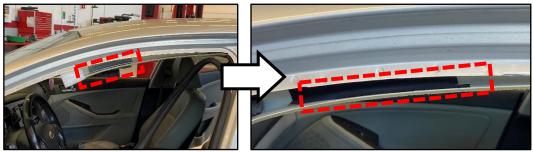

Location of Adhesive Tape Application on Headliner Plate

There is no charge to the vehicle owner for this repair. Under applicable law, you may not sell or otherwise deliver any affected vehicle until it has been repaired pursuant to the procedures set forth in this bulletin.

To assure complete customer satisfaction, always remember to refer to WebDCS Warranty Coverage (validation) Inquiry Screen (Service \rightarrow Warranty Coverage \rightarrow Warranty Coverage Inquiry) for a list of any additional campaigns that may need to be performed on the vehicle before returning it to the customer.

A printed copy is for reference only; publication information can be updated at any time. Always refer to KGIS for the latest information. After logging in kdealer.com, the newest technical publications are listed in 'Service Releases' and has the latest service information that has been released. SUBJECT:

ADHESIVE TAPE APPLICATION ON HEADLINER PLATES (SC245)

Repair Procedure:

1. Carefully remove the headliner clips (A).

Use a non-marring trim removal tool (such as Snap-on[®] Part Number PBN5 or equivalent) to avoid damaging trim pieces.


 Remove the front pillar trim (B) by referring to "Body (Interior and Exterior) → Interior → Interior Trim → Repair procedures (Front Pillar Trim)" in the applicable Shop Manual on KGIS.


- Wear disposable latex gloves to prevent soiling the headliner.
- Be careful <u>not</u> to damage trim panels or covers while removing/installing

Note: Fasteners/Clip replacement:

- Replace 85815 3S100 Clip/Tether.
 (May not be re-used)
- Replace 82315 33020 Fastener (Only if broken or damaged).




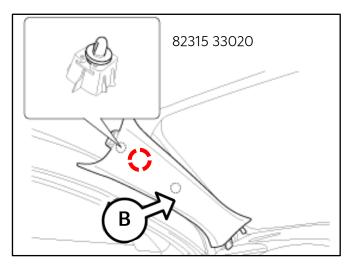

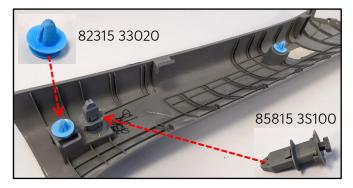

🗲 TECH TIP

When the front pillar trim is pulled away from pillar, the clip/tether may be cut in the area shown so it may be removed. The remaining clip in the trim can be twisted off once the trim is removed from the vehicle.

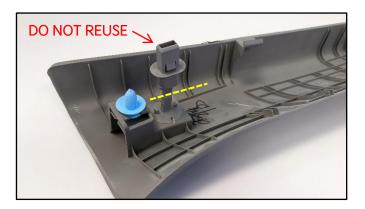

SUBJECT:


ADHESIVE TAPE APPLICATION ON HEADLINER PLATES (SC245)


- Refer to "Body (Interior and Exterior) → Interior
 → Roof Trim → Repair procedures" in the Shop
 Manual on KGIS to remove the following parts:
 - E. Sunvisors (2)
 - F. Sunvisor Retainers (2)
 - G. Assistant Handles (2) Front

4. Partially detach the upper section of the door weather strip (H).

5a. Carefully and gently pull down the headliner from the (LH and RH) front door openings to expose the metal plates (I) in the front areas shown.

5b. <u>Note</u>: Insert a pair of 1.5" (40mm) thick foam blocks (J) to prevent damage to headliner and provide working space between the headliner and vehicle roof.

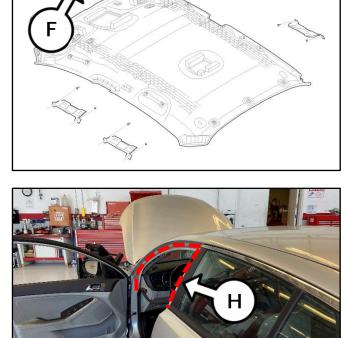

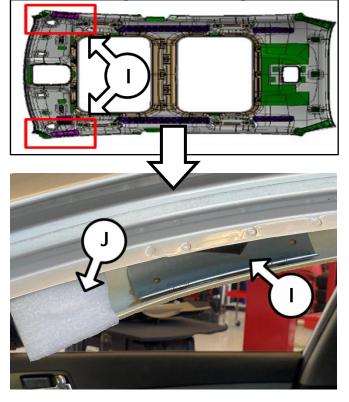



Page 4 of 5

SUBJECT:

ADHESIVE TAPE APPLICATION ON HEADLINER PLATES (SC245)

6a. Using a ruler/measuring tape, measure the metal plate and <u>add</u> 1" inch to the front and rear of the metal plate and ³/₄" inch to both sides of the metal plate.

6b. Cut out a piece of the adhesive tape to cover the plate including excess area measured as noted above. The adhesive tape will exceed coverage over the metal plate shown.


- 7a. Adhere the tape over the plate and carefully apply pressure not to exceed the headliner from lowering below the foam pad thickness of 1.5" (40mm).
- 7b. <u>Note</u>: Ensure no excess adhesive tape is exposed from headliner edge area.

🖌 TECH TIP


Use one hand to apply downward pressure and the other hand to push upward, against the applied pressure area.

8. Reinstall all removed parts in the reverse order of removal.

<u>Note</u>: Replace any broken clips that may have broken during removal.

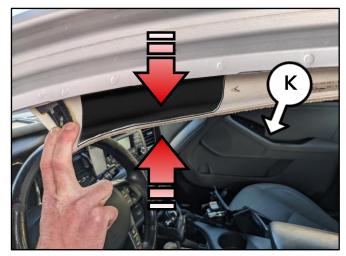



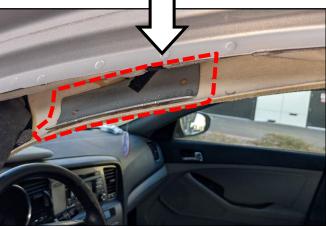

ADHESIVE TAPE APPLICATION ON HEADLINER PLATES (SC245)

AFFECTED VEHICLE RANGE:

Model	Production Date Range		
Optima (QF)	August 12, 2011 to September 27, 2013		

REQUIRED PART:

SUBJECT:

Part Name	Part Number	Figure	Qty.	Comments	
Industrial-grade Adhesive Tape	85365 4C200QQK	- Comments	2	One per Side	
Clip (Tether)	85815 3S100		2	(LH & RH)	
Fastener	82315 33020*		4	1-4 fasteners (If needed)	

*Only replace if damaged or broken.

WARRANTY INFORMATION:

N Code: N99 C Code: C99

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
R 85310 R 4C00087		(SC245) O Adhesive Tape Application on Headliner Plates	221A16RO	0.5 M/H	85365 4C2OOQQK	2	
	0				85815 3S100	2	
					82315 33020	Up to 4	

Refer to Warranty Bulletin 2022-36 for claim submission procedures.

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SC245 when accessing the WebDCS system.