

# Technical Information

199/22 ENU ANB4

Service

9


# ANB4 - Retrofitting Locking Caps on the Front Left and Right Headlights (Stop Delivery / Recall Campaign)

Model Line:	Boxster / Cayman (981) 718 Boxster / 718 Cayman (982)
Model Year:	As of 2012 up to 2022
Country / Market:	USA (C02) Canada (C36)
Concerns:	Caps in luggage compartment
Information:	There is a possibility that a locking cap that prevents the adjustment of the headlights in the horizontal direction was not installed during vehicle assembly on the affected vehicles. If this is the case, certain legal requirements will not be met in the USA and Canada markets.
Action required:	Check installation of the caps and retrofit a cap in the front luggage compartment on the left and right if necessary.
	Every vehicle is exactly assigned just two campaign scopes.
	$\Rightarrow$ To find out which scope is assigned to the vehicle, see PCSS Vehicle Information.
Affected	Only vehicles assigned to the campaign (see also PCSS Vehicle Information).

Vehicles:

Installation

Position:

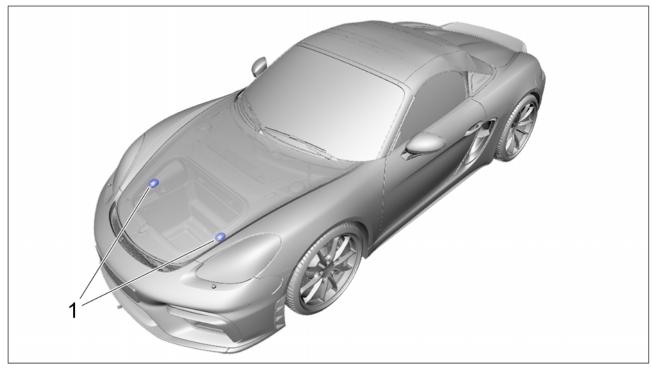

Installation position of caps (example 718 Spyder 982)

1 – Cap (retrofit)

# **Required parts**

Parts Info: Required parts:

Part No.	Designation – Location	Number
V04015001KA	$\Rightarrow$ Plug – Headlight adjusting screws	2 pieces


# Checking caps and retrofitting them if necessary

Work Procedure: 1 Open front lid.

2 Remove plastic box with tyre sealant compound and plastic box with tool kit in front luggage compartment.

# **AfterSales**

3 Check that a cap is installed in the front luggage compartment on the left and right. ⇒ Checking sealing caps

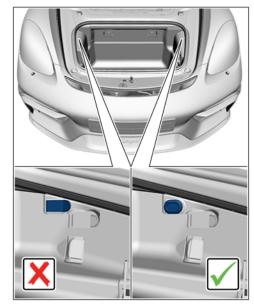

Checking sealing caps

Assessment		Action
(~)	A cap is installed in the front luggage compartment on the left and right.	End of remedial action. Continue with Step 5.
(X)	There is <b>no</b> or only one <b>capinstalled in the</b> front luggage compartment on the left and right.	Retrofit cap. Continue with Step 4.

4 Retrofit cap.

**Technical Information** 

4.1 Remove old stopper  $\Rightarrow$  *Previous stopper*-1in the front luggage compartment at the left and right.



Previous stopper

- 4.2 Press a cap  $\Rightarrow$  Cap -2- into the now existing opening in the front luggage compartment on the left and right until you hear a distinct click.
- 5 Install plastic box with tyre sealant compound and plastic box with tool kit.
- 6 Close front lid.
- 7 Enter the campaign in the Warranty and Maintenance booklet.



Сар

## Warranty processing

#### i Information

The specified working time was determined specifically for carrying out this campaign and includes all necessary preliminary and subsequent work.

The working time may differ from the working times published in the Labor Operation List in the PCSS.

Scope 1 - 2: Not relevant for this vehicle type.

### Scope 3: Checking caps

Labor time: Checking caps

Labor time: 15 TU

## $\Rightarrow$ Damage Code ANB4 099 000 1

Scope 4 - 11: Not relevant for this vehicle type.

## Scope 12: Retrofitting caps

 Labor time:

 Retrofitting caps

 Includes:
 Checking caps

 Parts required:

 V04015001KA
 Plug

 ⇒ Damage Code ANB4 099 000 1

# **AfterSales**

Technical Information	Service	9
	199/22 ENU ANB4	

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2022 Porsche Cars North America, Inc.

**AfterSales** 

Nov 11, 2022 Page 5 of 5