

RECALL 22V750 / 2022-572 REMEDY INSTRUCTIONS



Make(s): PRIME TIME - AVENGER
Model(s): AVT23BHS
Model Year(s): 2023

Concern:
The rear bunkroom flip-up bunk supporting angle brackets may not have been installed completely into backers in the walls.

Repair Code: RC-076-13-00-004255
Allotted Time: .50
Inspection Code: N/A
Allotted Time: N/A
Photo(s) Required: YES
Prior Authorization Required: NO
Part(s) Kit Number: F100363060
Part(s) Return: N/A

Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

STEP 1: LOCATE SLIDEROOM UPPER BUNK;

- RAISE THE UPPER BUNK INTO THE NON-USE POSITION;

STEP 2: LOCATE THE WHITE ALUMINUM ANGLE BRACKETS ON EACH SIDE OF THE BUNK;

- ONE WILL BE ON THE LEFT (REAR) WALL AND ONE WILL BE ON THE RIGHT (FRONT) WALL;

STEP 3: REMOVE THE BRACKETS FROM THE WALL WITH CARE;

- APPLY LIQUID NAILS TO THE BACKSIDE OF THE ALUMINUM BRACKET(S)

STEP 4: RE-INSTALL THE ALUMINUM BRACKETS TO THE WALL, USING THE SAME HOLES AND FASTENERS;

- ENSURE THE LIQUID NAILS IS SQUISHED SO IT MAY BOND THE PANEL AND BRACKET;

STEP 5: USING CARE, KNOCK ON THE WALL AND LOCATE TWO ADDITIONAL STUDS CLOSEST TO THE INTERIOR OF THE VEHICLE;

- LOCATE AND INSTALL ADDITIONAL FASTENERS IN THIS LOCATION TO ENSURE THE BRACKET(S) ARE SECURED PROPERLY TO THE WALL;

STEP 6: INSTALL THE TWO STYLES FROM THE PARTS KIT AT THE CENTER OF THE ALUMINUM BRACKET AND TO THE FLOOR;

- ONE STYLE FOR LEFT BUNK BRACKET AND ONE STYLE FOR THE RIGHT BUNK BRACKET;
- APPLY LIQUID NAILS TO THE BACKSIDE OF THE STYLES;
- ENSURE THE LIQUID NAILS IS SQUISHED SO IT MAY BOND THE STYLE AND WALL PANEL;
- FIGURE 1 (LEFT) FIGURE 2 (RIGHT)

STEP 7: CLEAN AREA;

STEP 8: CLAIM REPAIR CODE.

FIGURE 1



FIGURE 2

