



VOLUNTARY RECALL CAMPAIGN

Classification: AN22-025	Reference: NTB22-090	Date: October 13, 2022
-----------------------------	-------------------------	---------------------------

VOLUNTARY SAFETY RECALL CAMPAIGN 2021-2022 ROGUE; INFOTAINMENT SYSTEM REPROGRAM

CAMPAIGN ID #: R22C1 and PC925
APPLIED VEHICLES: 2021-2022 Rogue (T33)
APPLIED GRADES: SL, SV And Platinum

**Check Service COMM or Dealer Business Systems (DBS)
National Service History to confirm campaign eligibility.**

INTRODUCTION

Nissan is conducting this voluntary safety recall campaign on certain specific model year 2022 Rogue SL, SV and Platinum vehicles to reprogram the Infotainment system. This service will be performed at no charge to the customer for parts or labor.

IDENTIFICATION NUMBER

Nissan has assigned identification numbers R22C1 and PC925 to this campaign. This number must appear on all communication and documentation of any nature dealing with this campaign.

DEALER RESPONSIBILITY

It is the dealer's responsibility to check Service COMM or Dealer Business Systems (DBS) National Service History for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. **Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration.** While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

REQUIRED SPECIAL TOOL

- One of the special tool USB drive J-52727-1 (new tool number NI-52727-1) has been previously shipped to each dealer and should already be available (Figure 1).
- Do not use any other USB drive to perform the procedure in this bulletin.
- Additional USB drives may be purchased from Tech•Mate: www.techmatetools.com or 1-833-397-3493.

HINT:

- The update-software only needs to be downloaded once and can then be used continuously on multiple **APPLIED VEHICLES**.
- The update-software must be the only file on the USB drive.



Figure 1

SERVICE PROCEDURE

Update the AV Control Unit

IMPORTANT: Before starting, make sure:

- ASIST is connected to the internet.
- ASIST has been synchronized (updated) to the current date.

1. Insert special tool USB drive into the CONSULT PC.
 - If the infotainment software has already been downloaded onto special tool USB drive from a prior service procedure, skip to step 10 on page 7.

HINT:

- Special tool USB drive is the only USB drive approved for use with this procedure.
 - The update-software is estimated to take **4 hours** to download to the USB drive.
 - The update-software must be the only file on the USB drive.
2. Open ASIST.
 3. Select **Specialty Tools**, and then select **Infotainment Software Updates**.

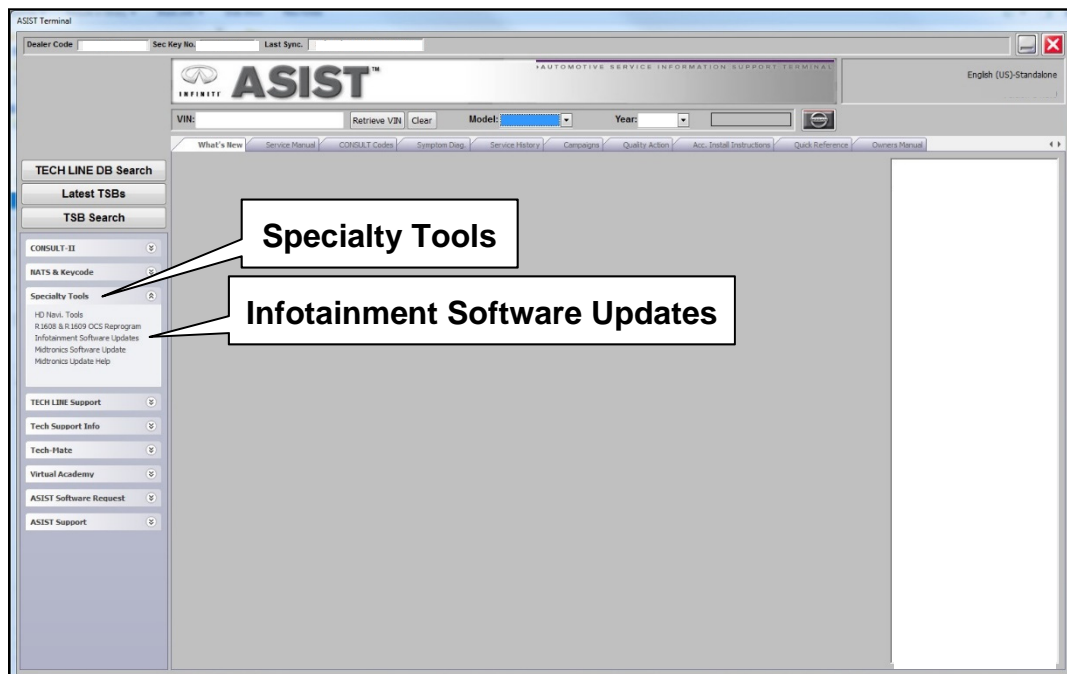


Figure 2

- Use the drop-down menu and select the location of the USB drive that was inserted in step 1 on page 3.

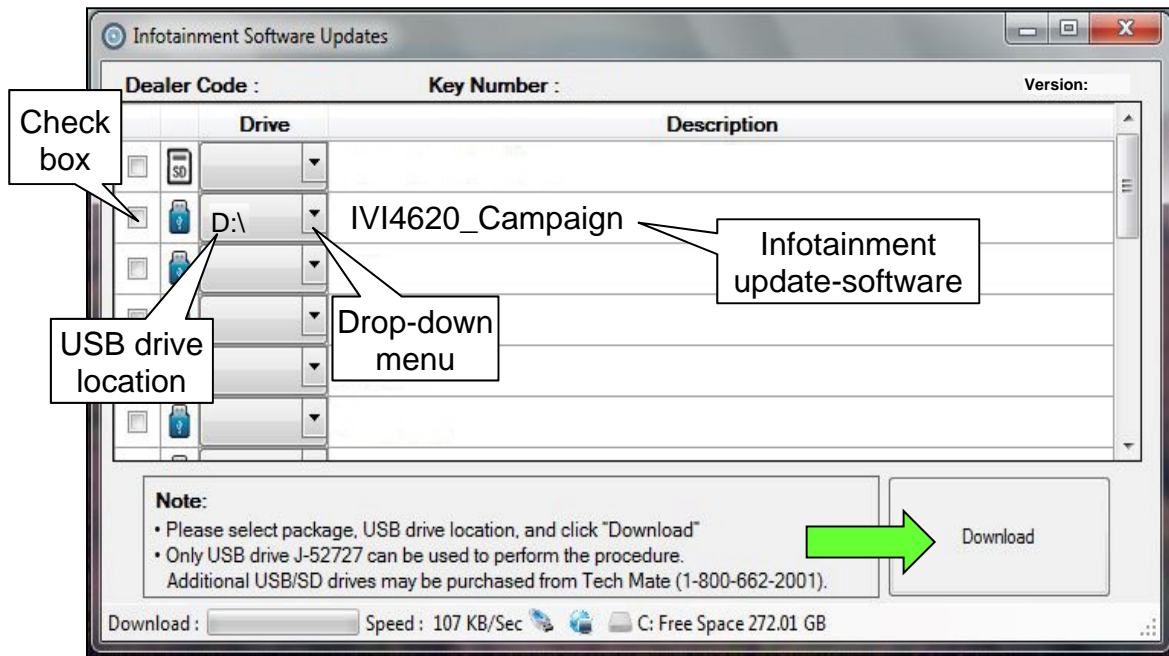


Figure 3

- Select the **Infotainment Update-Software** related to the model on the Repair Order (refer to **Table A** below).

Table A

Model	Infotainment Update-Software
Rogue (T33)	IVI4620_Campaign

6. Select **Download** (Figure 3 on page 4), and then wait for the download to complete.

HINT:

- The update-software is estimated to take **4 hours** to download to the USB drive.
- If, while attempting to download the software to the CONSULT PC, you receive the message shown in Figure 4:
 - a. First attempt to clear space on the CONSULT PC hard drive.
 - b. If space cannot be cleared and a second CONSULT PC is available with space, use it and start over from step 1 on page 3.

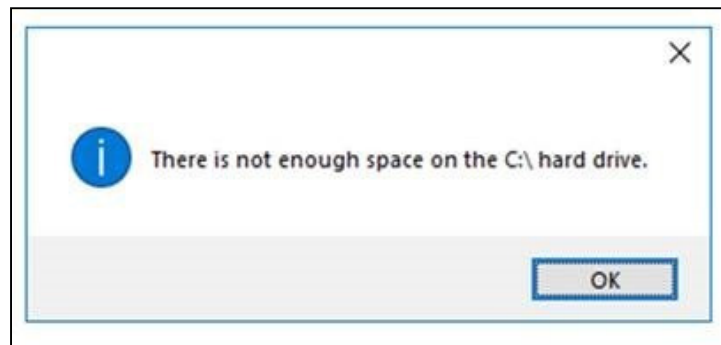


Figure 4

7. Select **OK**.

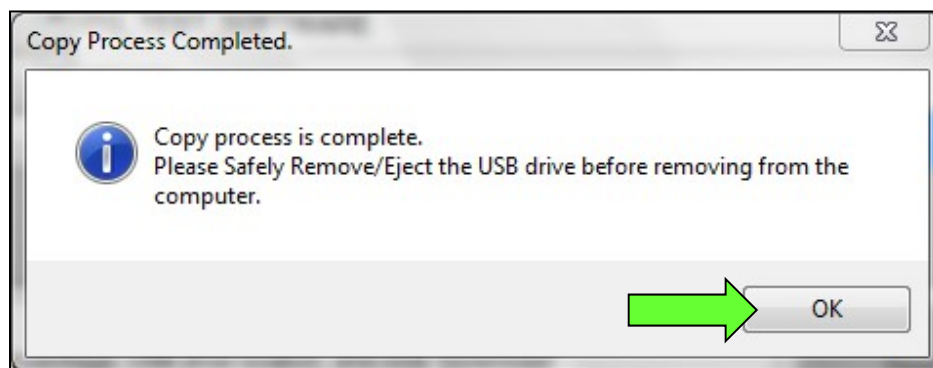


Figure 5

8. Once the transfer is complete, safely remove the USB drive from the CONSULT PC.
 - a. From the PC toolbar, select the **Safely Remove Hardware** icon.
 - o The icon is on the toolbar, or can be found after selecting the arrow.
 - b. Select the USB drive to be removed, and then remove the USB drive from the CONSULT PC.

NOTICE

Follow the steps to safely remove the USB drive. If not followed, the USB drive may corrupt the infotainment update-software.

- o If you are not familiar with the process of safe USB drive removal, ask for assistance at your dealer.

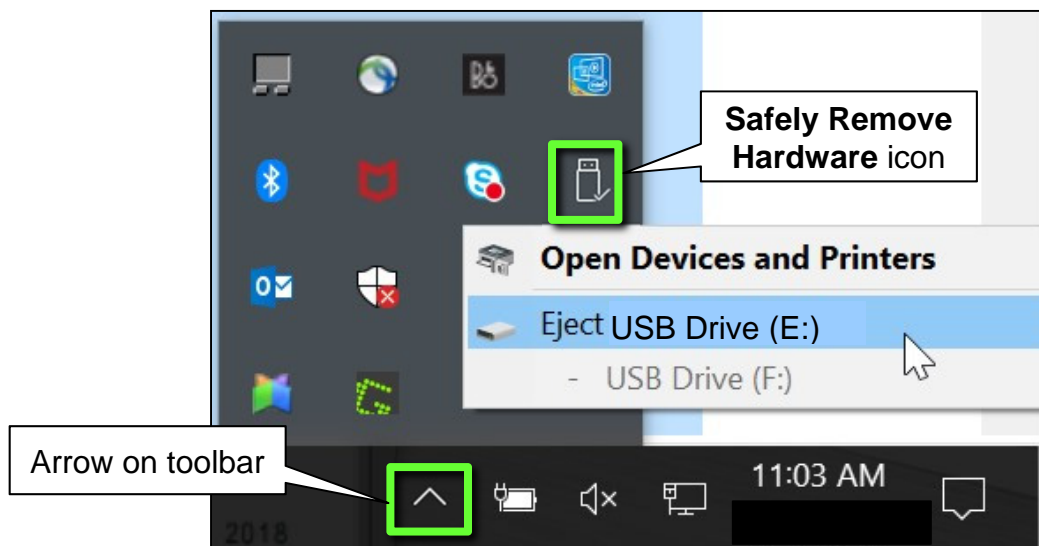


Figure 6

9. Close all ASIST **Infotainment Software Update** screens.

⚠ WARNING

To avoid the risk of death or serious personal injury when updating software, park the vehicle in a secure, safe, well ventilated location that is open to the air and apply the parking brake.

10. Start the engine, and then wait 60 seconds for the system to load.

HINT: The engine needs to idle for the duration of the update to retain battery charge.

11. Insert the USB drive with the infotainment update-software into the vehicle's USB media port (Figure 7).

- Do not remove the USB drive during the update to the vehicle until instructed to.

HINT: Charging ports are marked in the vehicle with a “lightning bolt” symbol.

NOTICE

Do not insert the USB drive into a charging port. If used, the update-software and/or USB drive may become damaged. Only insert the USB drive in a USB media port.

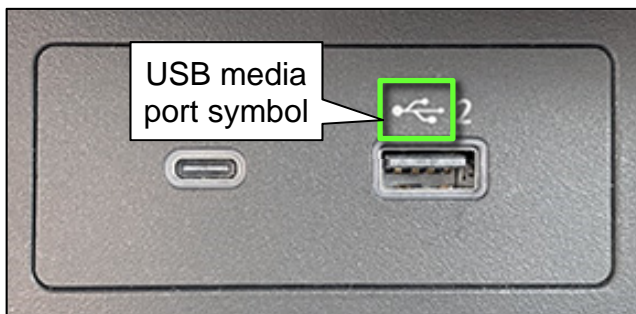


Figure 7

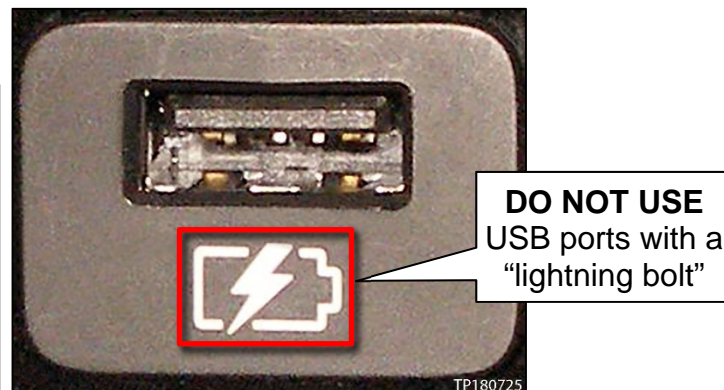


Figure 8

12. Wait approximately 10-30 seconds for the screen in Figure 9 to appear.



Figure 9

- The screen in Figure 10 may briefly appear. **Do not remove the USB drive.** The audio system will detect the USB drive and continue the update.



Figure 10

13. Wait for the update to complete.
 - Follow the on-screen instructions while waiting.

HINT: The update may take 15-25 minutes.

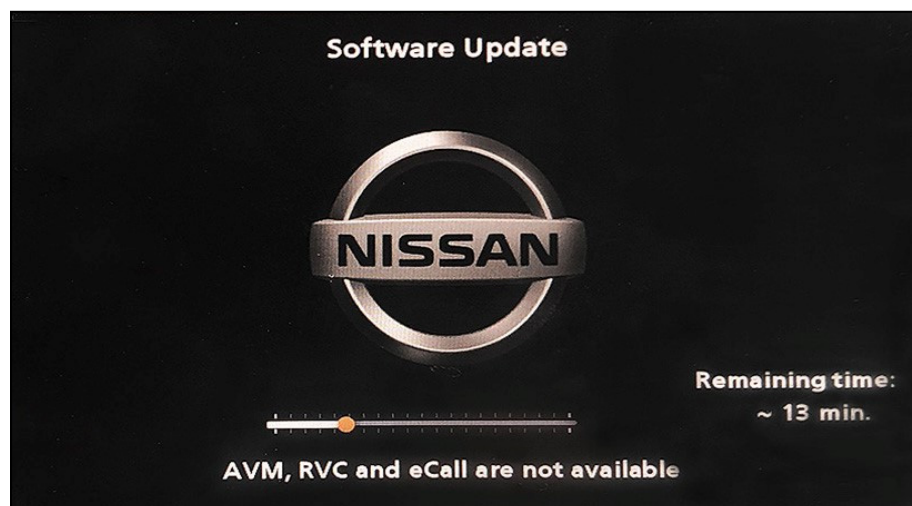


Figure 11

14. Once the update is complete (Figure 12), remove the USB drive; the system will reboot (restart).

HINT: The system will not reboot until the USB drive is removed.



Figure 12

NOTICE

Steps 15-24 must be completed. If they are not completed, the update may become corrupted.

15. Allow the reboot to complete (approximately 30 seconds).
 - The Nissan logo will be displayed during the reboot.
16. Turn the ignition OFF.

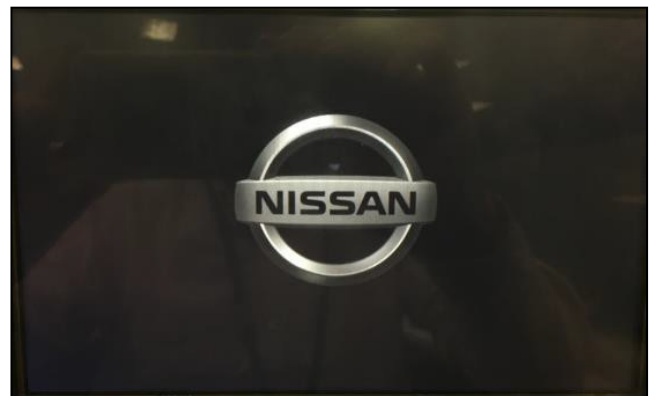


Figure 13

The steps below will fully reboot the infotainment system twice.

17. Open and close the driver door, and then ensure that all doors are closed.
18. Lock the doors.
19. Wait 5 minutes.

NOTICE

Ensure that all doors remain closed during the 5-minute wait period. If a door is opened during the 5-minute wait period, the update may not complete and the AV Control Unit may become inoperable.

20. Unlock the doors.

HINT: The engine does not need to be running for the next steps.

21. Turn the ignition ON (engine OFF) and wait for the Nissan logo to appear (Figure 13 on page 9).
 - If the Nissan logo does not appear (this might take up to 30 seconds), start over from step 16 on page 9.

22. After the Nissan logo appears, wait about 1 minute.
 - The **MENU** (Home) screen in Figure 14 will be displayed.

23. Turn the ignition OFF.



Figure 14

24. Repeat steps 17-23 one more time (for a total of two times) to complete the update.

CLAIMS INFORMATION

Submit a “CM” line claim using the following claims coding:

CAMPAIGN (“CM”) ID	DESCRIPTION	OP CODE	FRT
R22C1	Perform USB Software Update	R22C10	0.3

OR

Submit a “CM” line claim using the following claims coding:

CAMPAIGN (“CM”) ID	DESCRIPTION	OP CODE	FRT
PC925	Perform USB Software Update	PC9250	0.3

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
October 13, 2022	NTB22-090	Original bulletin published

