


RECALL 22V828 / 2022-637 REMEDY INSTRUCTIONS

	Make(s): ALTA Model(s): MANY, SEE BELOW Model Year(s): 2022 - 2023	Repair Code: RC-056-03-00-004265 Allotted Time: .20 HRS. Inspection Code: N/A Allotted Time: N/A
	Concern: The side marker lamps may not reflect light and be conspicuous to other motorists, which may lead to a crash.	Photo(s) Required: YES, PRE/POST REMEDY Prior Authorization Required: N/A Part(s) Kit Number: N/A Part(s) Return: F100368650

Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

CERTAIN: 2022 – 2023 – ALTA – ALT1900MMK, ALT2100MBH, ALT2350KRK, ALT2600KRB, ALT2800KBH, ALT2810KIK, ALT2850KRL, ALT2900KBH, ALT3150KBH, ALT1900MMK, ALT2100MBH, ALT2350KRK, ALT2600KRB, ALT2800KBH, ALT2810KIK, ALT2850KRL, ALT2900KBH & ALT3150KBH

CERTAIN: 2023 – ALTA – ALT2210MBH

REMEDY:

STEP 1: LOCATE THE RED MARKER LAMPS ON THE REAR PART OF THE CURB SIDE WALL AND ROAD SIDE WALL;

- FIGURE 1 & 2

STEP 2: CLEAN THE AREA DIRECTLY ABOVE THE RED MARKER LAMP(S) WITH ISOPROPYL ALCOHOL;

STEP 3: PEEL THE BACKING TAPE OFF THE RED REFLECTOR(S) ADHESIVE AND PLACE THE REFLECTOR DIRECTLY ABOVE THE RED MARKER LAMP(S) ON THE CURB SIDE AND ROAD SIDE;

- FIGURE 3

STEP 4: LOCATE THE AMBER MARKER LAMPS ON THE MID AND FRONT PART OF THE CURB SIDE WALL AND ROAD SIDE WALL;

- MID-SHIP LAMP MAY OR MAY NOT BE PRESENT DEPENDENT ON THE OVERALL LENGTH OF THE VEHICLE;
- IF MID-SHIP LAMP IS NOT PRESENT, **DO NOT** INSTALL REFLECTORS;
- IF MID-SHIP LAMP IS PRESENT, **DO** INSTALL REFLECTORS;
- FIGURE 1 & 2

STEP 5: CLEAN THE AREA DIRECTLY ABOVE THE AMBER MARKER LAMP(S) WITH ISOPROPYL ALCOHOL;

STEP 6: PEEL THE BACKING TAPE OFF THE AMBER REFLECTOR(S) ADHESIVE AND PLACE THE REFLECTOR DIRECTLY ABOVE THE AMBER MARKER LAMP(S) ON THE CURB SIDE AND ROAD SIDE;

- FIGURE 4

STEP 7: CLAIM REPAIR CODE.

PHOTOS ON NEXT PAGE PAGE.

RECALL 22V828 / 2022-637 REMEDY INSTRUCTIONS



Make(s): ALTA
 Model(s): MANY, SEE BELOW
 Model Year(s): 2022 - 2023
 Concern:
 The side marker lamps may not reflect light and be conspicuous to other motorists, which may lead to a crash.

Repair Code: RC-056-03-00-004265
 Allotted Time: .20 HRS.
 Inspection Code: N/A
 Allotted Time: N/A
 Photo(s) Required: YES, PRE/POST REMEDY
 Prior Authorization Required: N/A
 Part(s) Kit Number: N/A
 Part(s) Return: F100368650

FIGURE 1



FIGURE 2



FIGURE 3



REAR RED SIDE MARKER LAMP(S)
 - INSTALL REFLECTOR
 - CURB & ROAD SIDE REAR

FRONT & MID-SHIP SIDE MARKER LAMP(S)
 - INSTALL REFLECTOR
 - CURB & ROAD SIDE FRONT & MID-SHIP

FIGURE 4

