

Recall campaign 5622K – Headlight Adjustment Prevention Caps

A. VEHICLE INSPECTION PROCEDURE

1. Verify the vehicle is within the following ranges:


NOTE: None of the vehicles below were sold in the United States. The vehicles were sold by Mazda Puerto Rico but should be repaired if presented to a Mazda dealer.

Model	Subject VIN range	Subject production date range
2020-2021MY Mazda2	3MD DJ**** LM 400466 – 402865 3MD DJ**** MM 404276 – 409068	From November 1, 2019 through December 9, 2021

The asterisk symbol "*" can be any letter or number.

- If the vehicle is within the above VIN and production date ranges, proceed to Step 2.
 - If the vehicle is not within the above VIN and production date ranges, after verifying with Dealer Recall Help or Mazda Warranty, return the vehicle to the customer or inventory.
2. Fill out Dealer Recall Help on OneMazda or contact the Mazda Warranty department and include the VIN and this recall number. The team will advise if the recall is unrepaired. The recall will not display in eMDCS but you can enter a warranty claim. If unrepaired, please proceed below. The Mazda dealer or the customer can verify the recall status on www.mazdarecallinfo.com.

NOTE: Verify the campaign number as the vehicle may have multiple labels.

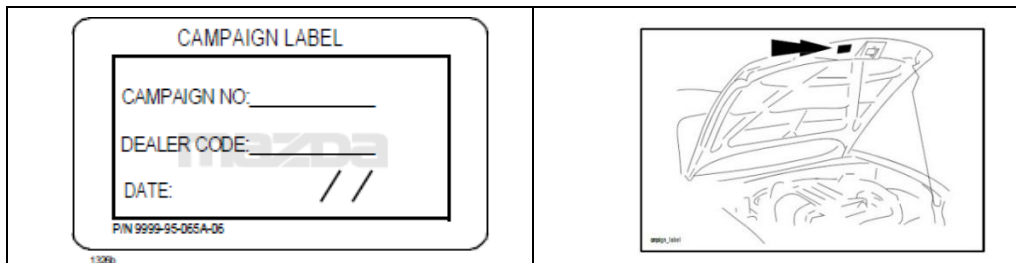


eMDCS System - Warranty Vehicle Inquiry Results:

Dealer Recall Help or Warranty Advised:	Campaign Label is:	Action Required:
"Dealer Recall Help or Warranty advised Open or repair incomplete"	Present	Contact the Warranty Hotline at (877) 727-6626, option 3 to update vehicle history.
	Not Present	Proceed to "REPAIR PROCEDURE".
"Dealer Recall Help or Warranty has advised Campaign: 5622K Closed and repaired"	Present	Return vehicle to inventory or customer.
	Not present	Complete a label and apply it to vehicle's bulkhead or hood.
"Dealer Recall Help advised vehicle is not in the campaign"	Does not apply	Campaign does not apply to this vehicle. Return the vehicle to inventory or customer.

B. REPAIR PROCEDURE

The photos below are of the RH side of the vehicle. Please perform the repair to both sides, RH and LH on the vehicle. The repair is the same for both sides of the car.

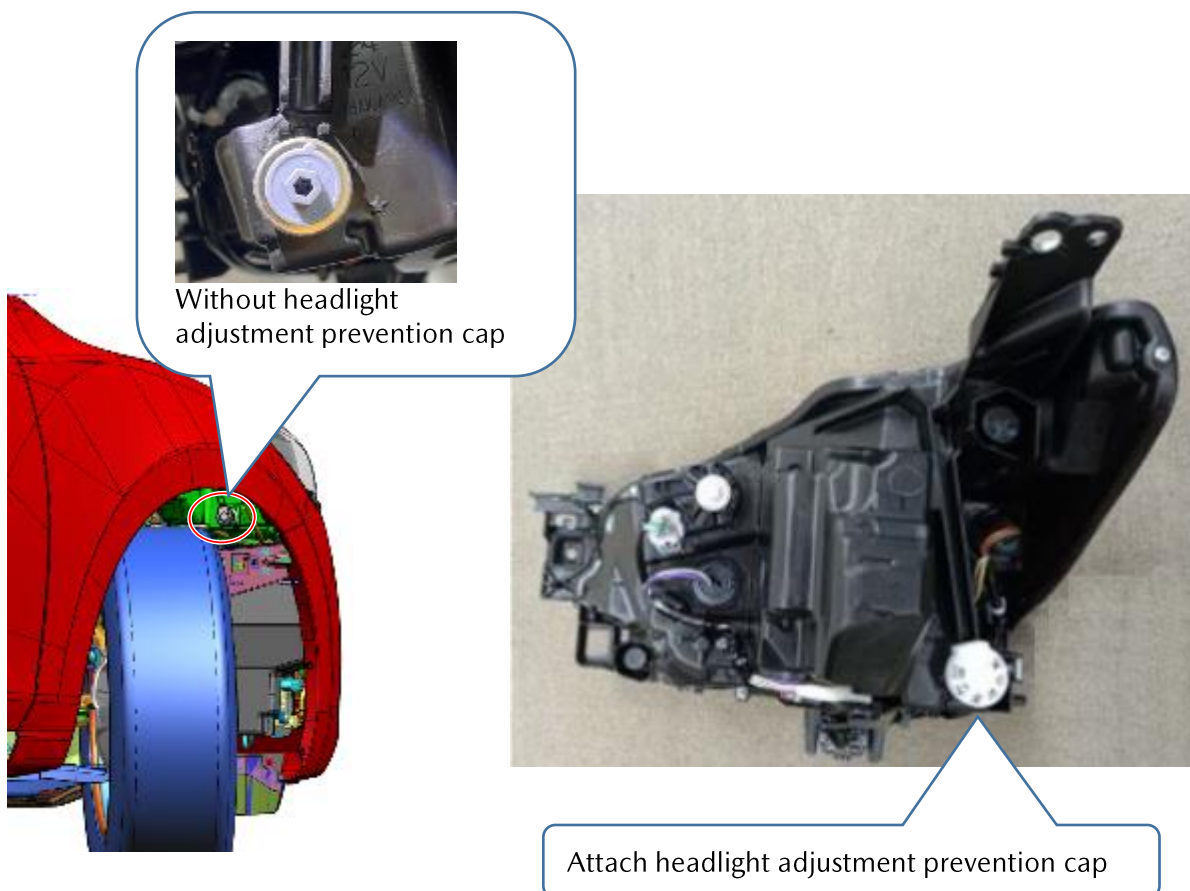

Removal of the Fender Well (LH Side shown below)

1. Turn the steering wheel completely to the right
2. Remove 6 fasteners using a standard body pry tool.



3. Gently peel back the front mudguard and locate the headlight aiming bolt.



4. Attach the headlight adjustment prevention cap.

NOTE:

Confirm that the cap is firmly attached with a click sound, and check that it is firmly attached.




5. Re-install the front mudguard attaching the 6 fasteners in the reverse order of removal.
6. ***IMPORTANT:*** Repeat this repair with the RH Side of the vehicle. Attach the headlight adjustment prevention cap to the other headlight going back to Section B, step 1 which is the same procedure.

MOVE TO SECTION C. AFTER COMPLETING INSTALLATION OF BOTH THE RIGHT AND LEFT HEADLIGHT CAPS

C. CAMPAIGN LABEL INSTALLATION

1. Fill out a "Campaign Label" (9999-95-055A-06) with Campaign No: "5622K", your dealer code and date of repair.

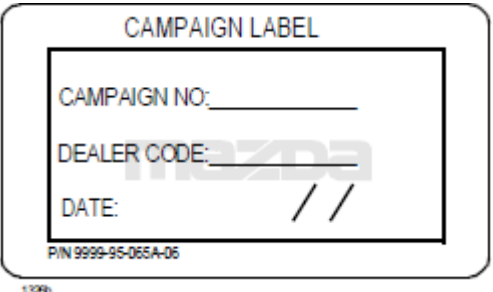

2. Affix it to the hood or bulkhead as shown:

