Equipment Recall

ER22-15A

Date Expiration Page

09.2022 N/A 1(5)

Revision A Table update – 4 last lines were missing 02-13-2023

ALTERNATOR BELTS REPLACEMENT

NHTSA Recall #22E-030

Transport Canada Recall #2022-191

Applicable vehicles: VIN ER22030UXXXXXXXXX

DESCRIPTION

Prevost has decided that a defect which relates to motor vehicle safety exists in certain alternator belts sold through its parts network from 2015 to 2022.

These alternator belts were sold to customers as replacement for 2010 to 2023 Prevost vehicles and 2020 to 2022 Volvo 9700 coaches

MATERIAL

Prevost Part Number	Belt Type
506015	Belt, Poly V 10PK1892
506020	Belt, Poly V 8PK1575
506026	Belt, Poly V 10PK1695
506034	Belt, Poly V 10PK1695
506067	Belt, Poly V 10PK1705
506070	Belt, Poly V 8PK1587
506077	Belt, Poly V 10PK1705
506080	Belt, Poly V 8PK1575
506083	Belt, Poly V 8PK1435
506114	Belt, Poly V 8PK1524
506134	Belt, Poly V 8PK1587
506167	Belt, Poly V 8PK1512
506188	Belt, Poly V 8PK1600
5060140	Belt, Poly V 8PK1840
23577315	Belt, Poly V 8PK1410 (Volvo 9700 only)
506084	Belt, Poly V 10PK1708


Date Expiration Page 09.2022 N/A 2(5)

DEFECTIVE BELT IDENTIFICATION:



Defective Aramid cord reinforced belt (left) vs New polyester cord belt (right) – Note the different cord arrangement between the two belt types.


STEP BY STEP WARRANTY PROCEDURE:

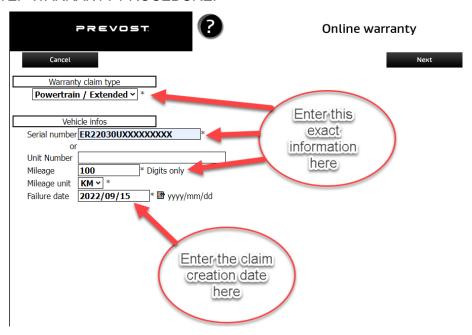

ER22-15A

Date Expiration Page 09.2022 N/A 3(5)




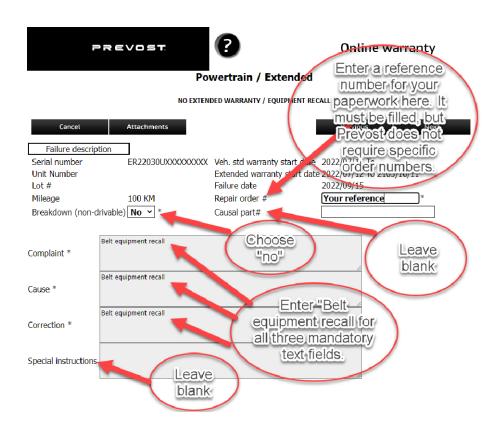

ER22-15A

Page

4(5)

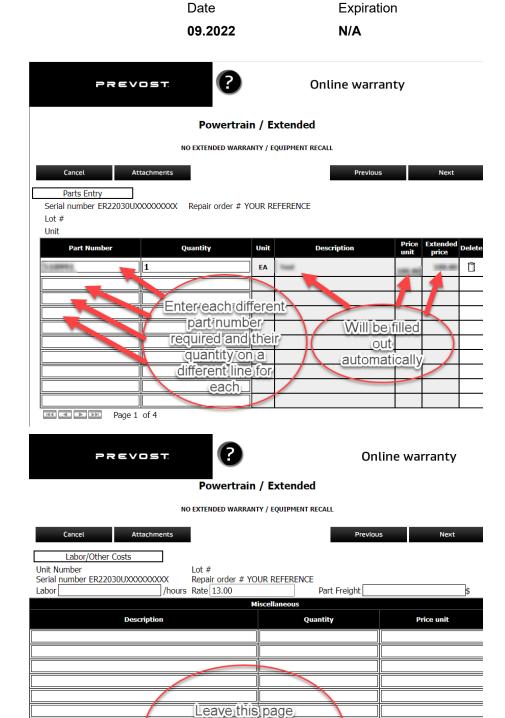

Writer: MG <QF7720961 rev8>

completely blank

Page 1 of 4

Equipment Recall

ER22-15A

Date Expiration Page 09.2022 N/A 5(5)

