

TOPIC	TYPE	RECALL CODE	QUESTION	ANSWER												
Safety Recall 97GF	Safety Recall	97GF	What vehicles are included in Safety Recall 97GF?	<table border="1"> <thead> <tr> <th>Country</th> <th>Beginning Model Year</th> <th>Ending Model Year</th> <th>Vehicle</th> </tr> </thead> <tbody> <tr> <td>USA</td> <td>2019</td> <td>2023</td> <td>ATLAS</td> </tr> <tr> <td>USA</td> <td>2020</td> <td>2023</td> <td>ATLAS CROSS SPORT</td> </tr> </tbody> </table>	Country	Beginning Model Year	Ending Model Year	Vehicle	USA	2019	2023	ATLAS	USA	2020	2023	ATLAS CROSS SPORT
Country	Beginning Model Year	Ending Model Year	Vehicle													
USA	2019	2023	ATLAS													
USA	2020	2023	ATLAS CROSS SPORT													
			What is the safety concern for Safety Recall 97GF?	The recall condition can result in a fault that causes the airbag light to be illuminated. When illuminated, in the event of certain side crash scenarios that would cause the side airbag to deploy, the side airbag may deploy later than designed. This may lead to an increased injury to vehicle occupants.												
			Are there any precautions I should take because my vehicle is part of Safety Recall 97GF?	<p>You can continue driving your vehicle if you are not currently experiencing the issues that may potentially be caused by the recall condition. Please ensure that everyone who uses your vehicle has read the owner's manual and is familiar with how the warning lights in your vehicle function.</p> <p>If the potential condition that is the subject of the recall is present in the vehicle, the airbag warning light may illuminate if a malfunction is detected. Other symptoms of a sporadic interruption of the affected electrical connection can be: inadvertently rolling down windows, inadvertent park brake engagement at low speeds (below approximately 3km/h or 1.8 mph), warning regarding faulty door sensor.</p> <p>Customers experiencing any of these conditions are advised to contact an authorized Volkswagen dealer to have their vehicle diagnosed/repaired without delay.</p>												

			<p>What is the repair for the Safety Recall 97GF?</p>	<p>To address this potential issue, your authorized Volkswagen dealer will check both front doors to determine if diagnostic trouble (fault) code(s) specific to the affected wiring harness are actually present. If the fault code(s) are present for a front door, the affected wiring harness will be replaced in that door. Harnesses will be modified with a zip tie to secure them, and a stabilizing compound will be applied to the terminal ends of the affected wiring harness connectors.</p> <p>If fault code(s) are not found, the existing wiring harness will be modified with a zip tie to secure it and a stabilizing compound will be applied to the terminal ends of the affected wiring harness connector(s).</p>
			<p>When will the repair for Safety Recall 97GF be available?</p>	<p>This recall repair is not available at this time, but Volkswagen is working to have it available as soon as possible. Volkswagen will send you a letter via first-class mail to let you know when you can schedule the recall repair with your dealer.</p>