


CONDITION OF CONCERN

On the subject Mazda2 vehicles, the headlight adjustment prevention cap was not installed during the manufacturing process, which may allow the headlight horizontal aiming to be improperly adjusted by end users. The vehicles with missing headlight adjustment prevention caps do not conform with Federal Motor Vehicle Safety Standards (FMVSS) regarding vehicle headlight adjustability.

- Applicable FMVSS: FMVSS No. 108, "Lamps, Reflective Devices and Associated Equipment"

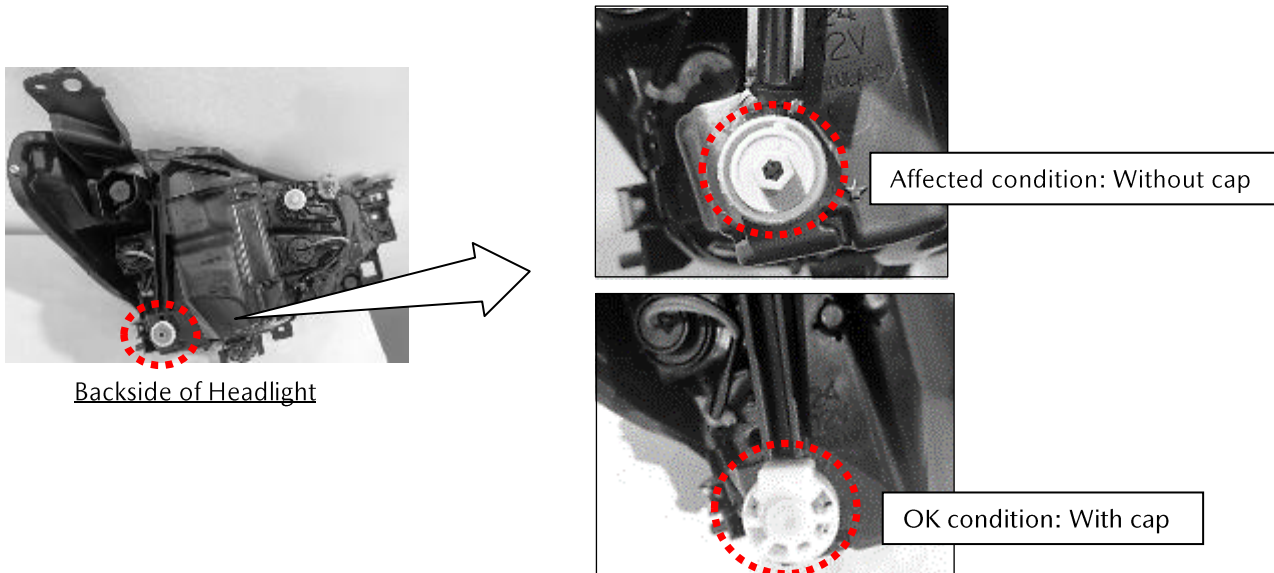

Backside of Headlight

OUTLINE OF REPAIR

Install a headlight adjustment prevention cap on each front headlight (right and left).
 Please refer to the Repair Procedure document on MGSS for further details.

SUBJECT VEHICLES

Model	Subject VIN range	Subject production date range
2020-2021MY Mazda2	3MD DJ**** LM 400466 – 402865 3MD DJ**** MM 404276 – 409068	From November 1, 2019 through December 9, 2021

The asterisk symbol "*" can be any letter or number.

OWNER NOTIFICATION

Mazda will notify the owners by first class mail no later than January 3, 2023.

PARTS INFORMATION

Description	Part Number	Quantity	Note
Headlight adjustment prevention cap set	DEYL-51-0X8	1	Consists of 2 caps
Campaign Label	9999-95-065A-06	1=50 labels	Obtain in Mazda e-Store

WARRANTY CLAIM PROCESSING INFORMATION

	Install headlight adjustment prevention caps
Process Number	AN025A
Symptom Code	99
Damage Code	99
Causal Part Number	DEYL-51-0X8
Quantity	1
Labor Operation Number	XXW88XRX
Labor Hours	0.3 hrs.