OMB Control No.: 2127-0004

Part 573 Safety Recall Report

23E-035

Manufacturer Name: Dana Incorporated

Submission Date: APR 24, 2023

NHTSA Recall No.: 23E-035

Manufacturer Recall No.: NR



Manufacturer Information:

Manufacturer Name: Dana Incorporated

Address: 3939 Technology Drive

Maumee OH 43537

Company phone: 419-887-3000

Population:

Number of potentially involved: 11 Estimated percentage with defect: 100 %

Equipment Information:

Brand / Trade 1: Dana - Spicer

Model: Ultimate Dana 60™ Bracketless Crate Axle®

Part No.: See notes below.

Size: NR Function: Axle

Descriptive Information: This issue potentially affects certain Ultimate Dana 60™ Bracketless Crate Axles®

sold to aftermarket customers for use in some Jeep® Wrangler® vehicle

applications.

Production Dates: SEP 07, 2022 - SEP 08, 2022

Description of Defect:

Description of the Defect: The position in which covered axles are inadvertently installed in vehicles may

not allow sufficient lubrication to reach the axles' pinion tail bearings. This

condition can lead to a pinion tail bearing seizure.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: In the event of a pinion tail bearing seizure, the axle may not rotate. This

could affect a vehicle operator's operation of the vehicle.

Description of the Cause: The installed position of the axle's suspension bracket may not allow sufficient

lubrication to reach the axle pinion tail bearing.

Identification of Any Warning Drivers will likely experience substantial noise and vibration of the axle before

that can Occur: any pinion tail bearing seizure would occur.

Involved Components:

Component Name: NR

Component Description: NR

Component Part Number: NR

Supplier Identification:

Component Manufacturer

Name: NR

Address: NR

NR

Country: NR

Chronology:

In or about February 2023, Dana received two customer reports regarding issues with their axles. Dana investigated the reports, and determined that both axles were manufactured in the same lot. Upon further investigation, Dana identified the same issue in two other axles in its possession manufactured in the same lot, as well as root cause: an operator did not use an available checking fixture that would have detected the issue. Dana promptly assessed the potential consequence of the issue, and as a result of its evaluation, makes this report in an abundance of caution.

Description of Remedy:

Description of Remedy Program: At no cost to the consumer or retail purchaser, Dana will replace all units

that are the subject of this report.

How Remedy Component Differs The issue is isolated to one manufacturing lot in which the issue occurred

from Recalled Component: in production, and was inadvertently not detected by the operating

technician. Replacement parts will not have the production issue, which

will be mechanically confirmed in all replacement axles.

Identify How/When Recall Condition The recall condition was due to an isolated issue in production, and the was Corrected in Production: technician did not confirm the geometry with the checking tool as required. Dana has updated its production processes to prevent a recurrence.

Recall Schedule:

Description of Recall Schedule: Dana will promptly provide notice to the retail customers and end user

purchasers of covered units. Dana can begin offering the recall remedy

immediately.

Planned Dealer Notification Date: MAY 03, 2023 - MAY 03, 2023 Planned Owner Notification Date: MAY 03, 2023 - MAY 03, 2023

Purchaser Information:

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name: NR

Address: NR

NR

Country: NR

Company Phone: NR

^{*} NR - Not Reported