

Part 573 Safety Recall Report

23E-043

Manufacturer Name : Nissan North America, Inc.

Submission Date : JUN 07, 2023

NHTSA Recall No. : 23E-043

Manufacturer Recall No. : PC966/7, PC980/1



Manufacturer Information :

Manufacturer Name : Nissan North America, Inc.

Address : P. O. BOX 685001

Franklin TN 37068-5009

Company phone : 800-647-7261

Population :

Number of potentially involved : 78

Estimated percentage with defect : 1 %

Equipment Information :

Brand / Trade 1 : Nissan Service Part

Model : 2021 - 2023 Rogue

Part No. : 87351 6RD0A

Size : NR

Function : NR

Descriptive Information : The driver's powered seat cushion frame parts listed above were shipped to dealer's service inventory between September 2022 and February 2023, but may contain the affected seat rails described in NHTSA Recall 23V-268 and in Section 5 below. The date range of seat cushion frame parts was determined using the Tier 1 (Adient) supplier records. Service parts were available at dealers for warranty repair for the applicable models and may have been installed on vehicles as part of a repair.

Driver's powered seat cushion frames produced before or after the dates above are not affected. Nissan confirmed that no affected parts remain in Nissan's service inventory

Production Dates : AUG 23, 2022 - SEP 04, 2022

Brand / Trade 2 : Nissan Service Part

Model : 2021 - 2023 Rogue

Part No. : 87351 6RF0A

Size : NR

Function : NR

Descriptive Information : The driver's powered seat cushion frame parts listed above were shipped to dealer's service inventory between September 2022 and February 2023, but may contain the affected seat rails described in NHTSA Recall 23V-268 and in Section 5 below. The date range of seat cushion frame parts was determined using the Tier 1 (Adient) supplier records. Service parts were available at dealers for warranty repair for the applicable models and may have been installed on vehicles as part of a repair.

Driver's powered seat cushion frames produced before or after the dates above are not affected. Nissan confirmed that no affected parts remain in Nissan's service inventory.

Production Dates : AUG 23, 2022 - SEP 04, 2022

Brand / Trade 3 : INFINITI Service Part

Model : 2022 - 2023 QX60

Part No. : 87351 6TA1A

Size : NR

Function : NR

Descriptive Information : The driver's powered seat cushion frame parts listed above were shipped to dealer's service inventory between September 2022 and February 2023, but may contain the affected seat rails described in NHTSA Recall 23V-268 and in Section 5 below. The date range of seat cushion frame parts was determined using the Tier 1 (Adient) supplier records. Service parts were available at dealers for warranty repair for the applicable models and may have been installed on vehicles as part of a repair.

Driver's powered seat cushion frames produced before or after the dates above are not affected. Nissan confirmed that no affected parts remain in Nissan's service inventory.

Production Dates : AUG 23, 2022 - SEP 04, 2022

Brand / Trade 4 : Nissan Service Part
Model : 2022 - 2023 Pathfinder
Part No. : 87351 6TA0A
Size : NR
Function : NR

Descriptive Information : The driver's powered seat cushion frame parts listed above were shipped to dealer's service inventory between September 2022 and February 2023, but may contain the affected seat rails described in NHTSA Recall 23V-268 and in Section 5 below. The date range of seat cushion frame parts was determined using the Tier 1 (Adient) supplier records. Service parts were available at dealers for warranty repair for the applicable models and may have been installed on vehicles as part of a repair.

Driver's powered seat cushion frames produced before or after the dates above are not affected. Nissan confirmed that no affected parts remain in Nissan's service inventory.

Production Dates : AUG 23, 2022 - SEP 04, 2022

Description of Defect :

Description of the Defect : The driver's powered seat may not be fully secured to the seat frame on the affected service parts. As a result of this issue, the seat frame welds may detach from the rear inboard seat bracket.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If this condition occurs, it may increase the risk of injury to the vehicle occupant in the event of a crash. In addition, the seat frame assembly may not meet certain FMVSS 207 and FMVSS 210 requirements because of this condition.

Description of the Cause : NR

Identification of Any Warning that can Occur : The customer may notice excess movement in the driver's seat.

Involved Components :

Component Name : Driver's Seat Frame

Component Description : FRAME ASSY - CUSHION, FRONT SEAT LH

Component Part Number : 87351 6RD0A

Component Name : Driver's Seat Frame

Component Description : FRAME ASSY - CUSHION, FRONT SEAT LH

Component Part Number : 87351 6RF0A

Component Name : Driver's Seat Frame

Component Description : FRAME ASSY - CUSHION, FRONT SEAT LH

Component Part Number : 87351 6TA1A

Component Name : Driver's Seat Frame

Component Description : FRAME ASSY - CUSHION, FRONT SEAT LH

Component Part Number : 87351 6TA0A

Supplier Identification :

Component Manufacturer

Name : Forvia SLP Mechanism

Address : Av. Central No. 200 Interior 365 Parque

San Luis Foreign States 78395

Country : Mexico

Chronology :

See attached part 573 report for chronology

Description of Remedy :

Description of Remedy Program : Dealers will be instructed to check the driver's seat rail clearance to the inboard seat bracket, and if necessary, the dealer will remove and replace the affected driver's seat cushion frame. All repairs will be performed free of charge for parts and labor and may take less than two (2) hours to complete.
Nissan will not include a statement in the Part 577 owner notification concerning reimbursement for the cost of obtaining a pre-notification remedy since the subject service parts are under warranty.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Dealers will be notified of this equipment recall beginning June 8, 2023. In addition, owners of all vehicles that may have been serviced with a potentially affected service part will be notified beginning July 27, 2023.

Planned Dealer Notification Date : JUN 08, 2023 - NR

Planned Owner Notification Date : JUL 27, 2023 - NR

Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name : NR

Address : NR

NR

Country : NR

Company Phone : NR

* NR - Not Reported