

Part 573 Safety Recall Report

23V-134

Manufacturer Name : Airstream, Inc.**Submission Date :** MAR 01, 2023**NHTSA Recall No. :** 23V-134**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Airstream, Inc.

Address : 419 West Pike Street
 PO Box 629 Jackson Center OH
 45334-0629

Company phone : 937-596-6111

Population :

Number of potentially involved : 6,827

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2021-2023 Airstream 2021-2023 Basecamp, Bambi, Atlas, Interstate

Vehicle Type :

Body Style : OTHER

Power Train : NR

Descriptive Information : The supplier Suburban indicated that the scope date(s) are from April 2021, through February 2023. Airstream used that information to set our recall scope.

Production Dates : MAR 01, 2021 - FEB 13, 2023

VIN Range 1 : Begin : 1SMG4DD29MJ204931 End : 1SMG4DC18PJ208787

☐ Not sequential

VIN Range 2 : Begin : 1STHMAC12MJ556670 End : 1STVMAF1XPJ567757

☐ Not sequential

VIN Range 3 : Begin : 1B9KUWH27NJ306580 End : 1B9KUWH26PJ311031

☐ Not sequential

VIN Range 4 : Begin : 1B9GUWA21MJ306766 End : 1B9HUWH20PJ311276

☐ Not sequential**Description of Defect :**

Description of the Defect : Per Suburban Recall 22E035; "The internal aluminum burner tubes connecting the gas valves to the cook top burners can fracture from excessive vibration or shock experienced through travel in a RV."

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Per Suburban Recall 22E035, "The burner tube could crack resulting a leak of propane when the top burner gas valve is opened to use the appliance. If ignited the propane could result in a fire and/or explosion which could result in personal injury.

Description of the Cause : Per Suburban Recall 22E035, The internal aluminum burner tubes connecting the gas valves to the cook top burners can fracture from excessive vibration or shock experienced through travel in a RV. The burner tube could crack

Identification of Any Warning that can Occur : resulting a leak of propane when the top burner gas valve is opened to use the appliance
Per Suburban Recall 22E035 "The owner could possibly hear a louder than normal hissing sound or smell propane odor when the cooktop gas valve is turned to the "on" position."

Involved Components :

Component Name 1 : Suburban 2 Burner Cooktop
Component Description : 2 Burner LP Cooktop
Component Part Number : 690784

Supplier Identification :

Component Manufacturer

Name : Suburban
Address : 676 Broadway St
Dayton Tennessee 37321
Country : United States

Chronology :

1/27/23 - Suburban notified Airstream of an existing recall for the 2 burner cooktop that may affect Airstream. They stated they would be sending detailed information in a formal communication on Monday January 30.
1/30/23 - We received the recall notification from Suburban. At this time Suburban does not have a remedy in place.
2/6/23 - Suburban to be on site to correct units in production.
2/22/23 - Suburban has stated they should have the final testing of the remedy by 2/28/23. Airstream will be submitting the 573.

Description of Remedy :

Description of Remedy Program : Dealers will install a regulator support bracket, free of charge. Owner notification letters are expected to be mailed April 29, 2023. Owners may contact Airstream Customer Service at 877-596-6111 (Travel Trailer ext. 7491) or (Touring Coach ext. 7401). Customers will be allowed reimbursement following the general reimbursement plan on file with NHTSA

How Remedy Component Differs from Recalled Component :	Per Suburban's recall 22E-035, The replacement/exchange unit will have a different part number outside of the recall population that will have a bracket installed to prevent vibration damage to the gas line. The units will be visually the same to the end user.
Identify How/When Recall Condition was Corrected in Production :	Per Suburban's Recall 22E-035, the gas line coupler has a bracket to prevent vibration damage.

Recall Schedule :

Description of Recall Schedule :	Airstream will send dealer and owner notification letters once approved by NHTSA.
Planned Dealer Notification Date :	APR 29, 2023 - APR 29, 2023
Planned Owner Notification Date :	APR 29, 2023 - APR 29, 2023

* NR - Not Reported