OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

## 23V-354

**Manufacturer Name:** Terminal Investment Corporation

**Submission Date:** MAY 18, 2023 **NHTSA Recall No.:** 23V-354

**Manufacturer Recall No.:** NR



#### **Manufacturer Information:**

Manufacturer Name: Terminal Investment Corporation

Address: 66 Cypress Ridge Dr.

Ridgeland SC 29936

Company phone: 5368139

## **Population:**

Number of potentially involved: 570 Estimated percentage with defect: 3 %

#### **Vehicle Information:**

Vehicle 1: 2022-2023 TICO Spotter B 6.7 2021 Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : DIESEL

Descriptive Information: Based on Sheppard production dates, possible affected units were identified after

reviewing FIFO and production laydown dates.

Production Dates: JUL 01, 2021 - JUN 30, 2022

VIN Range 1: Begin: 1T9TSTA83MR825586 End: 1T9TSTA86NR825535 Not sequential

#### **Description of Defect:**

Description of the Defect: Steering gear was assembled with fewer than the required number of

recirculating balls which can lead to a fracture in the steering gear worm-shaft

and loss of vehicle steering.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: A steering gear with fewer than the required number of recirculating balls

may bind when loads are applied. In some cases the balls may align on the same side of the gear's worm-shaft and concentrated loads may cause the gear's internal parts to fracture resulting in loss of vehicle steering. Loss of

steering increases the likelihood of a crash

Description of the Cause: NR

Identification of Any Warning Preceding the internal fracture, the steering may be perceived as strained by

that can Occur: the driver. No audible or visual warning is available.

## **Involved Components:**

Component Name 1: Steering Gear

Component Description: HD Steering Gear for trucks

Component Part Number: 23986581, 21129326, 23851030, 23851036, 23851046, 23851032, 23056973,

24008407, 23851052, 22396595,

## **Supplier Identification:**

## **Component Manufacturer**

Name: R.H SHEPPARD CO., INC. Address: 101 Philadelphia Street

P.O. Box 877 Hanover Pennsylvania 17331-0877

**Country: United States** 

### **Chronology:**

TICO received a recall notice from RH Sheppard on the 6th of June 2022 stating that there were affected steering gear units they provided and a description of the condition. The quality and Warranty departments had agreed that there were affected units in TICO products, and it was a safety concern. TICO tractors were deemed compliant in reporting, and a recall was to be issued in support of safety concerns.

#### **Description of Remedy:**

Description of Remedy Program: TICO is requiring vehicles built within the TICO identified affected date

range to be inspected for the Sheppard issue serial number. Once this serial number is given to TICO, via EDGE, we will cross reference with Sheppard and verify if it is an affected gear. If the steering gear falls under the recall, Sheppard and TICO will provide a new replacement gear at no cost to UPS. If the steering gear is not an affected serialized number, no further action is required. See the following Sheppard Identification Guideline for instructions on finding and recording the serial number. \*\*If during the campaign, we identify the 16 units requiring gear replacement before all trucks have been inspected, you will receive a

notice that the campaign has ended. \*\*

How Remedy Component Differs NR from Recalled Component :

Identify How/When Recall Condition NR

was Corrected in Production:

#### **Recall Schedule:**

Description of Recall Schedule: NR

Planned Dealer Notification Date : MAY 22, 2023 - MAY 22, 2023 Planned Owner Notification Date : MAY 23, 2023 - MAY 23, 2023

\* NR - Not Reported