

Part 573 Safety Recall Report

23V-483

Manufacturer Name : Industrial Video & Control Co

Submission Date : AUG 28, 2023

NHTSA Recall No. : 23V-483

Manufacturer Recall No. : NR



Manufacturer Information :

Manufacturer Name : Industrial Video & Control Co

Address : 189 Wells Ave

Suite 202 Newton MA 02459

Company phone : 1-617-467-3059

Population :

Number of potentially involved : 4

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2021-2021 MVT-900A MVT-3001-G

Vehicle Type : TRAILERS

Body Style : OTHER

Power Train : NR

Descriptive Information : The recall population was determined by using the generator serial numbers provided by Cummins.

Production Dates : DEC 16, 2021 - JUL 01, 2022

VIN Range 1 : Begin : 1Z9B21314MG534043 **End :** 1Z9B21318MG534045 Not sequential

Description of Defect :

Description of the Defect : As stated in Cummins Recall 23E-030, "This fuel hose between the inline fuel filter and the Injection Pump Module (IPM) may have inadequate clamp force, possibly resulting in a gasoline leak."

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : As stated in Cummins Recall 23E-030, "A gasoline leak in the presence of an ignition source may increase the risk of Fire."

Description of the Cause : As stated in Cummins Recall 23E-030, "The cause of the issue is an inadequate specification of the fuel hose."

Identification of Any Warning that can Occur : As stated in Cummins Recall 23E-030, "Bystanders may see or smell gasoline."

Involved Components :

Component Name 1 : Hose, Fuel

Component Description : Gasoline fuel hose between the IMP and the fuel filter

Component Part Number : A064P26

Supplier Identification :

Component Manufacturer

Name : Cummins Inc.

Address : PO BOX 3005

Columbus Indiana 43026

Country : United States

Chronology :

In mid-April Cummins notified Industrial Video & Control of recall 23E030. An investigation was opened to determine impacted units. Once scope was defined, Cummins was provided the associated vehicle model identification, VINs and owner contact information to facilitate owner notification.

Description of Remedy :

Description of Remedy Program : As stated in Cummins Recall 23E-030, "The remedy is to inspect and, if the unit has the defect, to replace the subject fuel hose and associated clamps. A recall-specific reimbursement plan will be provided on the Recall Portal for those units not covered by the manufacturer's limited warranty."

How Remedy Component Differs from Recalled Component : As stated in Cummins Recall 23E-030, "The remedy fuel hose has a unique part number A073T925."

Identify How/When Recall Condition was Corrected in Production : Production began with the remedy fuel hose on 02/21/2023.

Recall Schedule :

Description of Recall Schedule : As stated in Cummins notification letter, "Cummins will conduct the recall, including notifying owners pursuant to 49 CFR Part 577, performing the remedy, and submitting quarterly status reports to NHTSA." The dates provided below, reference the dates provided by Cummins in their 573 for 23E-030.

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : AUG 08, 2023 - AUG 09, 2023

* NR - Not Reported