Part 573 Safety Recall Report

Manufacturer Name : Jayco, Inc. Submission Date : JUL 14, 2023 NHTSA Recall No. : 23V-486 Manufacturer Recall No. : Daimler 23V-100

Manufacturer Information :

Manufacturer Name : Jayco, Inc. Address : 903 South Main Street PO Box 460 Middlebury IN 46540 Company phone : 800-283-8267

Vehicle Information :

Vehicle 1:	2020-2021 Jayco/Entegra Coach Launch, Melbourne, Melbourne Prestige, Qwest
Vehicle Type :	BUSES, MEDIUM & HEAVY VEHICLES
Body Style :	OTHER
Power Train :	DIESEL
Descriptive Information :	The recall population was determined through Jayco Inc. production records.
Production Dates :	JUL 10, 2019 - JUN 30, 2022
VIN Range 1:	Begin : W1W4EBVY2LT020559 End : WDAPF4CD5KN043082 Not sequential

Description of Defect :

Description of the Defect :	Mercedes-Benz AG ("MBAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain Sprinter (907 platform) vehicles, the fuse layout of the interior blower motor might not meet the requirements for prolonged operation at the highest blower setting.	
FMVSS 1 :	NR	
FMVSS 2 :	NR	
Description of the Safety Risk :	Influenced by certain premises, such as ambient and assembly space temperatures as well as usage, this could lead to an increase of the transitional resistance between fuse and fuse holder and thus, to a limit- exceeding heat development in the area of the fuse holder. Consequently, a risk of fire during operation and a risk of injury cannot be ruled out.	
Description of the Cause :	Due to a deviation in the development process, the fuse layout of the interior blower motor of vehicles from the given production dates might not meet the requirements.	
Identification of Any Warning that can Occur :	When the issue occurs, the driver might notice unusual odors.	
The information contained in this report was submitted pursuant to 49 CER §573		





Number of potentially involved : 659 Estimated percentage with defect : 100 %

Population :

23V-486

Part 573 Safety Recall Report

volved Components :		
Component Name 1:	Wire Harness	
Component Description :	Wire Harness	
Component Part Number :	A9075409365	
Component Name 2:	Wire Harness	
Component Description :	Wire Harness	
Component Part Number :	A9075407565	
Component Name 3:	Wire Harness	
Component Description :	Wire Harness	
Component Part Number :	A9075408565	
Component Name 4:	Fuse 25A	
Component Description :	Fuse 25A	
Component Part Number :	N00000004207	

Supplier Identification :

Component Manufacturer

Name : Kromberg & Schubert Automotive GmbH & C Address : Raitestraße 8 Renningen Foreign States D-71272 Country : Germany

Chronology :

Please refer to Mercedes Benz chronology on 23V-100 Jayco is not aware of any reports of accident or injury related to this condition. MBAG is currently aware of 11 field reports of apparently similar events involving Sprinter vans in the US that occurred between August 2022 to December 2022. MBAG is not aware of any warranty claims nor cases of death or injury related to this defect.

The information contained in this report was submitted pursuant to 49 CFR §573

March 7, 2023 Jayco received an email notification from Mercedes Benz about a pending recall 23V-100 and that we had purchased units that are affected by the recall.

March 13, 2023 Jayco's Warranty Incident Review Committee (WIRC) reviewed the incident and elevated it to CPAC. On March 15, 2023 The Corrective Preventive Action Committee (CPAC) decided to elevate the incident to the Safety Steering Committee (SSC). On June 7, 2023 Jayco received an email notification from Mercedes Benz that the recall 23V-100 is active. On July 10, 2023 SSC voted to proceed with a pass through chassis recall.

Description of Remedy :

How Remedy Component Differs from Recalled Component :New and relocated fuse and new supply line.Identify How/When Recall Condition was Corrected in Production :The introduction of an adapted fuse layout in production ensures that this issue can no longer occur from February 03, 2020 onwards for vehicles affected in the US market	Description of Remedy Program :	As a precautionary measure, an authorized Mercedes-Benz Sprinter dealer, will replace the fuse and its supply line as well as relocate the fuse within the fuse box. Owners are advised to only operate the front blower in manual (not automatic) mode whenever the engine is on. Do not use the maximum blower or lowest/highest temperature settings. Dealers will relocate and replace the fuse and wiring harness, free of charge. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is 8297010. If you have already paid to have this recall condition corrected, you may be eligible to receive reimbursement. Requests for reimbursement may include parts, labor, fees and taxes. An original or clear copy of all receipts showing name, address, VIN, problem, repair, who did the repair, cost, proof of payment are required. Daimler will be reporting the quarterly completion rates to NHTSA.
was Corrected in Production : issue can no longer occur from February 03, 2020 onwards for vehicles	v .	
		issue can no longer occur from February 03, 2020 onwards for vehicles

Recall Schedule :

Description of Recall Schedule :Jayco will notify its dealers and affected retail owners.Planned Dealer Notification Date :AUG 18, 2023 - AUG 18, 2023Planned Owner Notification Date :AUG 18, 2023 - AUG 18, 2023

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573

Page 3