OMB Control No.: 2127-0004

Part 573 Safety Recall Report

23V-497

Manufacturer Name: Vanguard National Trailer Corporation

Submission Date: DEC 04, 2023 NHTSA Recall No.: 23V-497 Manufacturer Recall No.: NR NHTSA

NATIONAL HIGHWAY TRAFFIC
SAFETY ADMINISTRATION

Manufacturer Information:

Manufacturer Name: Vanguard National Trailer Corporation

Address: 289 E. Water Tower Drive

200 L. Water Tower Dilve

Monon IN 47959

Company phone: 2532000

Population:

Number of potentially involved: 102

Estimated percentage with defect: 100 %

Vehicle Information:

Vehicle 1: 2023-2024 Vanguard All

Vehicle Type: TRAILERS
Body Style: VAN
Power Train: NR

Descriptive Information: Units have SAF Holland Tire Pilot Plus tire inflation system installed. This is for new

eletronic controller systems installed on certain customers trailer by order

Production Dates: NOV 30, 2022 - JUN 01, 2023

VIN Range 1 : Begin : NR End : NR ☐ Not sequential

Description of Defect:

Description of the Defect: Tire Pilot Plus (TPP) system produced on trailers after November 2022 with

the electronic regulator assembly have been determined under specific

conditions to slowly deflate the trailer tires.

FMVSS 1: 138 - Tire pressure monitoring systems

FMVSS 2: NR

Description of the Safety Risk: All Tires can deflate while in service/operation

Description of the Cause: Electronic Controller can open the check valves in the tire inflation hoses

causing the tires to lose air pressure and deflate.

Identification of Any Warning No warning notice has been provided by SAF Holland in their field bulletin..

that can Occur:

Involved	Components:	
mvorveu	components.	

Component Name 1: Tire Pilot Plus -

Component Description: Tire Infaltion Management System

Component Part Number: various

Supplier Identification:

Component Manufacturer

Name: SAF Holland

Address: 1950 Industrial Blvd

Muskegon Michigan 49442

Country: United States

Chronology:

SAF Holland notified us of the issue with Tire Pilot Plus(TPP) officially on 7/10/2023.

This included the shipment history of suspect components & their service bulletin XL-AA2015SB.

This instructed us of the recalled items & actions needed in the field to disable any units identified with the TPP susytem in the suspect population

Description of Remedy:

Description of Remedy Program: SAF Holland has provided remedy to disable the Tire Pilot Plus (TPP)

system per their Service Bulletin XL-AA20125SB. This disabling procedure will be completed on units identified in the field until SAF

Holland can provide a final solution.

How Remedy Component Differs Current direction is to disable the functional Tire Pilot Plus (TPP) system

from Recalled Component: currently in use on trailers in the field noted with the identified system. No future sale of units with the TPP will be permitted until SAF provides final solution to issue. The TPP system can only be sold/purchased as "prepped only" until SAF Holland provides permanent remedy/solution for the TPP

system issue before continued use.

Identify How/When Recall Condition Tire Pilot Plus (TPP) tire inflation kits were removed from current was Corrected in Production: production units. Customer wishing to retain the TPP system on their

equipment will only be allowed to obtain with equipment "prepped only" for later install of system when final solution is available from SAF Holland.

Recall Schedule:

Description of Recall Schedule: Units sold to reseller/dealers will be notified of respective units involved

& sold to end customers. Each will receive their respective VIN#'s listing

& letter explaining SAF Holland's remedy solution.

Planned Dealer Notification Date : AUG 25, 2023 - AUG 25, 2023 Planned Owner Notification Date : AUG 25, 2023 - AUG 25, 2023

* NR - Not Reported