

# Part 573 Safety Recall Report

# 23V-530

**Manufacturer Name :** Chinook Motor Coach, LLC

**Submission Date :** JAN 04, 2024

**NHTSA Recall No. :** 23V-530

**Manufacturer Recall No. :** NR



## Manufacturer Information :

## Population :

**Manufacturer Name :** Chinook Motor Coach, LLC

**Number of potentially involved :** 31

**Address :** 1482 North Eel River Cemetery Road

**Estimated percentage with defect :** 75 %

Peru IN 46970

**Company phone :** 574-584-3756

## Vehicle Information :

**Vehicle 1 :** 2020-2024 Chinook Bayside

**Vehicle Type :** LOW VOLUME VEHICLES

**Body Style :** VAN

**Power Train :** GAS

**Descriptive Information :** Chinook is recalling select Bayside models due to Cummins generator recall. These Bayside models were built with the now recalled Cummins Onan QG 2800i. There are 33 Chinook Bayside 2020-2024 models included in this recall.

**Production Dates :** JUN 21, 2021 - JUN 01, 2023

**VIN Range 1 : Begin :**

NR

**End :** NR

Not sequential

## Description of Defect :

**Description of the Defect :** There may be inadequate clamp force on the fuel hose between the IMP and fuel filter, resulting in a possible gasoline leak.

**FMVSS 1 :** NR

**FMVSS 2 :** NR

**Description of the Safety Risk :** The possible gasoline leak may increase the risk of a fire.

**Description of the Cause :** There is an inadequate specification of the fuel hose.

**Identification of Any Warning that can Occur :** Bystanders may smell or see gasoline.

## Involved Components :

Component Name 1 : Fuel Hose

Component Description : Gasoline fuel hose between the IPM and fuel filter.

Component Part Number : A064P026

## Supplier Identification :

### Component Manufacturer

Name : Chinook Motor Coach

Address : 1482 N Eel River Cemetery Rd

Peru Indiana 46970

Country : United States

## Chronology :

04/13/2023 - 04/18/2023 - Chinook received an important safety recall from Cummins about the Onan QG 2800i being recalled. Then notified by Cummins that they will be performing the recall.

04/18/2023 - 05/22/2023 - Chinook reviewed its records and identified affected Bayside models, then provided the information to Cummins to perform the recall and send out owner notification letters.

05/12/2023 - Cummins came to Chinook and checked fuel hose lines and correct any if needed.

07/27/2023 - Chinook was notified and decided to conduct a safety campaign to address the affected Chinook Bayside models. There are no records of warranty claims relating to this recall, nor have there been any reports of accidents, injuries, or fires.

## Description of Remedy :

Description of Remedy Program : Cummins will inspect and, if the unit has the defect, will replace the subject fuel hose and associated clamps. A recall-specific reimbursement plan will be provided on Cummins Recall Portal for those units not covered by the manufacturer's limited warranty. Cummins will be performing the recall and will be submitting quarterly reporting numbers.

How Remedy Component Differs from Recalled Component : The remedy fuel hose part number is A073T925.

Identify How/When Recall Condition was Corrected in Production : Cummins checked and corrected any Bayside models in production.

**Recall Schedule :**

Description of Recall Schedule : Chinook Motor Coach expects to notify its customers on or before 08/04/2023. Cummins will conduct the recall and send out owner notification letters.

Planned Dealer Notification Date : AUG 04, 2023 - AUG 04, 2023

Planned Owner Notification Date : AUG 04, 2023 - AUG 04, 2023

\* NR - Not Reported