

Part 573 Safety Recall Report

23V-603

Manufacturer Name : Interstate Group, LLC**Submission Date :** JAN 29, 2024**NHTSA Recall No. :** 23V-603**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Interstate Group, LLC

Address : 3601 DAVE WARD DRIVE
CONWAY AR 72034

Company phone : 999

Population :

Number of potentially involved : 263

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2022-2023 Interstate ITLT716SA2

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : Interstate Group has sold 206 of the model 2023 ITLT716SA2 trailers. An additional 57 trailers are located on our retail lots and will not be sold until this issue is corrected.

On Friday, August 25, 2023, a customer reported an injury to her finger that resulted from her finger becoming trapped between a latch and tie down point on our model ITLT716SA2 tilt deck trailer. While this injury should not occur when the trailer is properly loaded, in an abundance of caution, we intend to issue a safety recall to retrofit the tie down points on the subject trailers to eliminate the potential pinch point at the latching mechanism. This is the only model of trailer that has the subject configuration of latch and tie down points, and no other similar issues have been reported regarding this type of trailer.

Production Dates : JAN 01, 2022 - AUG 25, 2023

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : The ITLT716SA2 trailer was built with a 2" steel flat strap tie off point that can interfere with the safe operation of the trailer deck tilt latch when the trailer load is not evenly distributed. In certain load situations with rear weight, the deck can spring up when the operator opens the gate latch causing a potential pinch point that can cause injury to the operator.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : When the trailer deck tilt latch is unlatched when the trailer's load is unbalanced, leading to rear weight, a pinch point can occur. Increased risk for injury.

Description of the Cause : When a customer fails to properly balance the load on the tilt deck by allowing too much rear weight, the trailer deck tilt tach can spring up when the latch is released.

Identification of Any Warning that can Occur : NR

Involved Components :

Component Name 1 : Flat Strap

Component Description : Metal flat strap attached to the trailer for tie down use

Component Part Number : NA

Supplier Identification :

Component Manufacturer

Name : Interstate Group / TrailersPlus

Address : 3800 Airport Road
Nampa Idaho 83687

Country : United States

Chronology :

Interstate Group was notified by a customer on or about August 23, 2023, of an injury that occurred when unloading an unbalanced load and her finger became trapped between a latch and tie down point.

Description of Remedy :

Description of Remedy Program : The repair will include removing the tie down flat straps from the front stake pockets of the tilt deck to ensure that it does not interfere with the operation of the deck latch and adding a handle stop. The completed repair will take approximately 30 minutes.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : Going forward, the model ITLT716SA2 will be produced in the manner described in the remedy.

Recall Schedule :

Description of Recall Schedule : We intend to issue recall notices on September 6, 2023.
Planned Dealer Notification Date : SEP 06, 2023 - SEP 06, 2023
Planned Owner Notification Date : SEP 06, 2023 - SEP 06, 2023

* NR - Not Reported