OMB Control No.: 2127-0004

Part 573 Safety Recall Report

23V-871

Manufacturer Name: Jaguar Land Rover North America, LLC

Submission Date: JAN 02, 2024 NHTSA Recall No.: 23V-871 Manufacturer Recall No.: N830



Manufacturer Information:

Population :

Manufacturer Name: Jaguar Land Rover North America, LLC

Number of potentially involved: 4,347 Estimated percentage with defect: 100 %

Address: 100 Jaguar Land Rover Way

Mahwah NJ 07495

Company phone: 8188500

Vehicle Information:

Vehicle 1: 2023-2023 Land Rover Range Rover Sport

Vehicle Type: LIGHT VEHICLES

Body Style: SUV Power Train: GAS

Descriptive Information: Jaguar Land Rover is conducting a voluntary safety recall campaign involving certain

2023MY Land Rover Range Rover Sport vehicles built at the Solihull Vehicle Assembly Plant from July 1, 2022 - November 30, 2022. 4347 vehicles in the United States and

Federalized Territories.

The recall population was established based on the elevated pattern and trend of reports of righthand tail lamp failures coupled with dates where the finessing

processes were employed.

Production Dates: JUL 01, 2022 - NOV 30, 2022

VIN Range 1: Begin: SAL1L9FU1PA100681 End: SAL1P9EU1PA113677 Not sequential

Description of Defect:

Description of the Defect: A concern has been identified with the right hand tailgate and body mounted

rear lamps which may experience water ingress leading to one or more lamp failures including loss of brake/stop lamp, outer marker lamp, reversing lamp

and direction indicator/turn indicator.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: Loss of rear right hand lamp system functionality increases the risk of a rear

end crash.

Description of the Cause: NR Identification of Any Warning NR

that can Occur:

Involved Components:

Component Name 1: BODY SIDE LAMP TAILGATE LAMP Component Description: BODY SIDE LAMP TAILGATE LAMP

Component Part Number: N9X2 - 13404 - A/B

Component Name 2: BODY SIDE LAMP TAILGATE LAMP Component Description: BODY SIDE LAMP TAILGATE LAMP

Component Part Number: N9X2 - 13405 - A/B

Component Name 3: BODY SIDE LAMP TAILGATE LAMP Component Description: BODY SIDE LAMP TAILGATE LAMP

Component Part Number: N9X2 - 13A420 - A/B

Component Name 4: BODY SIDE LAMP TAILGATE LAMP Component Description: BODY SIDE LAMP TAILGATE LAMP

Component Part Number: N9X2 - 13A421- A/B

Supplier Identification:

Component Manufacturer

Name: Jaguar Land Rover Limited

Address: Abbey Road

Whitley Coventry Foreign States CV3 4LF

Country: United Kingdom

Chronology:

Attached file

Description of Remedy:

Description of Remedy Program: Owners will be notified and instructed to take their vehicle to an approved Jaguar Land Rover repairer. The right hand tailgate and body mounted lamps will replaced. Until such time as the recall has been completed, customers are advised to regularly check the operation of their rear lamps and if they fail to function as expected or differ from the operation the left hand side, seek retailer assistance. There will be no charge to the owners for this repair. The affected vehicles will be covered under Jaguar Land Rover's new vehicle warranty program. Therefore, reimbursement for prenotice remedies are not necessary because the affected vehicles are still under warranty.

How Remedy Component Differs NR from Recalled Component:

Identify How/When Recall Condition NR

was Corrected in Production:

Recall Schedule:

Description of Recall Schedule: Dealer notification is planned January 4, 2024. Owner notification is

planned on or before February 9, 2024

Planned Dealer Notification Date: JAN 04, 2024 - JAN 04, 2024 Planned Owner Notification Date: FEB 09, 2024 - FEB 09, 2024

* NR - Not Reported