



4400 S. Lewis Blvd. ▪ P.O. Box 6300 ▪ Sioux City, IA 51106-6300  
Phone: 712-252-6500 ▪ Toll Free: 800-798-2002 ▪ Fax: 712-252-6510  
www.wilsontrailer.com ▪ e-mail: sales@wilsontrailer.com

## IMPORTANT SAFETY RECALL

January , 2024

Customer Address:  
Address:

RE: Final Remedy Letter For TPP Defect  
This notice applies to your vehicle: Trailer Serial #  
NHTSA # 23V-618

Dear Valued Customer:

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act. Wilson Trailer Company has decided, that a defect, which relates to vehicle safety, exists in certain 2024 DWH-750 Pacesetter Grain trailer equipped with CBXA40 and ULX40 Tire Pilot Plus (TPP) tire inflation system with an electronic regulator assembly.

You are being notified because your trailer contains one of these TPP systems manufactured between 30NOV22 and 01JUN23. SAF Holland now has a final remedy available for your trailer(s).

SAF Holland's Tire Pilot Plus product, equipped with the Electronic Regulator Control Unit Assembly tire pressure regulation system (TPRS) needs to be replaced. Trailers equipped with TPRS may experience unintended loss of pressure of all tires while traveling at speeds higher than 45 mph, which increases the risk of a crash. This loss of pressure event occurs only on the Tire Pilot Plus – Electronic Regulator Control Unit Assembly that was launched by SAF Holland in late 2022.

Please contact Brad Dillard, Todd Heitman, or Dan Grote at Wilson Trailer Company at 1- 800-798-2002 with your trailer serial number so that they can file a claim with SAF Holland. **Wilson Trailer Company will file the claim with SAF Holland for the repair kit to be sent to you. This repair kit will be furnished at no cost to you and labor to install will be reimbursed up to 1.5 hour.**

If you have any questions regarding this notice, please contact Todd Heitman or Dan Grote at Wilson Trailer Company, or if you do not presently own the above listed trailer, please contact Brad Dillard at Wilson Trailer Company at 1– 800-798-2002.

Federal regulations require that any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within 10 days.

If you have had this repair performed before you received this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre- notification remedy of the problem associated with this recall. For more information contact Wilson Trailer Company, Dan Grote, or Todd Heitman at 1- 800-798- 2002. Documentation of this repair must be furnished to Wilson Trailer Company prior to reimbursement.

We regret any inconvenience that this action may cause you. However, we are concerned with your safety. If Wilson Trailer Company, or SAF Holland is unable to remedy this defect without charge within a reasonable time, you may submit a written complaint to the Administrator National Highway Safety Administration, 1200 New Jersey Avenue SE, Washington DC 20590, or call toll free Auto Safety Hotline at 1-888-327-4236 (TTY: 1800-424-9153) or go to <http://www.safercar.gov>.

Sincerely,

Dan Grote  
Technical Service & Claims Mgr.

# Service Bulletin - December 2023

## SAF Tire Pilot Plus™ (TPP) Inflation System

### Tire Pilot Plus Recall Reactivation/ Upgrade

Electronic Controlled Module (ECM)  
controlled systems only

In response to Safety Recall 23E-045, ECM controlled Tire Pilot Plus (TPP) systems, sold between December 1st 2022 and June 15th 2023, have been determined under specific conditions to slowly deflate the trailer tires. A TPP system upgrade is now available that accounts for these conditions and allows the system to function properly. This document will help you identify which kit to use for your specific trailer configuration and if a new module is required. To fully implement the upgrade you will also need access to a mobile device with the TPP App installed. The App is available on the Apple Store and Google Play.

### Tire Pilot Plus Inspection and Reactivation Process

#### INSPECTION:

1. Check the trailer build date on the VIN tag. If it was manufactured December 2022 or later, the trailer could be in the target group, but needs to be confirmed to have the electronic regulator assembly installed.
2. **Figure 1** illustrates the electronic regulator. Location is on the front cross-member for a sliding suspension.
  - a. This recall does not include TPP systems with the mechanical regulator installed (**Figure 2**).
  - b. Some trailers may have the electronic regulator already removed. If the regulator is not installed the TPP system is not part of the recall. A replacement kit will need to be purchased. See replacement kit selection on page 2.
3. Units that have already been reactivated will have yellow decals affixed to the control module as well as yellow marked tire hoses installed (**Figure 3**).
4. Before performing any inspection on the trailer, set the parking brake and block the tires.

#### **⚠️ WARNING**

Failure to set the parking brake and chock the tires prior to beginning maintenance could allow the vehicle movement which, if not avoided, could result in death or serious injury.

Figure 1



Figure 2



Figure 3



# TPP Reactivation Kit Selection

## Reactivation Kit Selection: Kits available Jan. 1, 2024

1. If determined to be part of the TPP recall see Chart 1 for needed reactivation kit.
2. Contact SAF-HOLLAND Warranty Dept. to place kit orders. 1-800-767-6967 or [service@safholland.com](mailto:service@safholland.com)

Chart 1

Number of Axles	WBS/Dual Tire	Kit Number
2	Dual	SRK-952
2	WBS	SRK-953
1	Dual	SRK-954

For other combinations contact SAF Customer Service.

SAF-HOLLAND will reimburse labor for this reactivation. Details for reimbursement are included in the reactivation kits. We apologize for any inconvenience this may have caused. SAF-HOLLAND is committed to serving our customers with quality products.

## Replacement Kit Selection: Kits available for purchase Jan. 1, 2024

1. If the trailer doesn't have a control module installed you will need to purchase a kit from Chart 2.
2. If the TPP indication light was removed, **Figure 4**, this will need to be installed as well. Light kit 211630000300 will also need to be purchased.
3. Contact SAF Aftermarket Dept. to place kit orders. 1-800-876-3929 or [amsales@safholland.com](mailto:amsales@safholland.com)

Chart 2

Number of Axles	WBS/Dual Tire	Tire Pressure Setting	Kit Number
2	Dual	95	SRK-956
2	Dual	100	SRK-957
2	Dual	105	SRK-958
2	Dual	110	SRK-959

For other combinations contact SAF Customer Service.

Figure 4



XL-AAZ01315B-en-US Rev. - 2023-11-29 - Amendments and Errors Reserved - © SAF-HOLLAND, Inc., SAF-HOLLAND, HOLLAND, SAF, and logos are trademarks of SAF-HOLLAND S.A., SAF-HOLLAND GmbH, and SAF-HOLLAND, Inc.