


INSTRUCTION TO SERVICE

ITS: 60795	08/25/2023	
SECTION:	260-Battery Compartment	
WRITTEN BY:	Devin Draward	
SUBJECT:	Add pre-formed insulation to the ESS Ports and Drains – 6 String ESS	
ISSUE:	vironmental conditions may cause the ESS drain to activate inadvertently	
SUMMARY:	Add pre-formed insulation to the ESS Ports and Drains	

ITS60795

Ref. NHTSA Recall No.	Ref. Transport Canada Recall No.		
23V083000	2023-073		

 THIS ITS DOCUMENT SHOULD BE RETAINED AND REFERRED TO FOR FUTURE MAINTENANCE UNTIL THE NEW FLYER PARTS AND/OR SERVICE MANUAL IS UPDATED TO REFLECT WORK DONE AS A RESULT OF THIS DOCUMENT. ENSURE THAT THIS DOCUMENT IS AVAILABLE FOR PARTS AND MAINTENANCE STAFF GOING FORWARD.







PROCEDURE:

- 1. Set the park brake and chock the wheels.
- 2. Turn the master run switch, the main battery disconnect and the HV interlock switch to the "OFF" position.

MARNING: The work detailed in this ITS involves working near High Voltage (HV) compartments, even after the bus has been locked out and tagged out. It is recommended that the service personnel be trained in NFI HV safety practices, such as those included in <u>Appendix A – NFIL Spec 532295 - High Voltage Safety Guidelines & Procedures for New Flyer Battery Bus.</u>

3. Perform the Lock Out Tag Out and De-Energizing procedures found in the Electrical System Section of the New Flyer Service Manual. Reference Figure 1 below.

MARNING: ENSURE MSD DUMMY PLUGS AND ARC FLASH GLOVES ARE AVAILABLE PRIOR TO STARTING ANY HV DISASSEMBLY

NOTE: Use commercially available lock out equipment and tags being sure to follow any local laws or workplace procedures.

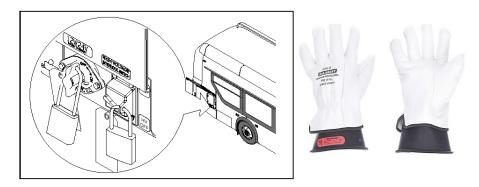


Figure 1: HV and LV Disconnect Switch Location and Arc Flash Glove Reference

4. Gain access to the rooftop ESS drains. Ensure that appropriate fall protection PPE is used and available for the duration of the work.

Ensure appropriate safety procedures are followed for the duration of the work.

5. Gain access to the to both the front and rear drains of the rear ESS. Reference Figure 2 on the following page for an exemplar ESS with rear drains visible.



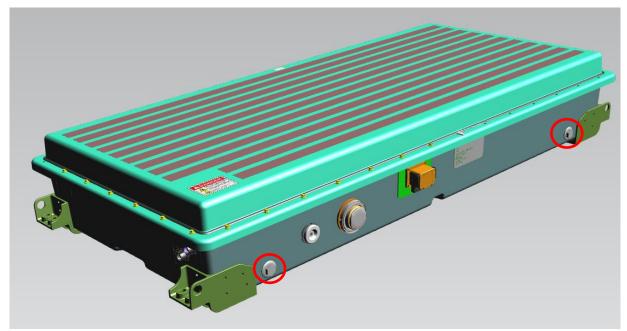


Figure 2: Complete ESS Enclosure - Rear Drains Visible

- 6. Using a lint-free cloth, carefully clean the exterior of the drain and port assembly with isopropyl. Ensure a flash-off time of 1 minute is followed. This is to ensure that the pressure sensitive adhesive on the foam puck bonds sufficiently to the port.
- 7. A complete ESS enclosure will contain four drains. Carefully peel the white backing off of the insulation and apply a pre-formed foam puck (PN 1040861) over the ESS port and drain assembly. Repeat for all ESS drains on vehicle. Reference Figure 3 below for an installed foam-puck.

WARNING: Avoid covering the piston when applying the foam puck!!!

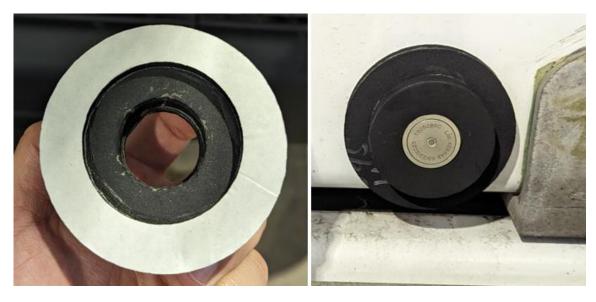


Figure 3: Remove White Backing (L) and Adhere Foam Puck to the ESS Port and Drain Assembly (R) – Repeat for all Drains.

ITS-60795 Page 3 of 10 8/25/2023



l	LABOUR - 6 STRINGS					
		Operation	Number of Technician(s)	Hours	Labor Time T X HR	
	1	INSULATE 24 ESS DRAINS 6-STRING	1	1.25	1.25	

PARTS					
Item	Part Number	Description	Qty. per Coach	Units	Notes
1	1040861	PUCK-FOAM, EMERG DRAIN	24	EA	

SPEC	SPECIAL TOOLS				
Item	Part Number	Description	Qty.	Units	Notes
1	6487253	ALCOHOL-CRC ISOPROPYL 99%-16OZ			Source Locally



Appendix A – NFIL Spec 532295 - High Voltage Safety Guidelines & Procedures for New Flyer Battery Bus

The following provides general guidelines in relation to safety and best practices when completing installation or servicing work on any New Flyer battery bus vehicle platform.

This document is not meant to supersede the actual released installation and assembly drawings and where conflicts arise, the released engineering drawings take precedence.



Introduction

The utmost concern, while working with High Voltage (HV) systems, is the safety of yourself, other personnel, and the potential of damage to property. To minimize these risks, it is crucial to be properly trained and always maintain a very alert, questioning, and disciplined attitude without fail. As soon as your guard is lowered, then the potential of an accident is probable that can hurt or kill yourself or someone else and possibly damage property.

What is High Voltage (HV)?

Any form of voltage that is greater than 50 volts if the person's skin at the electrical contact points is not compromised and not wet.



Equipment Required

The following equipment shall be required:

Digital Multimeter (DMM), 1000-volt Category III, 600 volt Category IV, 10Megohm impedance or greater with insulated case or rubber holster Clamp-on current probe, 1000-volt Category III, 600 volt Category IV High Pot Tester (Hi-Pot)

Phase rotation meter

Personal Protection Equipment (PPE) appropriate for 700volt DC & 230 volt AC with Class 00 or higher HV gloves with compatible leather over gloves. Appropriate safety glasses as well as the face shield. The PPE shall also meet the required Arc Flash & Arc Blast requirements. Before use, inspect the PPE in accordance with this guideline.

Adequate lighting HV insulated mat

Two fused HV clip leads 10 inches long

Safety barricade with warning lights & "Danger High Voltage" signs Belt tool pouch (use only to carry small components up/down a ladder)

Torque Screwdriver set

Imperial torque nut driver set

Metric torque nut driver set

Equipment Calibration

All test equipment must be within their calibration interval and recorded such with the respective serial numbers.

These records must be available to the Checker.



Personnel Requirement

Only trained personnel shall supervise and perform High Voltage system testing, checkout, and troubleshooting. Two personnel (one called the Checker & the other called Monitor/Recorder) shall perform Checkout Procedures, together, to ensure safety of themselves, others nearby & for the protection of vehicle & property. Refresher training shall be provided to these personnel on a regular basis and when new systems are to be checked by them. The training of the personnel shall consist of:

HV & low voltage basics, intermediate & advanced electricity
HV & low voltage electrical systems of the vehicle
Shop safety practices & procedures
First aide including CPR & the use of the shop defibrillator
How to release a victim that can't let go HV
Quickest method of shutting down HV
Firefighting and emergency procedures
HV & arc flash safety
Organized & tidy placement of equipment & tools allowing for
unrestricted movement
Operation of Hi-pot

To ensure effectiveness of training, exams of the trained material shall be required with a high passing mark of at least 80% and a retraining of the missed 20 % on a one-to-one basis.

Checker Function

(Caution: The Checker must not have any health conditions that can be exacerbated when startled and must not have any electronic implants.)

Directed by the Monitor/Recorder
Performs all preparations & checks
Wears PPE as specified by the Checkout Procedure
Performs all restorations

Vehicle Inspection

It is necessary that the vehicle to be checked out, first be visually inspected of all systems, workmanship and with special attention to ensuring there is no HV cable or equipment damage or chafing.



High Voltage Checkout Preparation

- (1) The scope of the work must be accurately defined such as a Checkout Procedure that requires systematic steps with sign offs. Before a Checkout is performed, the Supervisor, Checker and Monitor/Recorder must conduct a briefing of what shall transpire, identify potential hazards, resist pressures of "is it done yet?", anticipate problems and question possible events. If unexpected electrical hazard or fault occurs, during any time of the Checkout, it must be immediately reported to the supervisor. After the Checkout is completed, the same group should review the results and processes and make proposed modifications to the procedures if required.
- (2) Install Safety barricade with warning lights & signs indicating "Danger High Voltage" around the vehicle perimeter and ensure no personnel are within the fenced perimeter during the checkout procedure.
- (3) It shall always be the goal to check the systems as much as possible with all HV power OFF and Locked Out/Tagged Out and proven as de-energized by voltage measurement using the DMM. The functionality of the DMM must be proved before and after the verification of no HV present. Then, if possible, the HV systems should be challenged by trying to energize them while checking that no HV appears.
- (4) When it is necessary to perform tests of HV systems with the power ON, then the Working Live procedure must be followed.
- (5) The test personnel shall always rehearse the actions required in case of any possible accident scenarios.
- (6) Before beginning the Checkout Procedure, the test personnel shall remove all their jewelry (including pierced ones), watches and any electrically conductive objects on them.

PPE Requirements

The PPE voltage class, Arc Flash and Arc Blast rating shall be compatible with the voltage and Arc Flash capability of the systems being tested. Appropriate leather glove protectors shall be worn over the HV rubber gloves.

PPE Care & Testing

Rubber insulated PPE shall be periodically cleaned and tested in accordance with 29 CFR 1910.137 and the appropriate ANSI/ASTM standards. HV gloves, sleeves and mats shall be tested every 6 months. PPE apparel shall be cleaned and maintained in accordance with the manufacturer's instructions. A record of the PPE testing shall be maintained and available to the users.



PPE Inspection

Inspect PPE equipment, before use, for any degradation or damage and ensure that the HV gloves have been tested every 6 months. Also perform an air pressure test on the HV gloves before and after each use. If during PPE use a potential damaging incident occurred to the PPE, stop further testing and inspect the PPE. If at any time the PPE is defective, reject it, and obtain an accepted one.

PPE Storage

PPE apparel should be stored lying flat, undistorted, right-side out and not folded in protective containers. The HV mats can be rolled with an inside diameter greater than 2 inches.

Rubber HV gloves should be stored in cool, dark, dry, and free from damaging chemicals or vapors. The glove cuffs should face downwards, without folding, in the appropriate glove bag and hung vertically.

Insulated Tools

Insulated tools should be visually inspected for insulation damage before and after each session of use.

Lockout/Tagout Procedure

The Lockout/Tagout procedure should be followed that is specified in the respective checkout procedure. When removing the lock and tag:

- (1) The locks and tags shall be removed by the installer of them or under her/his supervision.
- (2) If the installer of the locks and tags is not available, then her/his supervisor:
- (a) Ensures that the installer of the locks and tags in not in the facility
- (b) Contacts the installer to inform her/him that the locks and tags will be removed
- (c) Reminds the installer of the lock and tag removal when she/he resumes work

Stored Energy

Personnel must always remember the characteristics of stored energy devices such as capacitors and batteries and when energy is available from.

Working Live

To maximize safety, it is always important to perform the maximum amount of HV checkout in the de-energized state.

When it is necessary to work with HV equipment while energized or to verify whether HV is present, the utmost care and safety procedures must be utilized including:

- (1) Wearing appropriate PPE with protector gloves over top of the HV rubber gloves
- (2) Ensure all personnel, except the Checker and Monitor/Recorder, are clear of the vehicle
- (3) Kneeling or standing on HV insulated mat



Energizing & De-energizing Procedure

It is critical that before any HV system is energized that a visual check be performed to ensure that all possible HV compartments are closed and there is no debris, tools or test equipment lying on HV terminations. If there is a certain sequence of energizing and de-energizing the HV system, then all personnel involved must be trained in this sequence. (CAUTION: Never try to connect or disconnect circuit components such as cables, fuses, connectors, etc. while there is current flowing in the circuit.)

Electrical Injuries

Electrical injuries should be immediately reported to the first aide personnel and the supervisor. Other than electrostatic shocks, even non-injurious electrical shocks should be reported to the supervisor. These should be immediately investigated and documented to determine the cause and prevent the occurrence in the future.