



Service Bulletin

American Honda Motor Co., Inc.

NVA110B #1
March, 2023

SAFETY RECALL

2022 NVA110B Speedometer Cable Replacement

BACKGROUND

Honda is launching a **SAFETY RECALL** on **CERTAIN 2022 NVA110B** motorcycles to replace the speedometer cable. An improperly routed speedometer cable may result in a speedometer malfunction which can affect the rider's judgment to ride safely, increasing the risk of a crash or injury.

AFFECTED UNITS

As of March 16, 2023, **YOU MUST NOT SELL CERTAIN NEW or USED** 2022 NVA110B motorcycles until they are repaired according to this Service Bulletin.

- To search for applicable recalls on a specific unit, you **MUST** use *Unit Information* on **IN**.
- To manage your affected new inventory, use your dealer *eResponsibility Report* on **IN**.

CUSTOMER NOTIFICATION

American Honda intends to mail customer letters to all owners of affected 2022 NVA110B motorcycles in May 2023. Customers will be informed that their motorcycle may be affected by a safety related defect and will be advised to make an appointment with an authorized Honda dealer for repair.

PARTS INFORMATION

Parts are available and can be ordered through the *Controlled Parts Ordering* process. An affected vehicle VIN will be required to order the speedometer cable.

MODEL	DESCRIPTION	PART NUMBER	QTY.
NVA110B	CABLE, SPEEDOMETER	44830-KTE-D12	1

DEALER REPAIR RESPONSIBILITY

- Repairs must be performed by a qualified technician.
- Performing this repair exactly as shown in Repair Procedure instructions is critical for the remedy to be effective. Carefully follow all instructions.
- Service Management should inspect and confirm the repair.
- Dealer submission of a warranty claim affirms this repair was properly performed.

WARRANTY CLAIM INFORMATION

After completing this Service Bulletin update, submit one warranty claim per unit with the following template number.

MODEL	TEMPLATE	FLAT RATE
NVA110B	KP1A	0.4

DEALER SUPPORT

TECHNICAL QUESTIONS

If you have any technical questions relating to this update procedure, please contact:

Motorcycle TechLine Online:

iN > Service > TechLine > TechLine > Tech-Line Connect

Or call (800) 421-1900, option 9

WARRANTY QUESTIONS

If you have any warranty administration questions relating to warranty claim templates, and claim filing procedures, please contact:

Motorcycle Warranty Online:


iN > Service > Warranty & HondaCare > Warranty Connect Filing

RECALL REPAIR IDENTIFICATION


Before you begin the repair procedure, verify that the unit has not already been repaired by searching *Unit Information* on **iN**.

SPEEDOMETER CABLE REPLACEMENT


1. Remove the headlight assembly and disconnect the headlight bulb.

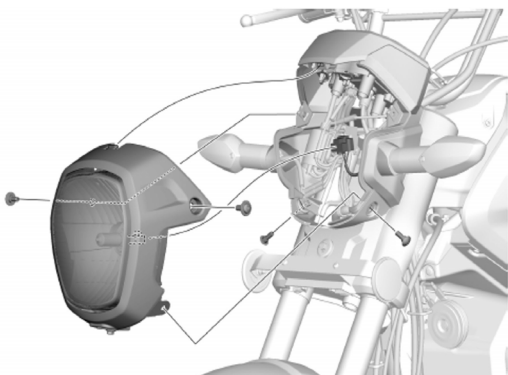

Note: Be careful to pull the lower part of the headlight outward slightly, then release the tab that secures the meter cover to the headlight assembly and pull the assembly straight out.

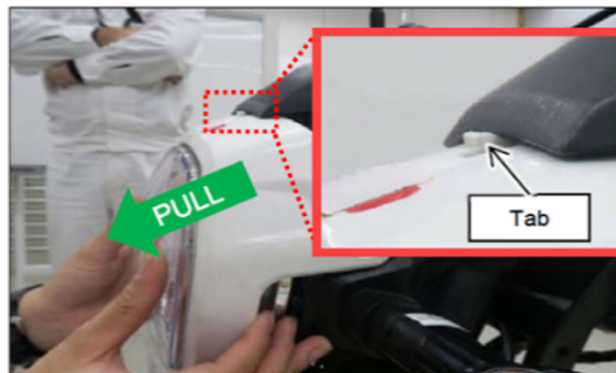

2. Disconnect the speedometer cable by unscrewing the knurled nut that attaches the speedometer cable to the underside of the meter.
3. Pull the speedometer cable through the cable guides.


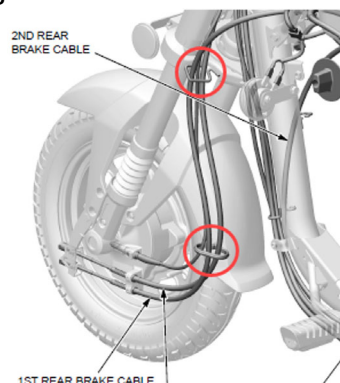


4. At the front wheel hub, release the tab securing the other end of the speedometer cable to the brake panel.



5. Remove the speedometer cable.

6. Install the new speedometer cable in reverse order of removal. Follow the routing instructions shown below.

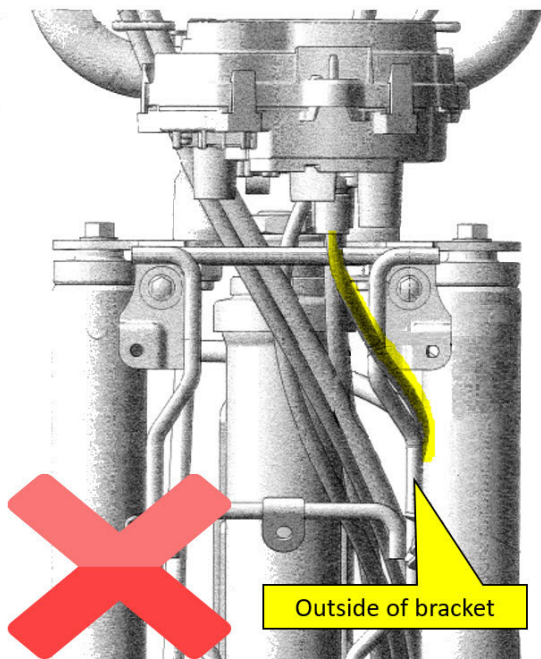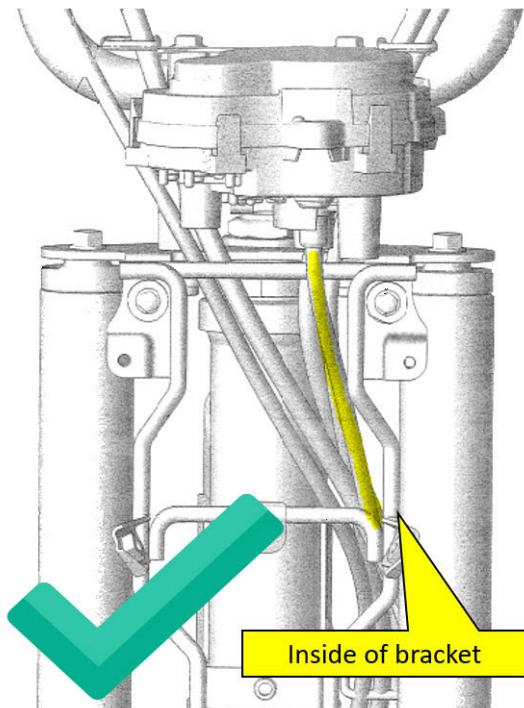

7. Re-connect the headlight connector and install the headlight assembly in reverse order of removal.
8. Confirm the speedometer is operating correctly.

TEXT OF CUSTOMER LETTER