

RECALL 23V288 REMEDY INSTRUCTIONS



Make(s): Salem & Wildwood
Model(s): Many, See Below
Model Year(s): 2023

Concern:
The brakes may be incorrectly wired.

Repair Code: RC-007-22-00-004319
Allotted Time: .25 HRS.
Inspection Code: N/A
Allotted Time: N/A
Photo(s) Required: NO
Prior Authorization Required: YES
Part(s) Kit Number: N/A
Part(s) Return: N/A

Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

CERTAIN 2023 – SALEM: SMT27RKX, SMT29BDBX & SMT29VBUDX

CERTAIN 2023 – WILDWOOD: WDT26DBUDX, WDT27RKX, WDT29BDBX & WDT29VBUDX

STEP 1: LOCATE THE BRAKE WIRING ON THE DRIVERS SIDE OF THE VEHICLE (OFF DOOR SIDE) WHERE THE BRAKE WIRING DROPS DOWN TO THE AXLE FROM THE UNDERBELLY;

STEP 2: REMOVE THE GEL-CONNECTORS, ENSURE TO LEAVE ENOUGH WIRE TO RE-INSTALL A NEW GEL FILLED CONNECTOR(S);

STEP 3: ON BOTH OFF DOOR SIDE HUBS THE WIRING SHOULD BE AS FOLLOWS (FIGURE 1);

- 1 – BLACK WIRE THAT COMES FROM THE UNDERBELLY
- 1 – GREEN WIRE THAT COMES FROM THE HUB
- 1 – BLACK WIRE THAT COMES FROM THE AXLE TUBE

FIGURE 1 – DRIVER / OFF DOOR SIDE WALL



FIGURE 2 – PASSANGER / DOOR SIDE WALL



STEP 4: ON THE DOOR SIDE WALL LOCATE THE BRAKE WIRING. REMOVE GEL-CONNECTORS ENSURE TO LEAVE ENOUGH WIRE TO RE-INSTALL A NEW GEL FILLED CONNECTOR(S)

STEP 5: ON BOTH DOOR SIDE HUBS, THE WIRING SHOULD BE INSTALLED AS SHOWN IN FIGURE 2;

- 1 – BLACK WIRE FROM THE AXLE – INTO CONNECTOR NEXT TO GREEN WIRE (FIGURE 2)
- 1 – GREEN WIRE FROM THE HUB – INTO CONNECTOR NEXT TO BLACK WIRE (FIGURE 2)

STEP 4: ENSURE TO CRIMP ALL GEL-CONNECTORS FULLY;

STEP 5: TEST BRAKE FUNCTIONALLITY;

STEP 6: CLAIM REPAIR CODE.