

Recall Inspection and Repair Instructions

NHTSA Recall #: 23V-308

Transport Canada Recall #: TC-2023-298

Tiffin Motorhomes Recall #: TIF-130

Models Involved: 2020, 2021, 2022 and 2023 Allegro Breeze Motorhomes

Purpose: To provide instructions on how to relocate 110V Molex connectors from floor to cabinet wall.

Tools Needed:

Power Drill

#2 Square-head bit

Multimeter

Parts Needed:


FLAT RATE CODES AND TIMES

When filing the warranty claim for payment, please use the following flat rate codes and times.

BR9873RC01, for 1 hour


REPAIR PROCEDURES:

1. Disconnect the batteries. The main feed to the house and chassis batteries needs to be disconnected.
 - i. House batteries are in the front passenger compartment.
 - ii. Chassis batteries are in the rear passenger compartment.
2. Locate the two Molex connectors mounted to the floor directly behind the refrigerator. Verify there is no power to connector with a multimeter, then remove the 8 mounting screws.

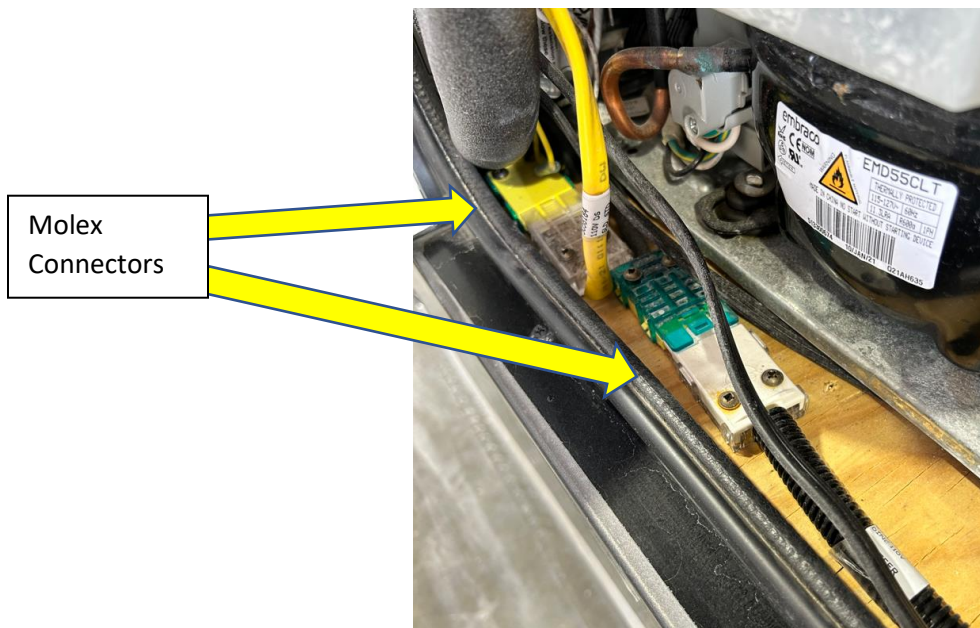

3. Secure Molex connectors to front facing wall of refrigerator cabinet. Connectors can mount vertically or side by side, as long as wiring is properly secured.

 Vertical Orientation



Side-by side Orientation

