


SERVICE PROCEDURE

23517
JULY, 2023

SUBJECT: SAFETY RECALL INTERIM NOTICE
Brake Pressure Switch on certain 2018 thru 2020 FBC1300 stripped chassis built 11/29/2017 thru 08/09/2019, 2023 and 2024 FBC1300 stripped chassis built 03/04/2022 thru 05/19/2023, 2016 DuraStar® model trucks built 01/07/2015 thru 01/29/2015, 2018 thru 2020 DuraStar® model trucks built 08/16/2017 thru 01/21/2019, 2019 thru 2024 International® MV™ series trucks built 08/16/2017 thru 01/21/2019, 2019 thru 2022 IC Bus® commercial buses built 11/26/2018 thru 01/05/2022, and 2019 thru 2024 IC Bus® TC commercial buses built 05/24/2018 thru 05/15/2023 with feature code 04100 (Brake system, hydraulic)

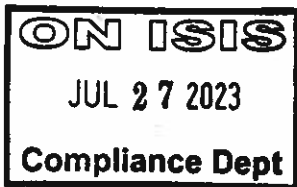

CUSTOMER LETTER

Print ready (PDF file) copy of the International [Customer Letter](#)

Print ready (PDF) copy of the IC Bus [Customer Letter](#)

DEFECT DESCRIPTION

The brake pressure switch may allow brake fluid to seep past the diaphragm seal into the brake pressure switch electrical connector and associated fuse, which can short the switch and / or fuse. A shorted switch or fuse may cause the circuit to generate excessive heat, which can result in a fire, increasing the risk of property damage or personal injury to the operator.

MODELS INVOLVED

This safety recall involves certain 2018 thru 2020 FBC1300 stripped chassis built 11/29/2017 thru 08/09/2019, 2023 and 2024 FBC1300 stripped chassis built 03/04/2022 thru 05/19/2023, 2016 DuraStar® model trucks built 01/07/2015 thru 01/29/2015, 2018 thru 2020 DuraStar® model trucks built 08/16/2017 thru 01/21/2019, 2019 thru 2024 International® MV™ series trucks built 08/16/2017 thru 01/21/2019, 2019 thru 2022 IC Bus® commercial buses built 11/26/2018 thru 01/05/2022 and 2019 thru 2024 IC Bus® TC commercial buses built 05/24/2018 thru 05/15/2023 with feature code 04100 (Brake system, hydraulic).

ELIGIBILITY

This procedure applies ONLY to vehicles marked in the International® Service Portal™ with Safety Recall 23517. Also complete any other open campaigns listed on the Service Portal at this time.



PARTS INFORMATION

No required parts.

ACTIONS YOU SHOULD TAKE

NOTE: This condition may cause the service brake system malfunction lamp to illuminate on vehicle's gauge cluster when the vehicle is in operation.

NOTE: This condition may cause the brake booster motor to run when the ignition is in the Key OFF position.

- Until the recall remedy is performed, owners should NEVER park the affected vehicles indoors and ALWAYS park the affected vehicles outdoors.
- If contacted by customers, make sure they understand the Actions You Should Take in the interim notice they received in the mail.
- Parts are expected to be available early September 2023.

NAVISTAR, INC.