

Service Bulletin - December 2023

SAF Tire Pilot Plus™ (TPP) Inflation System

Tire Pilot Plus Recall Reactivation/ Upgrade

Electronic Controlled Module (ECM)
controlled systems only

In response to Safety Recall 23E-045, ECM controlled Tire Pilot Plus (TPP) systems, sold between December 1st 2022 and June 15th 2023, have been determined under specific conditions to slowly deflate the trailer tires. A TPP system upgrade is now available that accounts for these conditions and allows the system to function properly. This document will help you identify which kit to use for your specific trailer configuration and if a new module is required. To fully implement the upgrade you will also need access to a mobile device with the TPP App installed. The App is available on the Apple Store and Google Play.

Tire Pilot Plus Inspection and Reactivation Process

INSPECTION:

1. Check the trailer build date on the VIN tag. If it was manufactured December 2022 or later, the trailer could be in the target group, but needs to be confirmed to have the electronic regulator assembly installed.
2. **Figure 1** illustrates the electronic regulator. Location is on the front cross-member for a sliding suspension.
 - a. This recall does not include TPP systems with the mechanical regulator installed (**Figure 2**).
 - b. Some trailers may have the electronic regulator already removed. If the regulator is not installed the TPP system is not part of the recall. A replacement kit will need to be purchased. See replacement kit selection on page 2.
3. Units that have already been reactivated will have yellow decals affixed to the control module as well as yellow marked tire hoses installed (**Figure 3**).
4. Before performing any inspection on the trailer, set the parking brake and block the tires.

⚠️ WARNING

Failure to set the parking brake and chock the tires prior to beginning maintenance could allow the vehicle movement which, if not avoided, could result in death or serious injury.

Figure 1



Figure 2

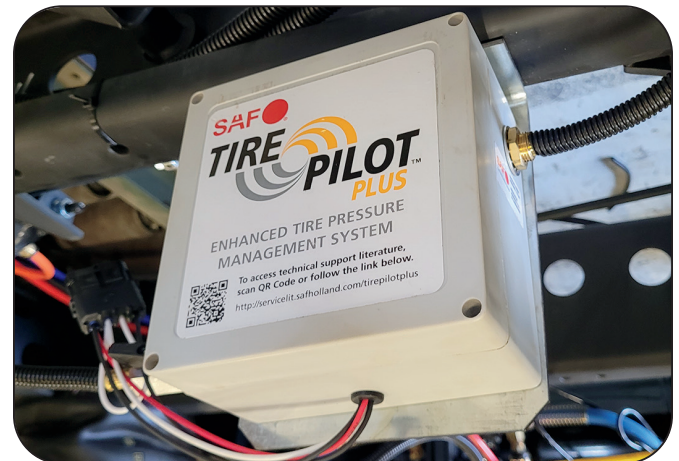


Figure 3



TPP Reactivation Kit Selection

Reactivation Kit Selection: Kits available Jan. 1, 2024

1. If determined to be part of the TPP recall see Chart 1 for needed reactivation kit.
2. Contact SAF-HOLLAND Warranty Dept. to place kit orders. 1-800-767-6967 or service@safholland.com

Chart 1

Number of Axles	WBS/Dual Tire	Kit Number
2	Dual	SRK-952
2	WBS	SRK-953
1	Dual	SRK-954

For other combinations contact SAF Customer Service.

SAF-HOLLAND will reimburse labor for this reactivation. Details for reimbursement are included in the reactivation kits. We apologize for any inconvenience this may have caused. SAF-HOLLAND is committed to serving our customers with quality products.

Replacement Kit Selection: Kits available for purchase Jan. 1, 2024

1. If the trailer doesn't have a control module installed you will need to purchase a kit from Chart 2.
2. If the TPP indication light was removed, **Figure 4**, this will need to be installed as well. Light kit 211630000300 will also need to be purchased.
3. Contact SAF Aftermarket Dept. to place kit orders. 1-800-876-3929 or amsales@safholland.com

Chart 2

Number of Axles	WBS/Dual Tire	Tire Pressure Setting	Kit Number
2	Dual	95	SRK-956
2	Dual	100	SRK-957
2	Dual	105	SRK-958
2	Dual	110	SRK-959

For other combinations contact SAF Customer Service.

Figure 4

