



GROUP	MODEL
Safety Recall Campaign	2010-2011MY Rondo (UN)
NUMBER	DATE
SC284UN	June 2024

## SAFETY RECALL CAMPAIGN

SUBJECT:

### HECU FUSE REPLACEMENT (SC284UN)

This bulletin provides information to replace the fuses of the Hydraulic Electronic Control Unit (HECU) and install an updated junction box label on certain 2010-2011MY Rondo (UN) vehicles produced from September 19, 2009 through February 9, 2011. An engine compartment fire may occur in the area where the HECU is located. The HECU may experience an internal electrical short circuit condition that can result in overcurrent, thereby increasing the risk of an engine compartment fire while the vehicle is driven or while parked. Dealers are to install new fuses to prevent an electrical short circuit condition in the HECU's electrical circuit board. Customers may experience illumination of the Malfunction Indicator Lamp (MIL), ABS warning light, burning/melting smell, and/or smoke from the engine compartment. Follow the procedure outlined in this publication to install new fuse(s) and junction box cover label(s) on the applicable vehicle. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs.

#### NOTICE

**There is no charge to the vehicle owner for this repair. Under applicable law, you may not sell or otherwise deliver any affected vehicle until it has been repaired pursuant to the procedures set forth in this bulletin.**


Repair status for a VIN is provided on KDealer+ (Service → Warranty Coverage → Warranty Coverage Inquiry → Campaign Information). Not completed Recall / Service Action reports are available on KDealer+ (Consumer Affairs → Not Completed Recall → Recall VIN → Select Report), which includes a list of affected vehicles.

SUBJECT:


# HECU FUSE REPLACEMENT (SC284UN)

## Replacement Procedure:

1. Open the hood.
2. Remove the junction box fuse cover.

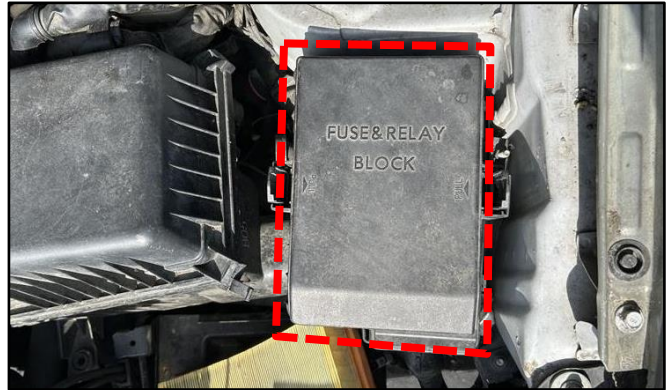

- 3a. Remove both existing HECU ABS1 40A (A) and ABS2 40A (B) fuses.

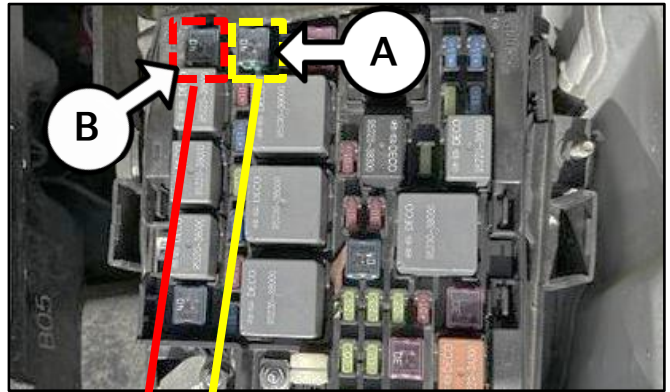


- 3b. Install new amperage fuses:


- ABS1 fuse (A) → new 20A
- ABS2 fuse (B) → new 30A

**ⓘ IMPORTANT**

Ensure to replace ABS1 fuse (A) with the 20A fuse and ABS2 fuse (B) with 30A fuse.

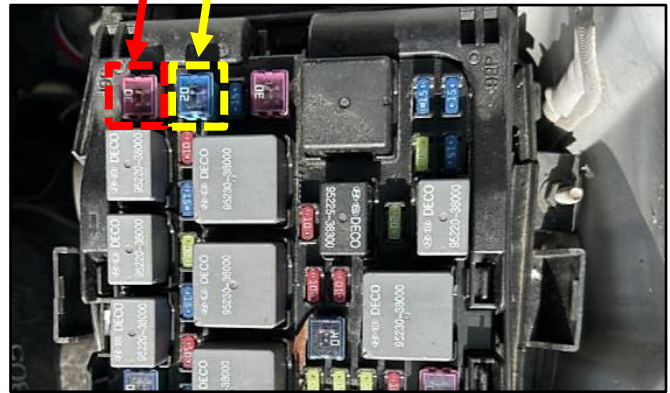

4. Adhere the new ABS1 20A and ABS2 30A labels to the bottom of the junction box fuse cover, as shown.

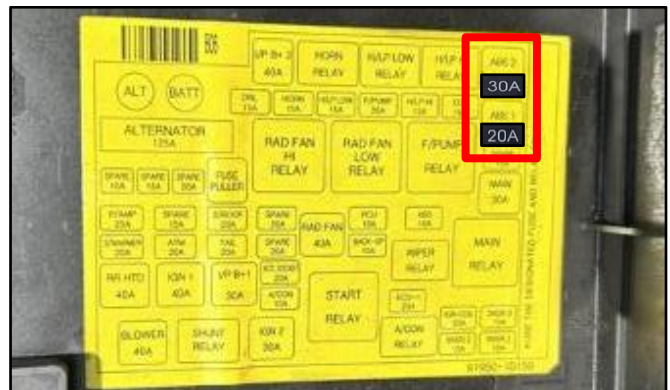

5. Reinstall all removed parts in reverse order of removal.





SUBJECT:

**HECU FUSE REPLACEMENT (SC284UN)****AFFECTED VEHICLE RANGE:**

Model	Production Date Range
Rondo (UN)	September 19, 2009 to February 9, 2011

**REQUIRED PART:**

Part Name	Part Number	Figure	Qty.
Fuse & Label Kit	91UN1 11010QQK	  <div style="display: flex; flex-direction: column; gap: 5px;"> <div style="background-color: black; color: white; padding: 2px 5px;">30A</div> <div style="background-color: black; color: white; padding: 2px 5px;">20A</div> </div>	1

Note: Order Quantity will be controlled by a UIO% per dealer net submitted warranty claims. No VIN entry will be required. To keep the supply of parts flowing, please be sure to expedite warranty claim filing. As supply becomes more available, the maximum order quantity limit may be increased or removed.

**WARRANTY INFORMATION:****N Code: N99 C Code: C99**

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
R	58920 1D400	0	(SC284UN) HECU Fuse and Label Kit Installation	241035R4	0.3 M/H	91UN1 11010QQK	1

Note: Refer to [Warranty Bulletin 2024-25](#) for claim submission procedures. Manually enter sublet code 'X2' for reimbursement of one roundtrip rideshare expense or up to three (3) days of rental expense, with supporting documentation.

**NOTICE**

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SC284UN when accessing the KDealer+ system.

