

# August 9, 2024

Version 1

# Safety Recall: 2023 Accord Fuel Pump Module Set/Assembly Replacement

## **AFFECTED VEHICLES**

Year	Model	Trim Level	VIN Range
2023	Accord	EX	Check the iN VIN status for eligibility.

## BACKGROUND

A single 2023 Accord unit may have received a **fuel pump assembly service part** with a defective impeller. Due to swelling of the fuel pump motor impeller, the fuel pump may seize and stop working. A defective impeller may cause the fuel pump to become inoperative, which could prevent an engine from functioning as intended. This limitation may cause a loss of motive power or a stall while driving increasing the risk of a crash or injury, creating a safety hazard. If this bulletin appears during an iN VIN status inquiry, the vehicle is subject to a safety recall.

## **CUSTOMER NOTIFICATION**

The owner of the affected vehicle will be sent a notification of this campaign. They will be informed that due to a limited supply of parts (at this time) Honda is prioritizing the repair of customer vehicles experiencing symptoms related to this recall.

When adequate replacement parts become available, Honda will send a follow-up letter to the customer instructing them to schedule an appointment for the vehicle affected by this recall. If the customer experiences the known symptoms associated with this safety recall (see CORRECTIVE ACTION), they are instructed to contact their local Honda dealer for the repair.

For any questions or concerns customers may have, you may have them contact American Honda Customer Support & Campaign Center at **1-888-234-2138**.

**CUSTOMER INFORMATION:** The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

# **CORRECTIVE ACTION**

Replace the fuel pump module set.

## **PARTS INFORMATION**

Part Name	Part Number	Quantity
Fuel Pump Module Set	17045-30A-A00	1
Fuel Feed Quick-Connect fitting (c) white Sanoh	17711-S84-004	1

## **TOOL INFORMATION**

Tool Name	Part Number	Quantity
Fuel Sender Wrench	070AA-TLA0100	1

## WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
3101EH	Fuel Pump replace	1.0	6FE00	JIH00	A24079A	17045-30A-A00

Skill Level: Repair Technician

## **REPAIR PROCEDURE**

- 1. Relieve the fuel pressure. NOTE: *Fuel Pressure Relieving*, (CLICK HERE)
- 2. Do the terminal disconnection procedure. NOTE: 12 Volt Battery Terminal Disconnection and Reconnection, (CLICK HERE)
- 3. Remove the rear seat cushion.

NOTE: Rear Seat Area, (CLICK HERE)

- 4. Remove the fuel unit and replace it with a new one. NOTE: *Fuel Tank Unit Removal and Installation*, (CLICK HERE)
- 5. Install all remaining parts in reverse order.
- 6. Reconnect the battery terminal.

NOTE: 12 Volt Battery Negative Terminal Reconnect, (CLICK HERE)

7. Check for fuel leaks on the low-pressure side.

NOTE: Fuel Line Inspection, (CLICK HERE)

 California residents only: Fill out a Vehicle Emissions Recall – Proof of Correction certificate and use JIH as the recall number. Have the service advisor give the certificate to your customer and advise him or her to keep it as proof that the recall was completed. Your customer will need to submit this certificate to the DMV only if the DMV requests it. If you need more certificates, use reorder number Y0657.

License Number Make Year Model Body Type		Body Type	Vehicle Identification Number			
devic	above des	t applicable C	has been re	epaired, modified and/or equipped mini- ission Control Laws. Address, City, State and Zip		
Date De		Deal	ealership's Authorized Signature			