

23PBB – Bendix 2.1m Medium Duty Brake Pedal Plunger: NHTSA #23V087, TC #2023-070

 [Edit](#)  [Clone](#)

Number

23PBB

Supplier

Bendix

Description

Bendix 2.1m Medium Duty Brake Pedal Plunger

Date

2/17/2023

What's New

Safety Recall

The brake pedal plunger which connects the brake pedal to the brake valve may dislodge after the pedal is fully depressed, and rapidly released (side slip foot brake release). If the plunger in the brake pedal assembly dislodges the driver may be unable to apply the service brakes, which may

increase the risk of a crash.

Introduction

If the brake pedal plunger becomes disconnected or jammed, the operator may not be able to apply the service brakes.

Situation

4,209 (4,015 U.S. and 194 Canada) 536, 537, and 548 chassis manufactured between 6/16/2020 and 01/25/2023.

Resolution

Safety Recall

Service all affected chassis that enter your dealership, even if the customer has no issue with the chassis.

1. Review the attached chassis list for your dealer code and schedule your customer(s) for service if their chassis is on the list.
2. If you are not using Service Management to start repair orders, review SIR for "Complete" or "In Process" next to the "23PBB" campaign code prior to performing this repair.
3. Follow the procedure to add the brake pedal restraint within the repair procedure.

Federal Law

It is a violation of Federal law for a dealer to sell or lease new vehicles covered by this recall until the defect or noncompliance has been corrected.

Warranty

There is no time or mileage limit for this recall. Peterbilt will pay for parts at dealer net plus applicable mark up and labor:

- **0.3 hours** labor to add the brake pedal restraint per the repair procedure and ensure working status of the brakes. Use Quick Claim Code

23PBBA.

- For extraordinary circumstances please use code **23PBB**. Add from "Recommended Repairs", then select the gear icon to edit Parts/Labor/Misc.
- File the claim within 14 days in accordance with Warranty Policy.

Take off parts disposition: N/A

PRWS CLAIM CODING			
Campaign Code:	23PBB	Campaign Type:	Safety Recall
Claim Category:	Truck	Repair Type:	Proactive
Customer Concern Code:	195	Causal Code:	51
Corrective Action Code:	12	Responsibility Code:	CampSupp
Failure Location:	013-005-001	Causal Part:	G90-1288
Supplier Code:	Bendix 01674AA	SRT Code:	B23-PBB 0.3hrs - Bendix 2.1m MD brake

			pedal bracket installed per bulletin procedure.
--	--	--	--

Procedure

Please follow your dealership's safety procedures and precautions to ensure the vehicle can be safely repaired and maintained.

A link to the repair procedure can be found in the Links section of this bulletin.

Parts

Parts are available from PACCAR Parts.

Quantity	Part Number	Description
1	G11-6557	Brake Pedal Restraint Bracket
2	R34-6002-08045RHLK	Bolts
2	HWC12713	Nut Fasteners
2	Source Locally	Cable Ties (to secure wire harnesses near brake pedal)

Links

[23PBB Chassis List](#)

[23PBB Repair Procedure](#)

[23PBB US Customer Letter](#)

[23PBB Canada - English Customer Letter](#)

[23PBB Canada - French Customer Letter](#)

Revision History

04/28/2023 - Added warranty and procedures section and created procedural document that is linked in the Links section.

05/03/2023 - Converted from Interim to Final bulletin.