

23PBK - Safety Recall Cummins L9N Rear Lift Bracket Stud

 [Edit](#)  [Clone](#)

Number

23PBK / 23V749 / C2735

Description

Safety Recall Cummins L9N Rear Lift Bracket Stud

Subject

Safety Recall Cummins L9N Rear Lift Bracket Stud

Date

11/14/2023

Introduction

Cummins alerted Peterbilt to a defect which relates to motor vehicle safety in the 2024 Model 520 vehicles equipped with L9N engines. The rear lifting bracket may detach from the cylinder head while the engine is being

lifted, possibly causing the engine to swing or fall, potentially resulting in personal injury. Refer to **Cummins Recall C2735** for repair information.

Situation

PB--- 9 – 2024 Model 520 vehicles built from 08/01/2023 through 09/14/2023 equipped with Cummins L9N engines.

Resolution

Safety Recall

Service all chassis affected that enter your dealership, even if the customer has no issue with the chassis.

1. Review the attached chassis list for your dealer code and schedule your customer(s) for service if their chassis is on the list.
2. If you are not using Service Management to start repair orders, review SIR for "Complete" or "In Process" next to the "C2735" Cummins campaign code prior to performing this repair.
3. If you are not using Service Management to start repair orders, review SIR for "Complete" or "In Process" next to the C2735 campaign code prior to performing this repair.

Follow the procedures in Cummins C2735 Safety Recall to replace the rear lift bracket stud. Go to Cummins QuickServe and refer to the Cummins Recall – C2735.

Warranty

Go to Cummins QuickServe and refer to the Cummins Recall – C2735. File warranty claims through the Cummins warranty system. SIR will indicate chassis involved in this recall with the designator of "C2735" in the campaign field.

Procedure

Please follow your dealership's safety procedures and precautions to ensure the vehicle can be safely repaired and maintained.

Please refer to Cummins QuickServe for repair procedure. Reference **Cummins Recall C2735**.

Links

[23PBK - Chassis List](#)

[23PBK - Customer Letter](#)

[23PBK - Repair Procedure](#)