

Part 573 Safety Recall Report

24V-054

Manufacturer Name : Winnebago Towable

Submission Date : FEB 21, 2024

NHTSA Recall No. : 24V-054

Manufacturer Recall No. : CAM0000035



Manufacturer Information :

Manufacturer Name : Winnebago Towable

Address : 201 14th Street

Middlebury IN 46540

Company phone : 825-5250

Population :

Number of potentially involved : 5,214

Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2022-2023 Winnebago Micro Minnie, Micro Minnie FLX, Hike 200, & Minnie

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : All vehicles built between February 2022 and April 2023 with Suburban cooktops with backlit LED knobs built with subject circuit boards.

Production Dates : FEB 15, 2022 - APR 30, 2023

VIN Range 1 : Begin :

NR

End : NR

Not sequential

Description of Defect :

Description of the Defect : LED backlight circuit boards in Suburban cooktop ranges installed in certain Winnebago vehicles may fail without any prior warning.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : The failure may potentially lead to overheating of the LED backlight light, and in some cases, a thermal event without any prior warning.

Description of the Cause : Winnebago is currently investigating the root cause of the failure condition and will update this section within 5 working days after it obtains accurate information regarding the root cause.

Identification of Any Warning that can Occur : NR

Involved Components :

Component Name 1 : Suburban Cooktop

Component Description : Suburban 3 Burner Slide in Cooktop with backlit LED control knobs

Component Part Number : SCNB3B6REB

Supplier Identification :

Component Manufacturer

Name : Suburban Manufacturing

Address : 676 Broadway Street
Dayton Tennessee 37321

Country : United States

Chronology :

In June 2023, Winnebago was notified of two incidents related to melted LED light rings on stove knobs. An investigation was opened and the supplier, Suburban, was notified.

Winnebago continued to meet with the supplier over the next few months, working together to try and understand scope of the issue.. In January 2024, Winnebago escalated the issue to the Product Safety Committee. On January 26, 2024, the Product Safety Committee determined that the issue presents an unreasonable risk to safety.

Winnebago is aware of 6 thermal incidents that it believes may relate to the recall condition. Winnebago has received claims/notices regarding these incidents on the following dates: 9/8/2022, 6/15/2023, 6/23/2023, 9/7/2023, 10/6/2023, and 1/9/2023

Of those incidents, Winnebago is aware of 0 death or injuries.

Description of Remedy :

Description of Remedy Program : Reimbursement requests will follow the general reimbursement plan on file with NHTSA.

How Remedy Component Differs from Recalled Component : The remedy involves replacing the cooktop control panel with a revised version that does not include the LED backlit control knobs.

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : NR

Planned Dealer Notification Date : FEB 02, 2024 - FEB 09, 2024

Planned Owner Notification Date : MAR 29, 2024 - MAR 29, 2024

* NR - Not Reported