

# Part 573 Safety Recall Report

# 24V-295

**Manufacturer Name :** Winnebago Industries, Inc.**Submission Date :** MAY 29, 2024**NHTSA Recall No. :** 24V-295**Manufacturer Recall No. :** 184**Manufacturer Information :**

Manufacturer Name : Winnebago Industries, Inc.

Address : PO BOX 152  
605 W. Crystal Lake Rd. Forest City IA  
50436

Company phone : 1-641-585-3535

**Population :**

Number of potentially involved : 1,166

Estimated percentage with defect : 100 %

**Vehicle Information :**

Vehicle 1 : 2024-2024 Winnebago Minnie Winnie / Spirit

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles built with Suburban cooktop models with backlit LED knobs as Identified in Recall 24E-028.

Production Dates : JUN 29, 2023 - JUL 18, 2023

VIN Range 1 : Begin : NR End : NR  Not sequential

Vehicle 2 : 2022-2023 Winnebago Cambria

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles built with Suburban cooktop models with backlit LED knobs as Identified in Recall 24E-028.

Production Dates : MAR 03, 2022 - JUL 25, 2023

VIN Range 1 : Begin : NR End : NR  Not sequential

Vehicle 3 : 2022-2023 Winnebago Inspire

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles built with Suburban cooktop models with backlit LED knobs as Identified in Recall 24E-028.

Production Dates : APR 29, 2022 - MAR 20, 2023

VIN Range 1 : Begin : NR End : NR  Not sequential

Vehicle 4 : 2021-2023 Winnebago Vista / Sunstar

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles built with Suburban cooktop models with backlit LED knobs as Identified in Recall 24E-028.

Production Dates : AUG 21, 2020 - MAR 25, 2023

VIN Range 1 : Begin : NR End : NR  Not sequential

Vehicle 5 : 2023-2023 Winnebago Forza

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles built with Suburban cooktop models with backlit LED knobs as Identified in Recall 24E-028.

Production Dates : APR 26, 2022 - JUN 29, 2023

VIN Range 1 : Begin : NR End : NR  Not sequential

Vehicle 6 : 2024-2025 Winnebago Porto / Vita

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles built with Suburban cooktop models with backlit LED knobs as Identified in Recall 24E-028.

Production Dates : DEC 20, 2022 - APR 16, 2024

VIN Range 1 : Begin : NR End : NR  Not sequential

## Description of Defect :

Description of the Defect : LED backlight circuit boards in Suburban cooktop ranges installed in certain Winnebago vehicles may fail without any prior warning.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : The failure may potentially lead to overheating of the LED backlight, and in some cases, a thermal event without any prior warning.

Description of the Cause : The root cause was determined to be a manufacturing defect in the printed circuit board within the cooktop LED backlights.

Identification of Any Warning that can Occur : The failure can occur without warning.

## Involved Components :

Component Name 1 : Suburban Cooktop

Component Description : Suburban 3 Burner Slide in Cooktop with backlight LED control knobs

Component Part Number : Models 3532A, 3593A, 3599A

## Supplier Identification :

### Component Manufacturer

Name : Suburban Manufacturing

Address : 676 Broadway St

Dayton Tennessee 37321

Country : United States

## Chronology :

In June 2023, Winnebago of Indiana was notified of two incidents related to melted LED light rings on stove knobs. An investigation was opened and the supplier, Suburban, was notified. Winnebago of Indiana continued to meet with the supplier over the next few months, working together to try and understand scope of the issue. On or about April 22, 2024 it was determined that Winnebago Motorhomes will issue a recall after identifying motorhomes built with affected cooktops as described in Suburban Manufacturing Recall 24E-028. Winnebago Motorhomes has not received any claims and is aware of 0 deaths or injuries.

## Description of Remedy :

Description of Remedy Program : Reimbursement requests will follow the general reimbursement plan on file with NHTSA.

How Remedy Component Differs from Recalled Component : The remedy involves replacing the cooktop control panel with a revised version that does not include the LED backlight control knobs.

Identify How/When Recall Condition was Corrected in Production : The cooktop with backlit knobs has been replaced with a cooktop without backlit knobs.

## Recall Schedule :

Description of Recall Schedule : Recall schedule for notifications will be within the 60 day requirement.

Planned Dealer Notification Date : MAY 16, 2024 - MAY 16, 2024

Planned Owner Notification Date : JUN 25, 2024 - JUN 25, 2024

\* NR - Not Reported