

Part 573 Safety Recall Report

24V-334

Manufacturer Name : Winnebago Industries, Inc.**Submission Date :** MAY 13, 2024**NHTSA Recall No. :** 24V-334**Manufacturer Recall No. :** NR**Manufacturer Information :****Population :**

Manufacturer Name : Winnebago Industries, Inc.

Number of potentially involved : 1

 Address : PO BOX 152
 605 W. Crystal Lake Rd. Forest City IA
 50436

Estimated percentage with defect : 100 %

Company phone : 1-641-585-3535

Vehicle Information :

Vehicle 1 : 2020-2020 Winnebago Commercial Vehicle

Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER

Power Train : DIESEL

Descriptive Information : One VIN impacted by equipment recall 24E-017.

Production Dates : AUG 22, 2022 - AUG 22, 2022

VIN Range 1 : Begin : 4UZACJFC5PCUF3341 End : 4UZACJFC5PCUF3341 ☐ Not sequential**Description of Defect :**

Description of the Defect : Per BraunAbility recall 24E-017 notification, premature outer barrier (OB) deployment.

FMVSS 1 : 403 - Platform lift systems

FMVSS 2 : NR

Description of the Safety Risk : Per BraunAbility recall 24E-017 notification, premature outer barrier deployment can result in lack of platform wheelchair retention which could result in an increased risk of personal injury.

Description of the Cause : Per BraunAbility recall 24E-017 notification, location of the ground sensing pressure switch was the cause.

Identification of Any Warning that can Occur : None

Involved Components :

Component Name 1 : Switch Pressure 25/75 PS71-20-4MSZ-B-SP

Component Description : Ground Sensing Pressure Switch

Component Part Number : 406464

Component Name 2 : Valve-Flow Control 0.45 GPM (PCM63-2-.45)

Component Description : Cylinder Flow Control Valve

Component Part Number : 37473

Supplier Identification :

Component Manufacturer

Name : The Braun Corporation DBA BraunAbility

Address : 631 W. 11th Street
Winamac Indiana 46996

Country : United States

Chronology :

On March 13, 2024, Winnebago was notified by BraunAbility of a recall impacting certain model NULC65S32X60I lifts manufactured between December 9, 2021, and July 13, 2023.

After review, it was determined that there was one Winnebago customer impacted by this recall. That customer was contacted and the remedy was completed.

This notice of defect is being filed in accordance with 49 CFR 573 requirements.

There are no known incidents associated with this issue.

Description of Remedy :

| | |
|--|---|
| Description of Remedy Program : | PerBraunAbility: The process of installing the pressure switch was corrected in production starting 2/13/2024. A revised manufacturing instruction was approved and published to production on 2/13/2024. |
| | Reimbursement requests will follow the general reimbursement plan on file with NHTSA. |
| How Remedy Component Differs from Recalled Component : | Per BraunAbility: Relocation of the switch from after the cylinder flow control valves to before the cylinder flow valve. A certified dealer will handle repairs of all impacted lifts. Dealer will be paid through warranty for labor time to complete the necessary repair of each product. |
| Identify How/When Recall Condition was Corrected in Production : | Per BraunAbility: The process of installing the pressure switch was corrected in production starting 2/13/2024. A revised manufacturing instruction was approved and published to production on 2/13/2024. |

Recall Schedule :

| | |
|------------------------------------|--|
| Description of Recall Schedule : | No dealers impacted. One commercial customer was impacted and has already been notified. |
| Planned Dealer Notification Date : | MAY 20, 2024 - MAY 20, 2024 |
| Planned Owner Notification Date : | MAY 20, 2024 - MAY 20, 2024 |

* NR - Not Reported